

PHOTOGRAPHS


PHOTOGRAPH #1



**BUILDING 24
SECTION G**

Contractor has made corrections to Tyvek HomeWrap by extending Dupont flashing at head of window past jamb flashing and extending jamb flashing past window sill.

PHOTOGRAPH #2

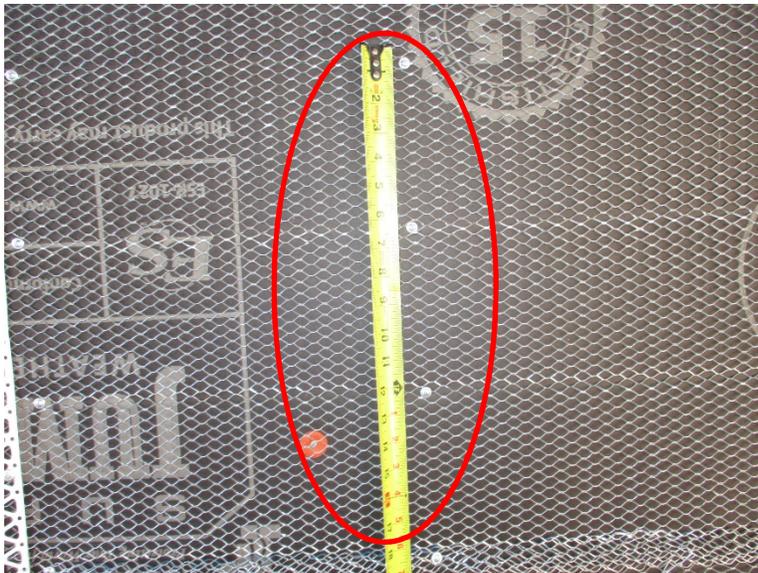

**BUILDING 24
SECTION D**

Stucco lath attached to wall studs at framing members no more that seven inches.

PHOTOGRAPH #3



**BUILDING 24
SECTION D**

Stucco lath overlapped minimum one-inch wire to wire and accessories flanges attached at no more than seven-inch intervals.

PHOTOGRAPH #4



**BUILDING 24
SECTION D**

Stucco lath and accessories attached with wafer pan head 8 x 1-1/4-inch screws.

PHOTOGRAPH #5



**BUILDING 24
SECTION B**

JUMBO TEX WRB overlapped minimum of two inches at horizontal overlaps.

PHOTOGRAPH #6



**BUILDING 24
SECTION H**

Window head flashing and Tyvek HomeWrap has been completed at new windows and ready for JUMBO TEX WRB.

PHOTOGRAPH #7



**BUILDING 24
SECTION E**

Bora - Care terminate treatment has been applied at framing members.

PHOTOGRAPH #8



**BUILDING 24
SECTION F**

Framing straps at balcony wall have been installed and approved for termite treatment and insulation.

PHOTOGRAPH #9



**BUILDING 24
SECTION F**

Contractor has completed sheathing in preparation for Tyvek WRB and window installation.

PHOTOGRAPH #10



**BUILDING 24
ATTIC 2425**

Truss scabs, gusset repairs, fire rated board and fire caulking repairs completed by contractor and confirmed by Delta.

PHOTOGRAPH #11



**BUILDING 24
ATTIC 2423**

Truss scabs, gusset repairs, fire rated board and fire caulking repairs completed by contractor and confirmed by Delta.

PHOTOGRAPH #12



**BUILDING 24
ATTIC 2426**

Truss scabs, gusset repairs, fire rated board and fire caulking repairs completed by contractor and confirmed by Delta.

PHOTOGRAPH #13



**BUILDING 24
ATTIC 2424**

Truss scabs, gusset repairs, fire rated board and fire caulking repairs completed by contractor and confirmed by Delta.

PHOTOGRAPH #14



**BUILDING 24
SECTION B**

Unit #2415 - Contractor has repaired window flashing at interior sill and jambs by adding additional flashing.

PHOTOGRAPH #15



**BUILDING 24
SECTION B**

Unit #2415 - contractor has repaired window flashing at interior sill and jambs by adding additional flashing and re-installing interior sealant bead.

PHOTOGRAPH #16



**BUILDING 26
SECTION B**

Contractor has continued to demo exposing damage at balcony framing and built up beam.

PHOTOGRAPH #17



**BUILDING 26
SECTION B**

Contractor has continued to demo exposing damage at balcony framing and built up beam.

PHOTOGRAPH #18



**BUILDING 26
ATTIC 2622**

Multiple broken trusses and damage noted during repairs.

PHOTOGRAPH #19



**BUILDING 26
ATTIC 2622**

Multiple broken trusses and damages being repaired.

PHOTOGRAPH #20



**BUILDING 24
ATTIC 2426**

Multiple broken trusses and damage noted prior to repairs.