

PHOTOGRAPHS

PHOTOGRAPH #1



**BUILDING 24
SECTION A**

Contractor is applying sealants at opening and at transitions in preparation for painting.

PHOTOGRAPH #2



**BUILDING 24
SECTION B**

Stucco corner bead has been notched out at balcony kick out flashing improperly. Corner bead is to follow straight through and will require repair at several locations.

PHOTOGRAPH #3



**BUILDING 24
SECTION B**

Leaking hose has damaged new stucco.

PHOTOGRAPH #4



**BUILDING 24
SECTION E**

Stucco sub-contractor has begun stucco with scratch coat application.


PHOTOGRAPH #5



**BUILDING 24
SECTION F**

Sub-contractor began scratch coat of stucco prior to completing sealants at accessories transition as specified and has not fully embedded scratch coat into corner beading.

PHOTOGRAPH #6

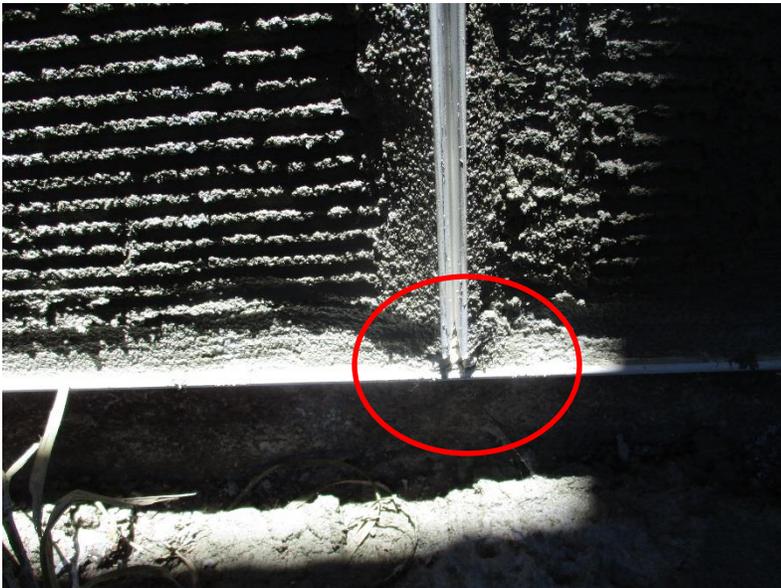

**BUILDING 24
SECTION F**

Sub-contractor has made corrections at areas not sealed prior to scratch coat of stucco and fully embedded scratch coat into accessories.

PHOTOGRAPH #7



**BUILDING 24
SECTION F**

Sub-contractor has made corrections at areas not sealed prior to scratch coat of stucco and fully embedded scratch coat into accessories.

PHOTOGRAPH #8



**BUILDING 24
SECTION G**

Stucco sub-contractor has applied three coat stucco system and in process of moisture curing.

PHOTOGRAPH #9



**BUILDING 26
SECTION H**

Sub-contractor has applied JumboTex weather barrier and begun stucco accessories installation.

PHOTOGRAPH #10



**BUILDING 26
SECTION A**

Contractor has completed window installation by installing head flashing and Dupont straight flash at head and jambs.


PHOTOGRAPH #11



**BUILDING 26
SECTION B**

Simpson Strong hardware connectors and strapping has been installed and termite treatment has been applied in preparation for new sheathing.

PHOTOGRAPH #12

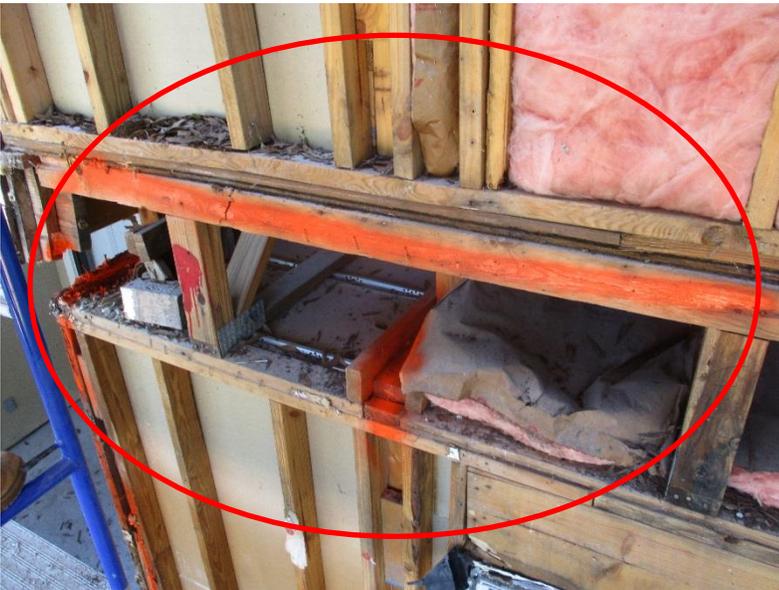

**BUILDING 26
SECTION C**

Framing damage has been identified and marked for repairs. This subfloor area is damaged and missing framing support.

PHOTOGRAPH #13



**BUILDING 26
SECTION C**

Framing damage has been identified and marked for repairs. This framing stud is bowed away from wall and will be replaced.

PHOTOGRAPH #14



**BUILDING 26
SECTION C**

Framing damage has been identified and marked for repairs.

PHOTOGRAPH #15



**BUILDING 26
SECTION D**

Framing damage has been identified and marked for repairs.

PHOTOGRAPH #16



**BUILDING 26
SECTION D**

Framing damage has been identified and marked for repairs

PHOTOGRAPH #17



**BUILDING 26
SECTION D**

Framing damage has been identified and marked for repairs.