

PHOTOGRAPHS

PHOTOGRAPH #1



BUILDING 21 SECTION A

Removal of all materials, equipment, portable toilet, and final cleanup of grounds will be performed as part of punch list.

PHOTOGRAPH #2



BUILDING 21 SECTION A

Loose soffit will be properly fastened, caulked, and touched up as part of punch list.

PHOTOGRAPH #3



**BUILDING 21
SECTION B**

Paint and stucco details noted for touch up during walk through with management to develop punch list.

PHOTOGRAPH #4



**BUILDING 21
SECTION B**

Final cleanup of grounds will be performed as part of punch list.

PHOTOGRAPH #5



**BUILDING 21
SECTION D**

Final cleanup of grounds will be performed as part of punch list.

PHOTOGRAPH #6



**BUILDING 21
SECTION E**

Hole in sealant will be filled and touched up as part of punch list.

PHOTOGRAPH #7



**BUILDING 21
SECTION F**

Kick out flashing gaps will be filled as part of punch list.

PHOTOGRAPH #8



**BUILDING 20
SECTION D**

Framing and gable end reinforcement repairs in place. Strapping and Simpson Strong-Tie hardware installation in progress.

PHOTOGRAPH #9



**BUILDING 20
SECTION D**

Wood framing repairs at window openings and window headers completed and quantified.

PHOTOGRAPH #10



**BUILDING 20
SECTION D**

Wood framing repairs at window openings and window headers completed and quantified.

PHOTOGRAPH #11



**BUILDING 20
SECTION D**

Pest control contractor spraying BoraCare termite treatment on wall framing.

PHOTOGRAPH #12



**BUILDING 20
SECTION D**

Pest control contractor spraying BoraCare termite treatment on wall framing.

PHOTOGRAPH #13



**BUILDING 20
SECTION E**

Damaged wood framing at window openings identified and marked for repairs.

PHOTOGRAPH #14



**BUILDING 20
SECTION F**

Damaged wood framing at balcony and patio framing identified and marked for repairs.

PHOTOGRAPH #15



**BUILDING 20
SECTION G- BREEZEWAY**

Removal of existing stucco and Thermoply sheathing exposed damaged framing that partially collapsed when stucco was removed. Immediate shoring is required until repairs are in place.

PHOTOGRAPH #16



**BUILDING 20
SECTION G- BREEZEWAY**

Removal of existing stucco and Thermoply sheathing exposed damaged framing that partially collapsed when stucco was removed. Immediate shoring is required until repairs are in place.

PHOTOGRAPH #17



**BUILDING 20
SECTION G-BREEZEWAY**

Contractor has provided shoring beam where damages are causing collapse.

PHOTOGRAPH #18



**BUILDING 20
SECTION G-BREEZEWAY**

Contractor has provided shoring beam where damages are causing collapse.

PHOTOGRAPH #19



**BUILDING 20
SECTION G**

Roof sheathing damage and evidence of active roof leaks.