

PHOTOGRAPHS

PHOTOGRAPH #1



BUILDING 1 SECTION H

Gable end wall bracing, strapping, and framing connectors repairs in progress.

PHOTOGRAPH #2



BUILDING 1 SECTION H

2"X6" SYP reinforcement framing studs installed at gable end.

PHOTOGRAPH #3



**BUILDING 1
SECTION H**

Nailing assessed for compliance with drawings and specifications is measured at 6" O.C..

PHOTOGRAPH #4



**BUILDING 1
SECTION H**

Simpson Strong-Tie MST49 straps attached to studs at 48" O.C. as per drawing and specifications.

PHOTOGRAPH #5



**BUILDING 1
SECTION G**

Simpson Strong-Tie SP1 connector attached to studs and bottom plate @16" O.C. as per drawing and specifications.

PHOTOGRAPH #6



**BUILDING 1
SECTION G**

Simpson Strong-Tie SP1 connector attached to studs and bottom plate @16" O.C. as per drawing and specifications.

PHOTOGRAPH #7



**BUILDING 1
SECTION G**

Simpson Strong-Tie SP1 connectors and Titen HD anchors installation in progress.

PHOTOGRAPH #8



**BUILDING 1
SECTION F**

Wood framing repairs in progress at balconies, breezeways, and exterior walls.

PHOTOGRAPH #9



**BUILDING 1
SECTION F**

Double window header and top plate replaced.

PHOTOGRAPH #10



**BUILDING 1
SECTION F**

Balcony column replaced as part of full balcony repairs.


PHOTOGRAPH #11



**BUILDING 1
SECTION F**

Built up beam replacement performed as part of full balcony remove and repair.

PHOTOGRAPH #12

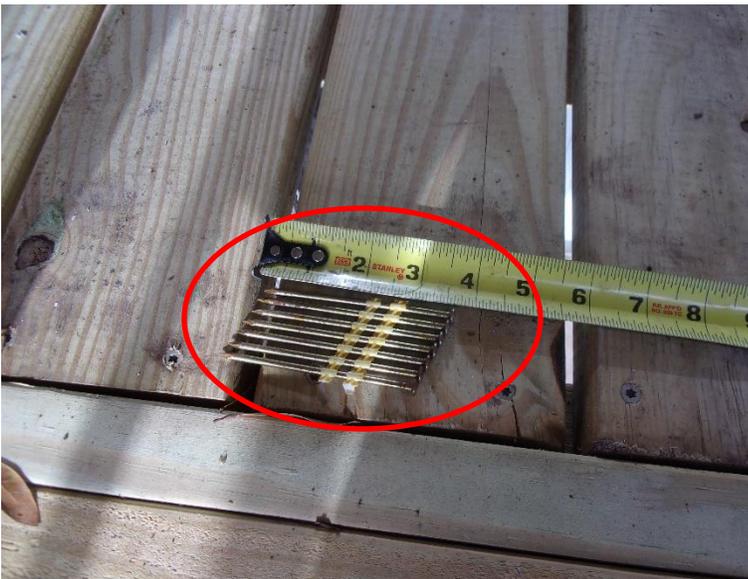

**BUILDING 1
SECTION F**

3 1/2" 16d common nails used for framing repairs.

PHOTOGRAPH #13



**BUILDING 1
SECTION F**

Full 2"x6" deck boards removed and replaced.

PHOTOGRAPH #14



**BUILDING 1
SECTION F**

Partial selected 2"x6" deck boards removed and replaced.

PHOTOGRAPH #15



**BUILDING 1
SECTION E-STAIRWAY**

Existing stucco, pressure cleaned in preparation for primer and finish painting.

PHOTOGRAPH #16



**BUILDING 1
SECTION E-STAIRWAY**

Bottom step steel angle has deteriorated and failed.

PHOTOGRAPH #117



**BUILDING 1
SECTION E-STAIRWAY**

Bottom step steel angle has deteriorated and failed.

PHOTOGRAPH #18



**BUILDING 1
SECTION E-STAIRWAY**

Stairway steel beam stringer has significant loss at base and fastening connection to concrete decking.

PHOTOGRAPH #19



**BUILDING 1
SECTION E**

Window framing king stud replacement due to existing framing not plum and straight.

PHOTOGRAPH #20



**BUILDING 1
SECTION E**

Window framing king stud replacement due to existing framing not plum and straight.