

PHOTOGRAPHS

PHOTOGRAPH #1



**BUILDING 8
UNIT #822 ATTIC**

Contractor has performed gusset repairs and scab repairs at trusses as per drawings.

PHOTOGRAPH #2



**BUILDING 8
UNIT #822 ATTIC**

Fire caulk applied at open penetrations with 3M fire barrier sealant.

PHOTOGRAPH #3



**BUILDING 8
UNIT #822 ATTIC**

Fire caulk applied at open penetrations with 3M fire barrier sealant.

PHOTOGRAPH #4



**BUILDING 8
UNIT #823 ATTIC**

Contractor has performed gusset repairs and scab repairs at trusses as per drawings.

PHOTOGRAPH #5



**BUILDING 8
UNIT #823 ATTIC**

Fire rated gypsum board installed at holes in existing fire walls.

PHOTOGRAPH #6



**BUILDING 8
UNIT #825 ATTIC**

Damaged trusses repaired with 2x4 scabs as per drawings and details.

PHOTOGRAPH #7



**BUILDING 8
UNIT #825 ATTIC**

Fire rated gypsum board and fire caulk installed at holes and penetrations in existing fire walls.

PHOTOGRAPH #8



**BUILDING 8
UNIT #826 ATTIC**

Damaged trusses repaired with 2x4 scabs as per drawings and details.

PHOTOGRAPH #9



**BUILDING 8
UNIT #826 ATTIC**

Fire caulk applied at open penetrations with 3M fire barrier sealant.

PHOTOGRAPH #10



**BUILDING 8
UNIT #827 ATTIC**

Gusset repairs performed at truss damage and truss connectors as per drawings.

PHOTOGRAPH #11



**BUILDING 8
UNIT #827 ATTIC**

Gusset fasteners 1 1/2" Simpson SD connector screws.

PHOTOGRAPH #12



**BUILDING 8
UNIT #827 ATTIC**

Damaged trusses repaired with 2x4 scabs as per drawings and details.

PHOTOGRAPH #13



**BUILDING 13
SECTION F**

RLJ priming and finish coating new stucco with Florida Paints Glades Exterior 100% Acrylic Paint.

PHOTOGRAPH #14



**BUILDING 13
SECTION F**

RLJ priming and finish coating new stucco with Florida Paints Glades Exterior 100% Acrylic Paint.

PHOTOGRAPH #15



**BUILDING 13
SECTION E**

RLJ priming and finish coating new stucco with Florida Paints Glades Exterior 100% Acrylic Paint.


PHOTOGRAPH #16



**BUILDING 13
SECTION D**

Stucco Contractor applying new Jumbo Tex water resistant barrier over Tyvek HomeWrap WRB.

PHOTOGRAPH #17

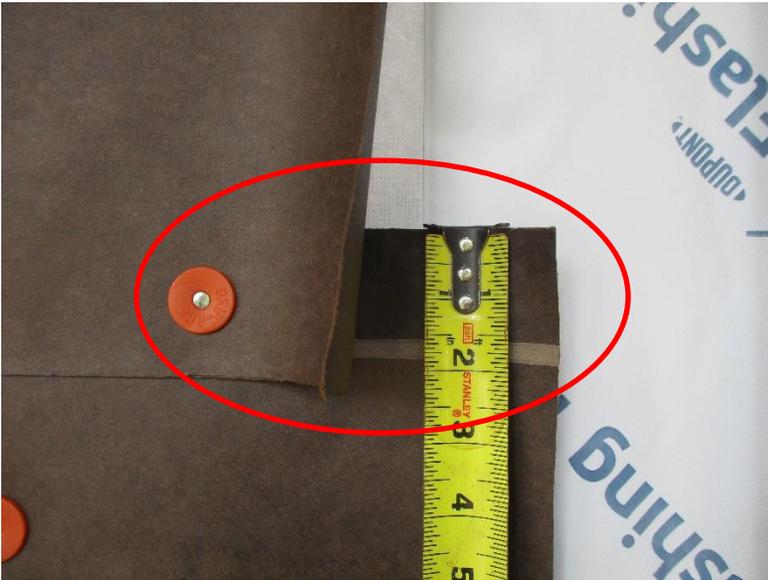

**BUILDING 13
SECTION D**

Jumbo Tex WRB overlapped 2" as per specifications and manufacturers recommendations.

PHOTOGRAPH #18



**BUILDING 13
SECTION D**

New plywood soffit installed and prepared for priming and painting.

PHOTOGRAPH #19



**BUILDING 13
SECTION B**

Preexisting water damaged roof sheathing. Owners' roofers to do repairs.

PHOTOGRAPH #20



**BUILDING 13
SECTION A**

Preexisting water damaged roof sheathing. Owners' roofers to do repairs.

PHOTOGRAPH #21



**BUILDING 18
SECTION F**

Delta marking existing wood damage for contractor to do repairs.

PHOTOGRAPH #22



**BUILDING 13
SECTION F**

Damaged window header floor truss, bottom plate and framing studs marked for repairs.

PHOTOGRAPH #23



**BUILDING 13
SECTION F**

Damaged window header floor truss, bottom plate and framing studs marked for repairs.

PHOTOGRAPH #24



**BUILDING 18
SECTION F**

Damaged window header and framing studs marked for repairs.