

PHOTOGRAPH #1



**BUILDING 11
SECTION G**

Contractor has not yet installed Simpson #SDW22458 screws @ ledger and corner blocking as per drawings.

PHOTOGRAPH #2



**BUILDING 11
SECTION D**

Stucco Sub-contractor installing vinyl stucco accessories over Jumbo Tex 60 water resistant barrier at gable end wall.

PHOTOGRAPH #3



**BUILDING 11
SECTION D**

Contractor grinding loose paint and corrosion from balcony railings in preparation for new paint system.

PHOTOGRAPH #4



**BUILDING 11
UNIT #1117- SECTION C**

Contractor removing bedroom windows that failed independent testing agency water infiltration testing.

PHOTOGRAPH #5



**BUILDING 11
UNIT #1117- SECTION C**

Contractor removing bedroom windows that failed independent testing agency water infiltration testing.


PHOTOGRAPH #6



**BUILDING 11
UNIT #1117- SECTION C**

Contractor installing new Dupont flashings at window opening as per drawings and window manufacturers requirements.

PHOTOGRAPH #7

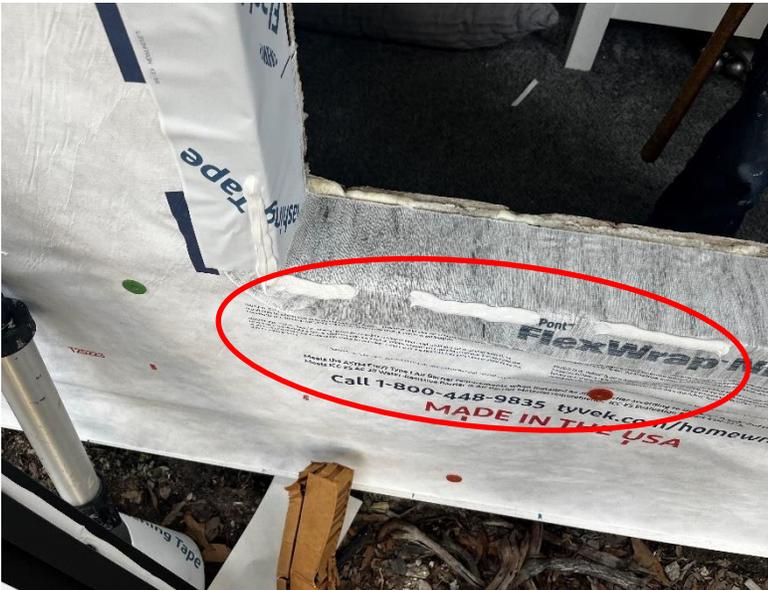

**BUILDING 11
UNIT #1117- SECTION C**

New sealant installed at sill allowing space for weeping as per installation drawings.

PHOTOGRAPH #8



**BUILDING 11
UNIT #1117- SECTION C**

New sealant installed at back side of window mounting flange as per installation drawings.

PHOTOGRAPH #9



**BUILDING 11
SECTION C**

Stucco Sub-contractor installing vinyl stucco accessories around new window, over Jumbo Tex 60 water resistant barrier.

PHOTOGRAPH #10



**BUILDING 11
UNIT #1123 - SECTION B**

New PGT window installed with Dupont flashing details as per drawings and specifications.

PHOTOGRAPH #11



**BUILDING 11
UNIT #1121 - ATTIC**

Contractor has performed scab repairs at damaged trusses.

PHOTOGRAPH #12



**BUILDING 11
UNIT #1121 - ATTIC**

Contractor has performed scab repairs at damaged trusses.

PHOTOGRAPH #13



**BUILDING 11
UNIT #1121 - ATTIC**

Contractor has performed fire wall repairs
at base of fire wall.

PHOTOGRAPH #14



**BUILDING 12
SECTION H**

New Florida Paints primer and finish
applied to new stucco at gable end wall.


PHOTOGRAPH #15



**BUILDING 12
SECTION G**

New Florida Paints primer and finish applied to new stucco.

PHOTOGRAPH #16

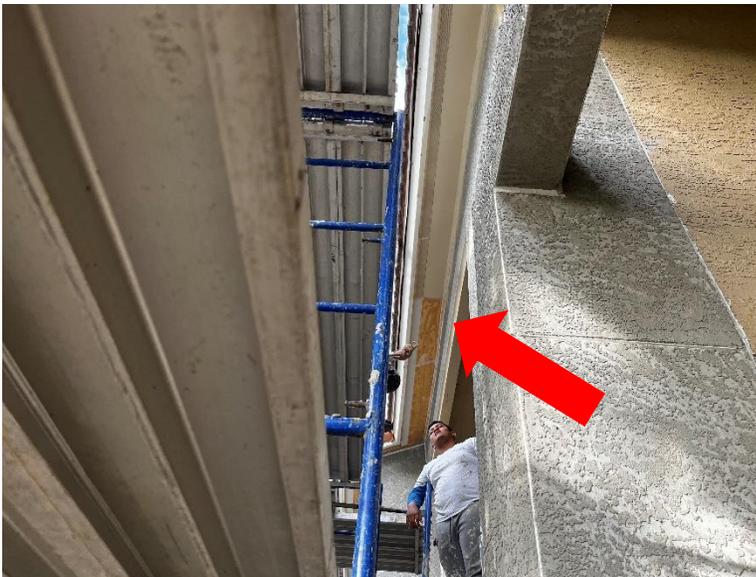

**BUILDING 12
SECTION E**

Contractor priming new wood soffit with Florida Paint Legacy UltraPrime all-purpose primer.

PHOTOGRAPH #17



**BUILDING 12
SECTION D**

Framing inspected and marked for repairs by Delta.

PHOTOGRAPH #18



**BUILDING 12
SECTION D**

Second floor bottom plates and intermediate floor framing marked for repairs.

PHOTOGRAPH #19



**BUILDING 12
SECTION D**

Window framing and headers marked for repairs.

PHOTOGRAPH #20



**BUILDING 12
SECTION C**

Framing inspected and marked for repairs by Delta.

PHOTOGRAPH #21



**BUILDING 12
UNIT #1227- SECTION C**

Damaged balcony built up beam marked for repairs.

PHOTOGRAPH #22



**BUILDING 12
SECTION C**

Roof sheathing damaged by roof leaks not part of wall repair work and will be repaired by owners roofing contractors.

PHOTOGRAPH #23



**BUILDING 12
SECTION A**

Contractor has covered open walls with plastic tarps for weather protection during repairs.