

PHOTOGRAPHS

PHOTOGRAPH #1



**BUILDING 2
SECTION E**

Balcony railings welded top rail angles attached and installed through stucco to wood framing.

PHOTOGRAPH #2



**BUILDING 2
SECTION A**

Balcony railings welded top rail angles attached and installed through stucco to wood framing.

PHOTOGRAPH #3



**BUILDING 2
SECTION A**

Two stair locations have not yet been welded and replaced.

PHOTOGRAPH #4



**BUILDING 2
SECTION B**

Construction debris have not yet been removed and site final cleaned.

PHOTOGRAPH #5



**BUILDING 3
SECTION B**

15/32" plywood sheathing applied over new repairs.

PHOTOGRAPH #6



**BUILDING 3
SECTIONS B**

Missing fasteners marked during inspection at new plywood sheathing.

PHOTOGRAPH #7



**BUILDING 3
SECTION B**

Missing fasteners installed by contractor at new plywood sheathing.


PHOTOGRAPH #8



**BUILDING 3
SECTION C**

Fastening of new sheathing to framing inspected for nail spacing at perimeters and framing studs.

PHOTOGRAPH #9

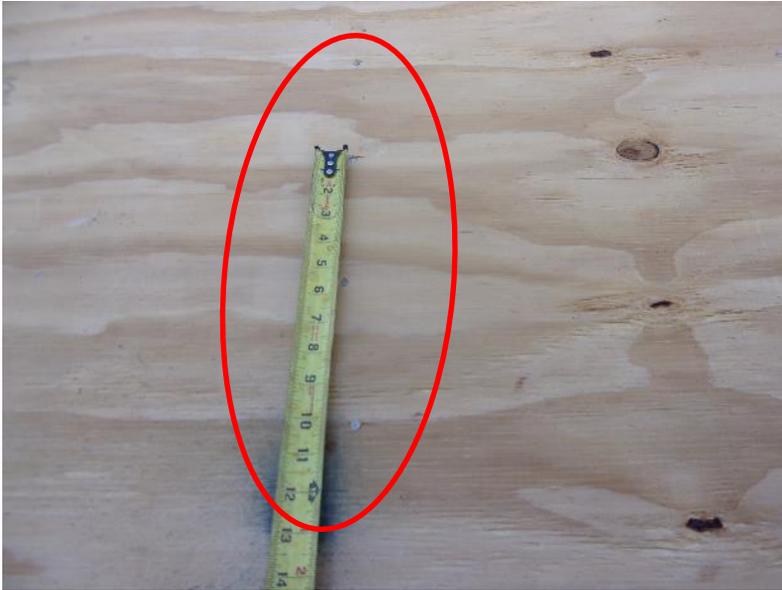

**BUILDING 3
SECTION C**

Fastening of new sheathing to framing inspected for nail spacing at perimeters and framing studs.

PHOTOGRAPH #10



**BUILDING 3
SECTION C**

Fastening of new sheathing to framing inspected for nail spacing at perimeters and framing studs.

PHOTOGRAPH #11



**BUILDING 3
SECTION D**

Missing fasteners marked and corrected during inspection at new plywood sheathing.

PHOTOGRAPH #12



**BUILDING 3
SECTION D**

BASF urethane sealant applied at plywood to bottom plate and existing concrete slab.

PHOTOGRAPH #13



**BUILDING 3
SECTION F**

Contractor painting patio stucco and overhead wood with Florida Paint Ultra Exterior Supercoat.

PHOTOGRAPH #14



**BUILDING 3
SECTION F**

Contractor painting patio stucco and overhead wood with Florida Paint Ultra Exterior Supercoat.

PHOTOGRAPH #15



**BUILDING 3
SECTION G**

Mildew at overhead wood where contractor was preparing to paint. Delta instructed that these surfaces require mildew and soil removal prior to painting as per specification and manufactures instructions.

PHOTOGRAPH #16



**BUILDING 3
SECTION G**

Contractor has cleaned wood over head at patios in preparation to paint as per specifications and manufactures instructions.

PHOTOGRAPH #17



**BUILDING 6
SECTION H**

New framing repairs at window openings,
and wall framing, quantified with
contractor.

PHOTOGRAPH #18



**BUILDING 6
SECTION H**

New framing repairs at window openings,
and wall framing, quantified with
contractor.

PHOTOGRAPH #19



**BUILDING 6
SECTION G- UNIT 612**

Marked termite damage extending into patio walls at **Unit # 612**.

PHOTOGRAPH #20



**BUILDING 6
SECTION G- UNIT 622**

Damaged decking at balcony of **Unit # 622** will require removal of owner's tile from deck.

PHOTOGRAPH #21



**BUILDING 6
SECTION G**

Contractor in process of grinding rust and peeling paint from stairway railings in preparation for primer and paint.

PHOTOGRAPH #22



**BUILDING 6
SECTION E**

Contractor in process of grinding rust and peeling paint from stairway railings in preparation for primer and paint