

PHOTOGRAPH #1



**BUILDING 12
INTERIOR PUNCH LIST**

Walked interior of building with Contractor and developed an itemized punch list.

PHOTOGRAPH #2



**BUILDING 9
SECTION D**

Stucco sub-contractor has completed three coat 7/8" stucco system as per specifications.

PHOTOGRAPH #3



**BUILDING 9
SECTION C**

Stucco sub-contractor applying finish texture coat of stucco.

PHOTOGRAPH #4



**BUILDING 9
SECTION B**

Stucco sub-contractor has protected the new PGT windows and applied scratch and brown coats of stucco.

PHOTOGRAPH #5



**BUILDING 9
SECTION A**

Self-furring galvanized lath and new vinyl stucco accessories installed as per drawings and specifications.

PHOTOGRAPH #6



**BUILDING 9
SECTION A**

New plywood soffit and vinyl soffit screen installed and prepared for prime and paint.

PHOTOGRAPH #7



**BUILDING 15
SECTION H**

Tyvek HomeWrap lifted for installation of vinyl weep stucco stop accessory.

PHOTOGRAPH #8



**BUILDING 15
SECTION H**

Soil has not been regarded away from existing footing as per drawings, not allowing for proper installation of weep screed termination.


PHOTOGRAPH #9



**BUILDING 15
SECTION G**

New PGT windows installed as per drawings and DuPont flashing recommendations.

PHOTOGRAPH #10

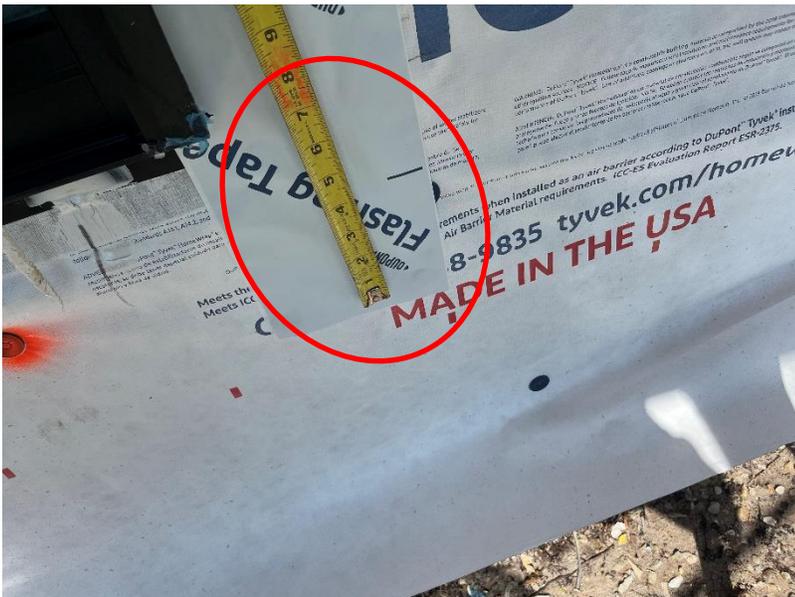

**BUILDING 15
SECTION G- UNIT #1512**

DuPont Flashing tape extends the required 6" past window framing as per drawings.


PHOTOGRAPH #11



**BUILDING 15
SECTION G-BREEZEWAY**

Gaps in Tyvek HomeWrap require repairs with new overlaps and / or Dupont FlexWarp flashing repairs as per Dupont details.

PHOTOGRAPH #12

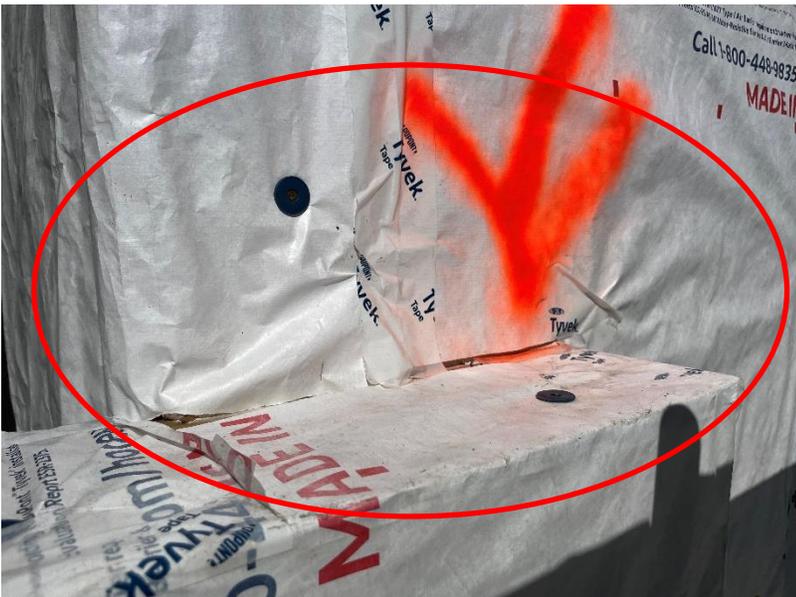

**BUILDING 15
SECTION E- BREEZEWAY**

Gaps in Tyvek HomeWrap require repairs with new overlaps and / or Dupont FlexWarp flashing repairs as per Dupont details.

PHOTOGRAPH #13



**BUILDING 15
SECTION E- BREEZEWAY**

Gaps in Tyvek HomeWrap require repairs with new overlaps and / or Dupont FlexWarp flashing repairs as per Dupont details.

PHOTOGRAPH #14



**BUILDING 15
SECTION D**

Contractor has begun repairs at gable end reinforcement and Delta marked damaged framing for repairs.

PHOTOGRAPH #15



**BUILDING 15
SECTION D**

New 2x6 L-Scab reinforcement attached with 10d nails at 6" O.C. as per drawings.

PHOTOGRAPH #16



**BUILDING 15
SECTION D**

Damage framing at studs, top plates and subflooring marked for repairs.

PHOTOGRAPH #17



**BUILDING 15
SECTION C**

Damaged window headers and window framing marked for repairs.

PHOTOGRAPH #18



**BUILDING 15
SECTION B- UNIT 1525**

Balcony framing built up repairs and deck boards marked for repairs.

PHOTOGRAPH #19



**BUILDING 15
SECTION B- UNIT 1523**

Balcony framing built up repairs and deck boards marked for repairs.

PHOTOGRAPH #20



**BUILDING 15
SECTION B**

Window header at 2nd level damaged by termites marked for removal and replacement.