

PHOTOGRAPHS

PHOTOGRAPH #1



BUILDING 24 BALCONY RAILINGS

Top railing angles have been placed, fastened to wall and paint touched up.

PHOTOGRAPH #2



BUILDING 24 SECTION F

Water hose bib will require sealant at penetration through stucco.

PHOTOGRAPH #3



**BUILDING 24
SECTION F- UNIT #2426**

New railing for balcony has not been delivered for installation.

PHOTOGRAPH #4



**BUILDING 24
SECTION D**

Pre-punch by Delta identified repair to be made at soffit where voids exist.

PHOTOGRAPH #5



**BUILDING 24
SECTION A**

Pre-punch by Delta identified repair to be made at soffit where voids exist.

PHOTOGRAPH #6



**BUILDING 24
SECTION E**

Screen enclosures are being installed at previously screened areas.

PHOTOGRAPH #7



**BUILDING 26
SECTION H**

Contractor has primed and painted stucco.

PHOTOGRAPH #8



**BUILDING 26
SECTION A**

Contractor has begun to prime new stucco.

PHOTOGRAPH #9



**BUILDING 26
SECTION B**

Sub-Contractor has applied a three coats stucco system and in process of moisture curing.

PHOTOGRAPH #10



**BUILDING 26
SECTION C**

Stucco sub-contractor has installed JumboTex WRB, stucco accessories and lath in preparation for stucco application.

PHOTOGRAPH #11



**BUILDING 26
SECTION D**

Stucco sub-contractor installing accessories and lath in preparation for stucco.


PHOTOGRAPH #12



**BUILDING 26
SECTION E**

Tyvek, flashings and windows have been installed.

PHOTOGRAPH #13

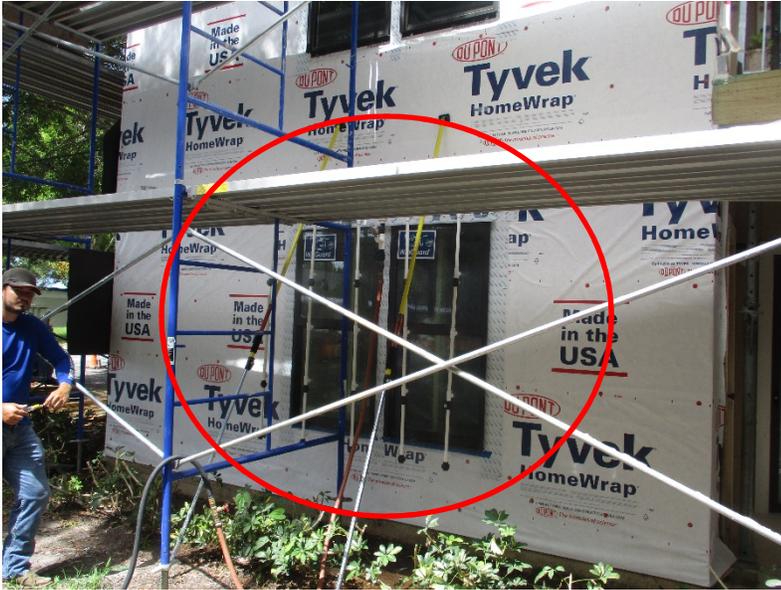

**BUILDING 26
UNIT 2418- WATER TESTING**

Independent Testing Agency setting up for ASTM E 1105 field testing.

PHOTOGRAPH #14



**BUILDING 26
UNIT 2418- WATER TESTING**

ASTM E 1105 testing performed at bedroom double window section E passed with no leaks.

PHOTOGRAPH #15



**BUILDING 26
UNIT 2418- WATER TESTING**

ASTM E 1105 testing performed at bedroom double window section D passed with no leaks.

PHOTOGRAPH #16



**BUILDING 26
UNIT 2418 – SECTION D**

Dupont flashings installed as per manufacturer's instructions.

PHOTOGRAPH #17



**BUILDING 26
SECTION F**

Bora-Care termite treatment has been applied in preparation for sheathing.

PHOTOGRAPH #18



**BUILDING 26
SECTION F**

Balconies and framed walls have been repaired and Simpson Strong connectors are in place.

PHOTOGRAPH #19



**BUILDING 26
SECTION F**

Pressure treated lumber used at base plate applications.

PHOTOGRAPH #20



**BUILDING 26
SECTION F**

Pressure treated plywood used at lower section of sheathing.

PHOTOGRAPH #21



**BUILDING 26
SECTION F**

Owens Corning R-13 insulation being installed where missing or damaged prior to sheathing application.