

PHOTOGRAPHS

PHOTOGRAPH #1



**BUILDING 23
UNIT #2325- ATTIC**

Contractor has removed fire wall board for review of termite damage.

PHOTOGRAPH #2



**BUILDING 23
UNIT #2325- ATTIC**

Contractor has removed fire wall board for review of termite damage.


PHOTOGRAPH #3



**BUILDING 21
SECTION D**

Tyvek WRB installed over new sheathing. Dupont / Tyvek flashing installed at window openings and new PGT windows installed.

PHOTOGRAPH #4

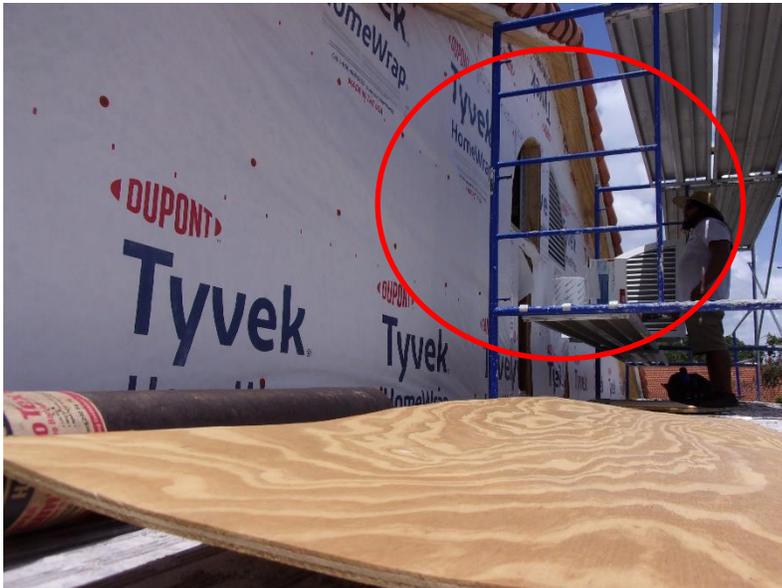

**BUILDING 21
SECTION D**

Dupont / Tyvek flashings being installed at framing opening for new attic louvered vents.

PHOTOGRAPH #5



**BUILDING 21
SECTION D**

Stucco sub-contractor has applied JumboTex secondary water-resistant barrier and in process of installing stucco accessories.

PHOTOGRAPH #6



**BUILDING 21
SECTION D**

Stucco accessories sealed at junctures and transitions with approve sealant.

PHOTOGRAPH #7



**BUILDING 21
SECTION C**

Contractor has flashed window opening with Dupont / Tyvek flashings as recommended by manufacturers.

PHOTOGRAPH #8



**BUILDING 21
SECTION C**

Dupont / Tyvek flashings application inspected for compliance with manufacturers recommendations.

PHOTOGRAPH #9



**BUILDING 21
SECTION C**

Window opening measurements confirmed for window installation to meet manufacturers NOAs.

PHOTOGRAPH #10



**BUILDING 21
SECTION D**

Contractor has installed new attic vents and in process of installing new plywood sheathing.


PHOTOGRAPH #11



**BUILDING 21
SECTION B - BREEZEWAY**

Contractor applying Sherwin Williams Encapsulon Epoxy Mastic Primer.

PHOTOGRAPH #12

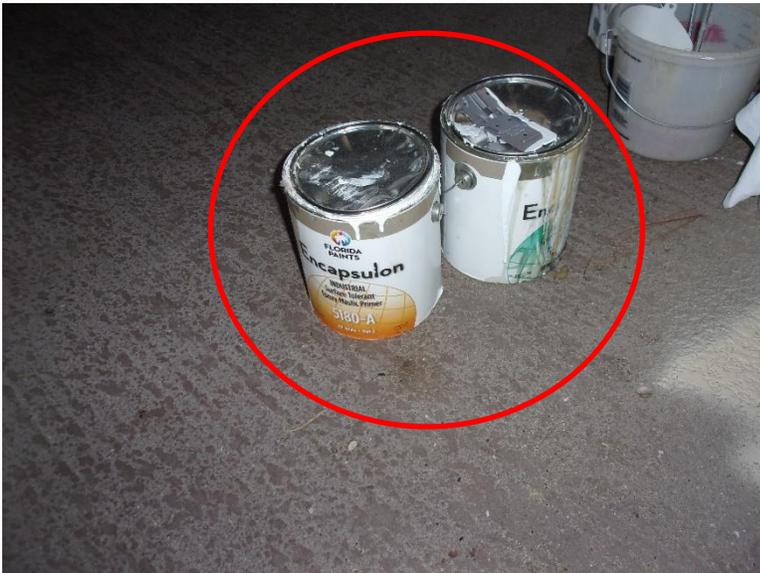

**BUILDING 21
SECTION B - BREEZEWAY**

Contractor applying Sherwin Williams Encapsulon Epoxy Mastic Primer.

PHOTOGRAPH #13



**BUILDING 21
SECTION B**

Simson Strong -Tie strapping in place at framing as per specifications and drawings.

PHOTOGRAPH #14



**BUILDING 21
SECTION B**

Simson Strong -Tie connectors and screws in place at top plate and truss connection as per specifications and drawings.

PHOTOGRAPH #15



**BUILDING 21
SECTION B**

New R-13 insulation installed where damaged or missing.

PHOTOGRAPH #16



**BUILDING 21
SECTION B**

Sealants installed at base of sheathing to bottom plate and concrete slab as directed by **ESI #1**.


PHOTOGRAPH #17



**BUILDING 21
SECTION B**

New pressure treated wood decking provided at damaged balcony decks.

PHOTOGRAPH #18

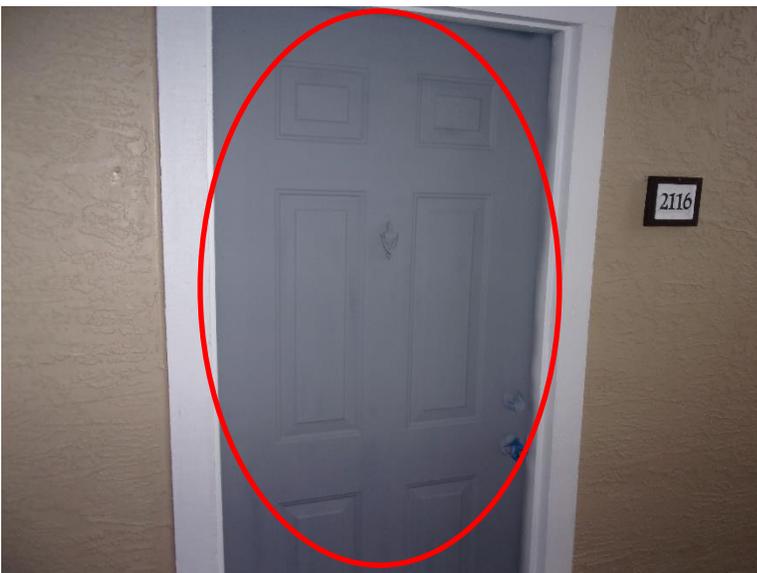

**BUILDING 21
SECTION A**

Contractor has sprayed front doors with Sherwin Williams primer.

PHOTOGRAPH #19



**BUILDING 21
SECTION A**

Previous paint at unit doors peeling and blistered at several locations. Additional surface preparation required prior to primer application.

PHOTOGRAPH #20



**BUILDING 21
SECTION A**

Contractor has covered open walls with heavy plastic for protection during repairs.

PHOTOGRAPH #21



**BUILDING 20
SECTION H**

Contractor has provided scaffolding for access, construction fencing and begun demolition for removal of stucco.

PHOTOGRAPH #22



**BUILDING 20
SECTION A**

Contractor has provided scaffolding for access, construction fencing.

PHOTOGRAPH #23



**BUILDING 20
SECTION B**

Contractor has provided scaffolding for access, construction fencing.