

PHOTOGRAPHS

PHOTOGRAPH #1



**BUILDING 1
SECTION A**

Unit #111- Master bedroom double window water testing performed by Independent water testing agency in accordance with AAMA 502. Test passed with no water intrusion.

PHOTOGRAPH #2



**BUILDING 1
SECTION A**

Unit #111- Master bedroom double window water testing performed by Independent water testing agency in accordance with AAMA 502. Test passed with no water intrusion.

PHOTOGRAPH #3



**BUILDING 1
SECTION A**

Unit #111- Guest bedroom double window water testing performed by Independent water testing agency in accordance with AAMA 502. Test passed with no water intrusion.


PHOTOGRAPH #4



**BUILDING 1
SECTION B**

Contractor has straightened stucco stop, and finished stucco at patio.

PHOTOGRAPH #5

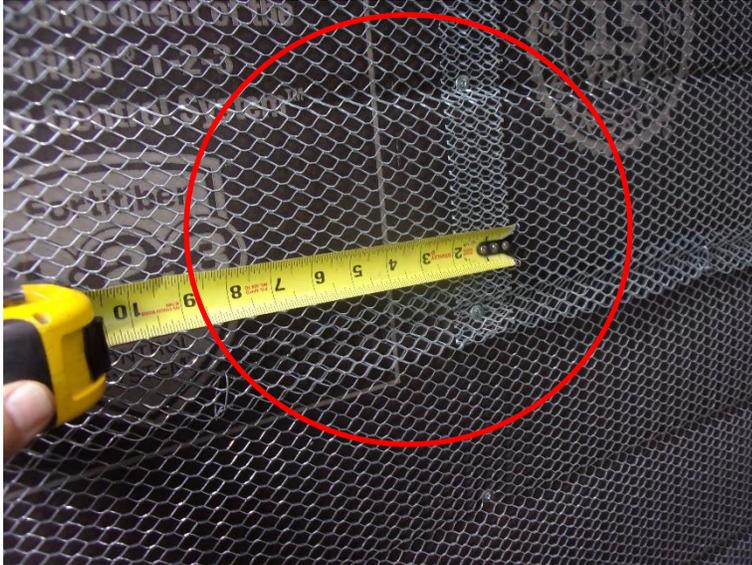

**BUILDING 2
SECTION G**

Metal lathing overlap meeting minimum 1" requirements per specifications and drawings.

PHOTOGRAPH #6



**BUILDING 2
SECTION F**

Contractor has applied new vinyl stucco accessories and metal lathing.


PHOTOGRAPH #7



**BUILDING 2
SECTION F**

Stucco accessories at window bands in progress as per drawings.

PHOTOGRAPH #8

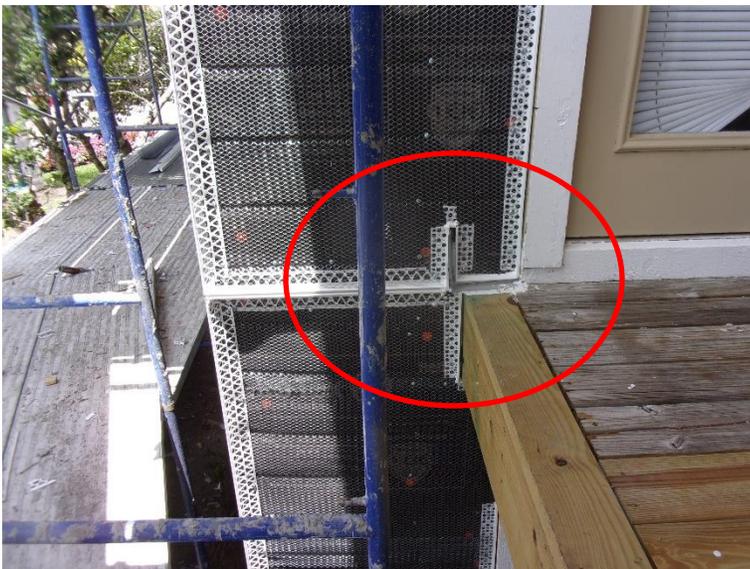

**BUILDING 2
SECTION F**

New galvanized kick out flashings installed at balcony decks.

PHOTOGRAPH #9



**BUILDING 2
SECTION E**

Stucco sub-contractor has installed JumboTex 60 Minute WRB and begun joints and window accessories.

PHOTOGRAPH #10



**BUILDING 2
SECTION D**

Contractor has applied new 15/32" plywood sheathing at gable end elevation.

PHOTOGRAPH #11



**BUILDING 2
SECTION D**

Contractor has not allowed 1/8" minimum spacing between plywood sheathing.

PHOTOGRAPH #12



**BUILDING 2
SECTION D**

Contractor has corrected lack of spacing between plywood.

PHOTOGRAPH #13



**BUILDING 2
SECTION D**

Contractor has preset Green Heck louvered vents into gable end plywood and framing.

PHOTOGRAPH #14



**BUILDING 2
SECTION D**

Tyvek HomeWrap provided at gable end wall with 3" Dupont seam tape at overlapping joints.

PHOTOGRAPH #15



**BUILDING 2
SECTION C**

Tyvek HomeWrap provided at bearing wall with 3" Dupont seam tape at overlapping joints.

PHOTOGRAPH #16



**BUILDING 2
SECTION B**

Contractor has applied new 15/32" plywood sheathing at bearing walls.

PHOTOGRAPH #17



**BUILDING 2
SECTION B**

Simpson Strong -Tie straps and connectors provided, and plywood sheathing application has begun.