

## PHOTOGRAPHS

PHOTOGRAPH #1



### BUILDING 2 SECTION H

Stucco sub-contractor has begun to apply scratch coat of stucco.

PHOTOGRAPH #2



### BUILDING 2 SECTION H

Sub-contractor mixing sand with Cemex Broco stucco bag cement.

**PHOTOGRAPH #3**



**BUILDING 2  
SECTION H**

Sub-contractor mixing sand with Cemex Brocco stucco bag cement.

**PHOTOGRAPH #4**



**BUILDING 2  
SECTION G**

**Unit #212** – Trim at patio door damaged and marked for replacement.

**PHOTOGRAPH #5**



**BUILDING 2  
SECTION D**

New PGT window installed, and flashing performed with DuPont Tyvek flashing system.

**PHOTOGRAPH #6**



**BUILDING 2  
SECTION D**

Contractor has installed new wood soffit and vinyl soffit venting.


**PHOTOGRAPH #7**



**BUILDING 2  
SECTION B**

Window dimensions confirmed to meet window manufacturer's NOA requirements and **ESI # 4**.

**PHOTOGRAPH #8**

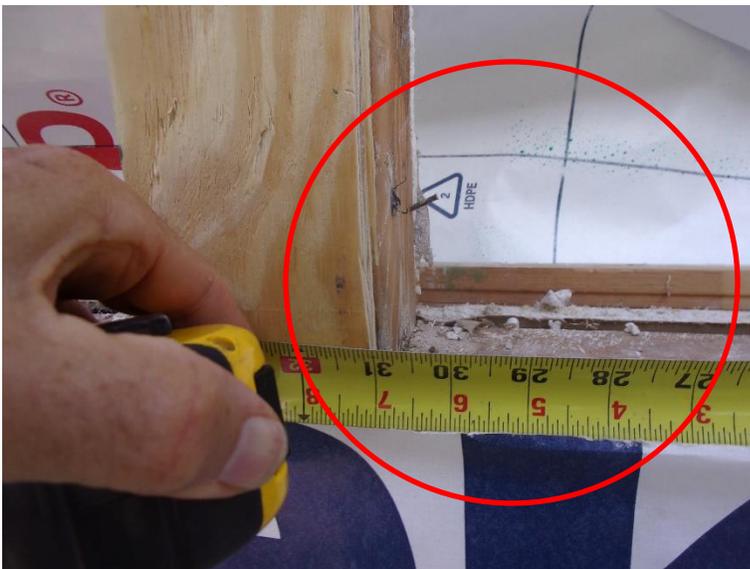

**BUILDING 2  
SECTION B**

Window dimensions confirmed to meet window manufacturer's NOA requirements and **ESI # 4**.

PHOTOGRAPH #9



**BUILDING 2  
SECTION B**

Dupont Tyvek flashings applied as per manufacturers recommendations at window openings.

PHOTOGRAPH #10



**BUILDING 2  
SECTION B**

Contractor using Dupont approved spray primer to enhance bond of new Dupont flashing.


**PHOTOGRAPH #11**



**BUILDING 2  
SECTION B**

New PGT window installed, and flashing performed with DuPont Tyvek flashing system.

**PHOTOGRAPH #12**

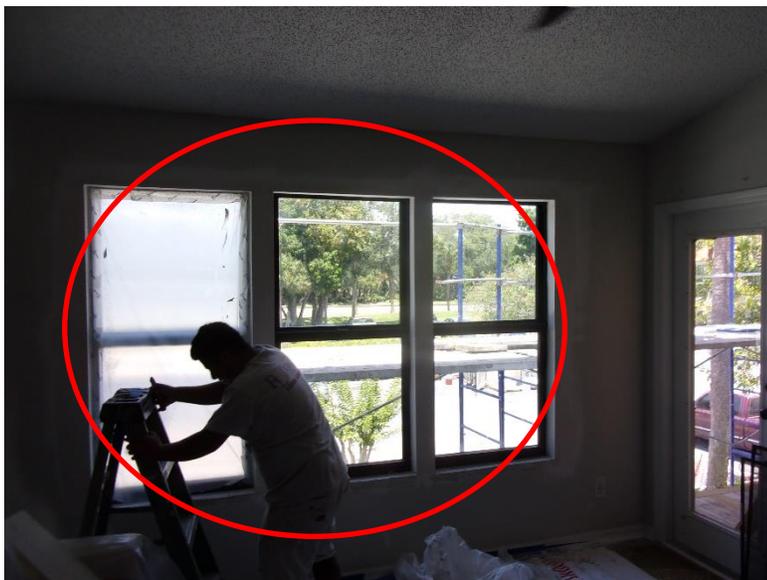

**BUILDING 2  
SECTION B**

**Unit #228-** Contractor performing drywall and sill repairs at new window openings.


**PHOTOGRAPH #13**



**BUILDING 2  
SECTION B**

**Unit #228-** New urethane sealant applied at interior side of window frame to Tyvek flashing.

**PHOTOGRAPH #14**

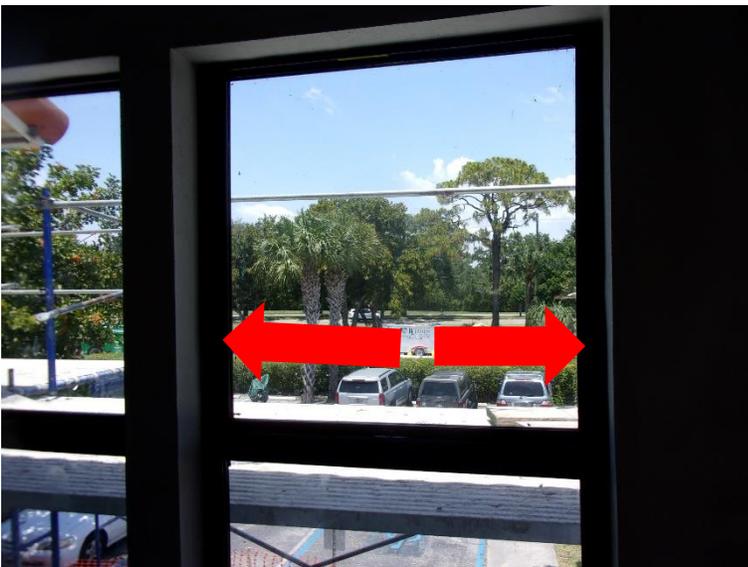

**BUILDING 2  
SECTION B**

PGT windows with factory installed WOCDs not used for several 2<sup>nd</sup> floor windows as required.


**PHOTOGRAPH #15**



**BUILDING 2  
SECTION A**

New wood soffit and vinyl soffit venting installation in progress.

**PHOTOGRAPH #16**

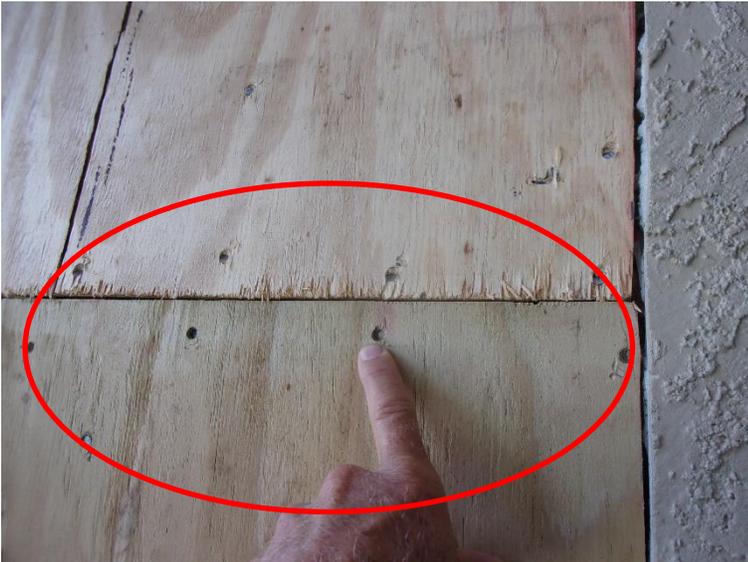

**BUILDING 2  
SECTION A**

Contractor has over sunk nails in sheathing at this location.

**PHOTOGRAPH #17**



**BUILDING 2  
SECTION A**

Over sunken nails in sheathing marked for correction and re nailed by contractor.

**PHOTOGRAPH #18**



**BUILDING 2  
SECTION A**

Patio painting in progress with Florida Paints acrylic paint.

**PHOTOGRAPH #19**



**BUILDING 3  
SECTION H**

Stucco and sheathing removed.  
Damaged framing marked for repairs.

**PHOTOGRAPH #20**



**BUILDING 3  
SECTION H**

Damaged framing at window openings  
and headers marked for repairs.

**PHOTOGRAPH #21**



**BUILDING 3  
SECTION H**

Damaged framing marked at window framing and bottom plates.

**PHOTOGRAPH #22**



**BUILDING 3  
SECTION G**

Damaged box beam at breezeway marked for repairs.

**PHOTOGRAPH #23**



**BUILDING 3  
SECTION F**

Previous repairs done at balcony built up beams cut short are not bearing at framing post and will require replacement.

**PHOTOGRAPH #24**



**BUILDING 3  
SECTION F**

Damaged framing marked for repairs at posts, plates, and studs.

**PHOTOGRAPH #25**



**BUILDING 3  
SECTION E**

Termite damage marked for repairs at breezeway.

**PHOTOGRAPH #26**



**BUILDING 3  
SECTION E**

Damaged breezeway framing marked for full breezeway repair detail.