

PHOTOGRAPHS

PHOTOGRAPH #1



BUILDING 2 SECTION H

Florida Paint has confirmed PH levels acceptable for coating by report Contractor has painted new stucco.

PHOTOGRAPH #2



BUILDING 2 SECTION G

BASF 150 sealant applied at window perimeters and all transitions from new stucco to adjacent substrates.

PHOTOGRAPH #3



**BUILDING 2
SECTION G**

BASF 150 sealant applied at window perimeters and all transitions from new stucco to adjacent substrates.

PHOTOGRAPH #4



**BUILDING 2
SECTION G**

BASF 150 sealant applied at window perimeters and all transitions from new stucco to adjacent substrates.

PHOTOGRAPH #5



**BUILDING 2
SECTION G**

Contractor has applied urethane sealant at interior side of new window to Dupont flashing system and allowed to cure before applying new drywall and sills.

PHOTOGRAPH #6



**BUILDING 2
SECTION G**

Contractor has painted new stucco and in process of removing access scaffolding.

PHOTOGRAPH #7



**BUILDING 2
SECTION F**

Sub-contractor has protected windows and applied three coat stucco system.

PHOTOGRAPH #8



**BUILDING 2
SECTION D**

Stucco sub-contractor has applied JumboTex WRB and begun to install vinyl stucco accessories.


PHOTOGRAPH #9



**BUILDING 2
SECTION B**

Stucco sub-contractor has applied JumboTex Water resistant barrier.

PHOTOGRAPH #10

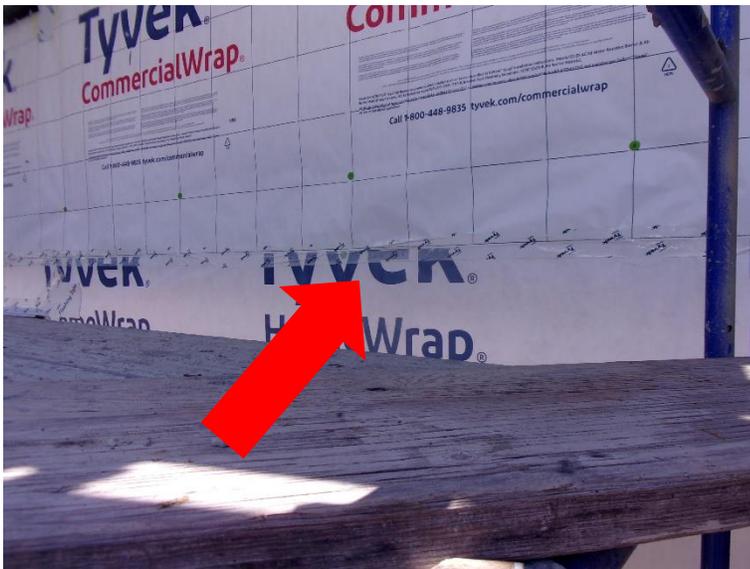

**BUILDING 2
SECTION A**

Overlapping seams taped with Tyvek 3" seam tape.

PHOTOGRAPH #11



**BUILDING 2
SECTION A**

Weep screed accessory detail at base of new plywood sheathing flashed with Dupont flashing and overlapped with Tyvek HomeWrap.

PHOTOGRAPH #12



**BUILDING 3
SECTION H**

Gable end wall framing treated with BoraCare Termite Treatment.

PHOTOGRAPH #13



**BUILDING 3
SECTION G**

Pest control contractor has treated wall framing with BoraCare Termite Treatment.

PHOTOGRAPH #14



**BUILDING 3
SECTION G**

Damaged framing at breezeway replaced at header and posts.

PHOTOGRAPH #15



**BUILDING 3
SECTION F**

Pest control contractor has treated wall framing with BoraCare Termite Treatment.

PHOTOGRAPH #16



**BUILDING 3
SECTION E**

Framing repairs in progress. Open walls covered for weather protection.

PHOTOGRAPH #17



**BUILDING 3
SECTION E**

Damaged breezeway wall framing replaced.

PHOTOGRAPH #18



**BUILDING 3
SECTION E**

Additional stucco removed exposing additional termite damaged headers and framing to be replaced.

PHOTOGRAPH #19



**BUILDING 3
SECTION E**

Additional stucco removed exposing additional termite damaged headers and framing to be replaced.

PHOTOGRAPH #20



**BUILDING 3
SECTION D**

Contractor mobilizing and setting up scaffolding for access to repairs.