

PHOTOGRAPHS


PHOTOGRAPH #1



BUILDING 2 SECTION C

Stucco sub-contractor has applied Super JumboTex 60 WRB, Vinyl stucco accessories and stucco lath.


PHOTOGRAPH #2

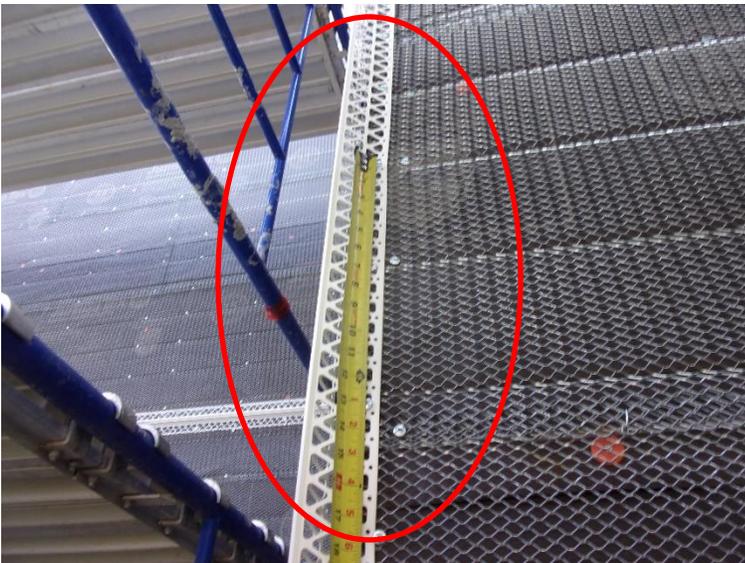

BUILDING 2 SECTION C

Stucco lath attachment and accessories attachment inspected for fastener spacing and locations.

PHOTOGRAPH #3

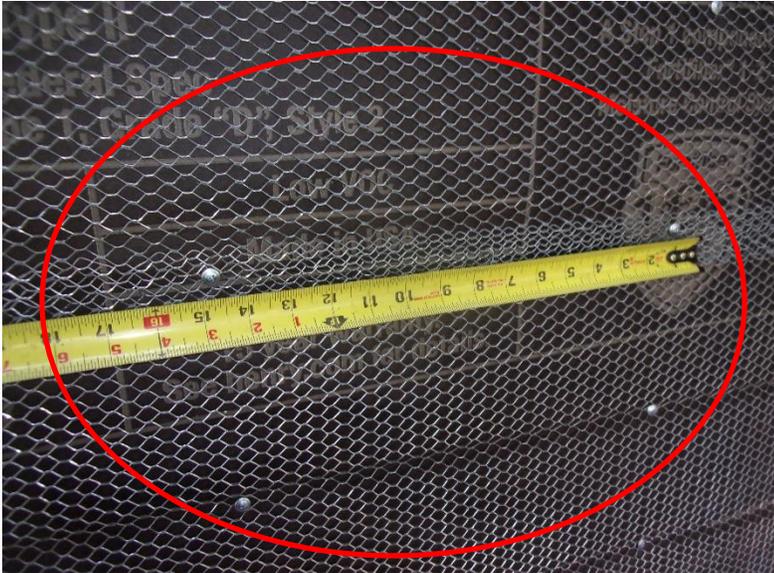

**BUILDING 2
SECTION C**

Stucco lath attachment and accessories attachment inspected for fastener spacing and locations.

PHOTOGRAPH #4



**BUILDING 2
SECTION B**

Stucco sub-contractor in process of applying Vinyl stucco accessories and stucco lath.

PHOTOGRAPH #5



**BUILDING 2
SECTION A**

Stucco sub-contractor has applied water resistant barrier and begun attaching stucco accessories.

PHOTOGRAPH #6



**BUILDING 3
SECTION H**

BoraCare Termite treatment applied to all wall new and old wood framing members.

PHOTOGRAPH #7



**BUILDING 3
SECTION H**

Blocking and framing support is not complete for attachment of flashing and stucco stop accessory details.

PHOTOGRAPH #8



**BUILDING 3
SECTION H**

Simpson Strong-Tie connectors and screws installed at studs to top plate and top plate to truss framing.

PHOTOGRAPH #9



**BUILDING 3
SECTION H**

Roofing sheathing damage and recent roofing leaks observed over soffit area. Owners to have roofing contractor perform repair.

PHOTOGRAPH #10



**BUILDING 3
SECTION G**

Simpson Strong-Tie connectors and screws installed at header beam to trusses and king studs to top plate.

PHOTOGRAPH #11



**BUILDING 3
SECTION G**

Copper Green wood preservative applied at bottom 2' of new and old framing.

PHOTOGRAPH #12



**BUILDING 3
SECTION G**

Copper Green wood preservative applied at bottom 2' of new and old framing.

PHOTOGRAPH #13



**BUILDING 3
SECTION F**

BoraCare termite treatment applied and connector straps in place.

PHOTOGRAPH #14



**BUILDING 3
SECTION F**

Simson Strong-Tie connectors and Titen HD fasteners installed at studs to base plate and base plate to foundation slab.

PHOTOGRAPH #15



**BUILDING 3
SECTION E**

Framing repairs performed and Simpson strong -Tie connectors installed.