

**PHOTOGRAPHS**

**PHOTOGRAPH #1**



**BUILDING 6  
SECTIONS E-H**

Contractor relocated scaffolding to the remaining elevations to start stucco removal.

**PHOTOGRAPH #2**



**BUILDING 6  
SECTIONS A-D**

Contractor relocated scaffolding to the remaining elevations to start stucco removal.

**PHOTOGRAPH #3**



**BUILDING 6  
SECTIONS A-D**

Contractor began saw cutting stucco to remove in sections.

**PHOTOGRAPH #4**



**BUILDING 6  
SECTION A-D**

Downspouts and balcony railing were removed and stored on-site for stucco and framing repairs.

**PHOTOGRAPH #5**



**BUILDING 3  
SECTION H**

Stucco Sub-contractor began stucco scratch coat installation.

**PHOTOGRAPH #6**



**BUILDING 3  
SECTION H**

Stucco Sub-contractor began stucco scratch coat installation.

**PHOTOGRAPH #7**



**BUILDING 3  
SECTION H**

Stucco Sub-contractor used approved Cemex Broco Stucco Cement to mix stucco on-site.

**PHOTOGRAPH #8**



**BUILDING 3  
SECTION H**

Stucco Sub-contractor used approved Cemex Broco Stucco Cement to mix stucco on-site.

**PHOTOGRAPH #9**



**BUILDING 3  
SECTION F**

Stucco Sub-contractor overlapped lath 2" minimum per the construction drawings and installed tie wire between fasteners.

**PHOTOGRAPH #10**



**BUILDING 3  
SECTION F**

Lath fasteners are spaced 6" on-center.


**PHOTOGRAPH #11**



**BUILDING 3  
SECTION E**

Stucco Sub-contractor installed lath and accessories over Weather-Resistive Barrier.

**PHOTOGRAPH #12**

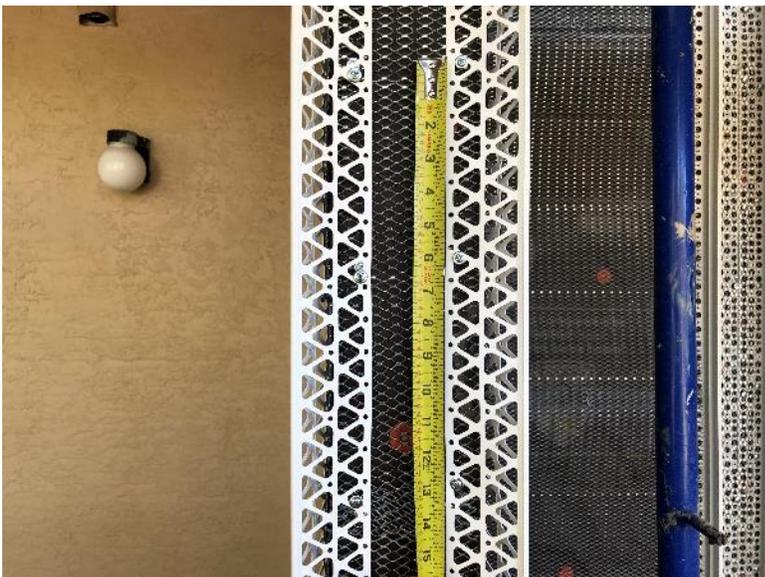

**BUILDING 3  
SECTION E**

Stucco accessories are fastened within 7" on-center.


**PHOTOGRAPH #13**



**BUILDING 3  
SECTION E**

MasterSeal NP 150 sealant was applied to accessory ends, corners, and intersections.

**PHOTOGRAPH #14**

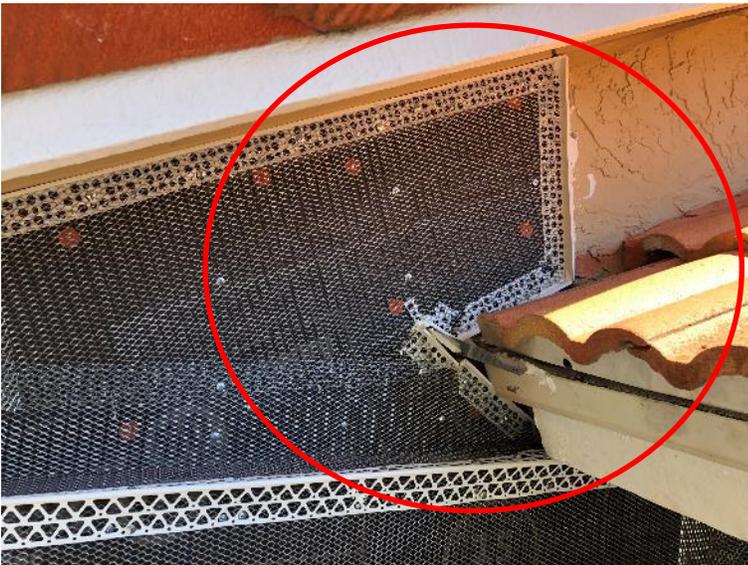

**BUILDING 3  
SECTION E**

Kickout flashing and accessories have been installed per the contract drawings.

**PHOTOGRAPH #15**



**BUILDING 3  
SECTION D**

Stucco Sub-contractor installing Super JumboTex 60 Minute Weather-Resistive Barrier.

**PHOTOGRAPH #16**



**BUILDING 3  
SECTION D**

Damaged truss repairs to second floor truss is in progress per ESI #1.

**PHOTOGRAPH #17**



**BUILDING 3  
SECTION D**

Contractor installing sheathing using 4d nails spaced at 4" on-center per contract drawings.

**PHOTOGRAPH #18**



**BUILDING 3  
SECTION D**

Contractor installed remaining sheathing using 4d nails spaced at 4" on-center per contract drawings.

**PHOTOGRAPH #19**



**BUILDING 3  
SECTION C**

Stucco Sub-contractor installed Super JumboTex 60 Minute Weather-Resistive Barrier with 2" horizontal overlap and 6" minimum vertical overlap.

**PHOTOGRAPH #20**



**BUILDING 3  
SECTION B**

Stucco Sub-contractor installing Super JumboTex 60 Minute Weather-Resistive Barrier and stucco accessories.

**PHOTOGRAPH #21**



**BUILDING 3  
SECTION B**

Stucco Sub-contractor provided over 2" horizontal overlap and 6" minimum vertical overlap.

**PHOTOGRAPH #22**



**BUILDING 3  
SECTION A**

Stucco Sub-contractor installing Super JumboTex 60 Minute Weather-Resistive Barrier.