

PHOTOGRAPHS

PHOTOGRAPH #1



BUILDING 6 SECTION F

Jumbo Tex super 60 WRB applied and stucco accessories in progress.

PHOTOGRAPH #2



BUILDING 6 SECTION F

Contractor installing kick-out flashing at balconies per contract drawings, Detail A/S-6.3.


PHOTOGRAPH #3



**BUILDING 6
SECTION F**

Holes and tears in Super JumpTex shall be covered with Tyvek tape prior to lath installation.

PHOTOGRAPH #4

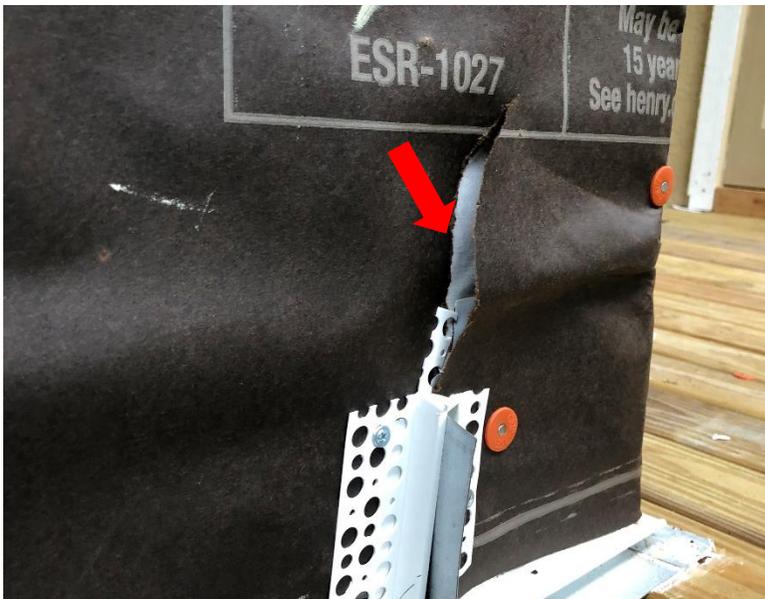

**BUILDING 6
SECTION F**

Holes and tears in Super JumpTex shall be covered with Tyvek tape prior to lath installation.

PHOTOGRAPH #5



**BUILDING 6
SECTION G**

Stucco accessories and wire lath were installed per the drawings and specifications and is ready for scratch coat.


PHOTOGRAPH #6



**BUILDING 6
SECTION G**

Kickout flashing and accessories have been installed per the contract drawings.


PHOTOGRAPH #7

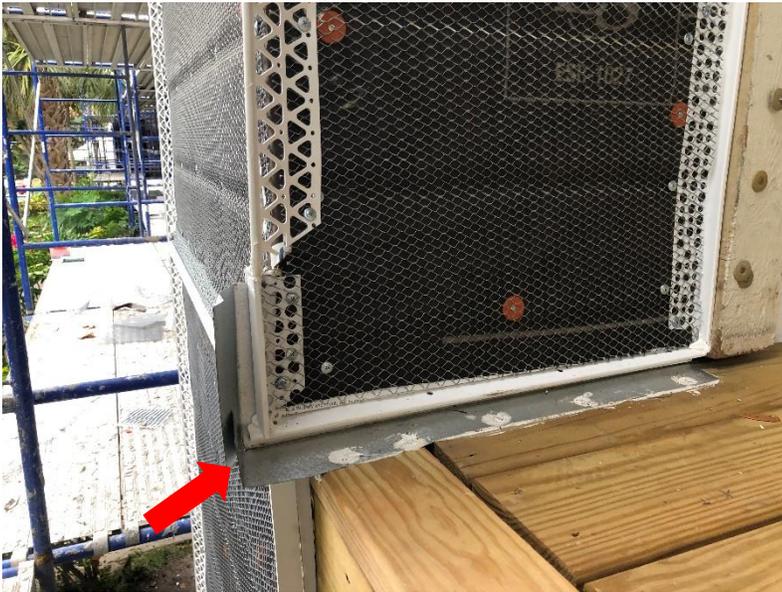

**BUILDING 6
SECTION G**

Kickout flashing and accessories have been installed with the flashing lap backwards. Contractor to fix flashing lap.

PHOTOGRAPH #8

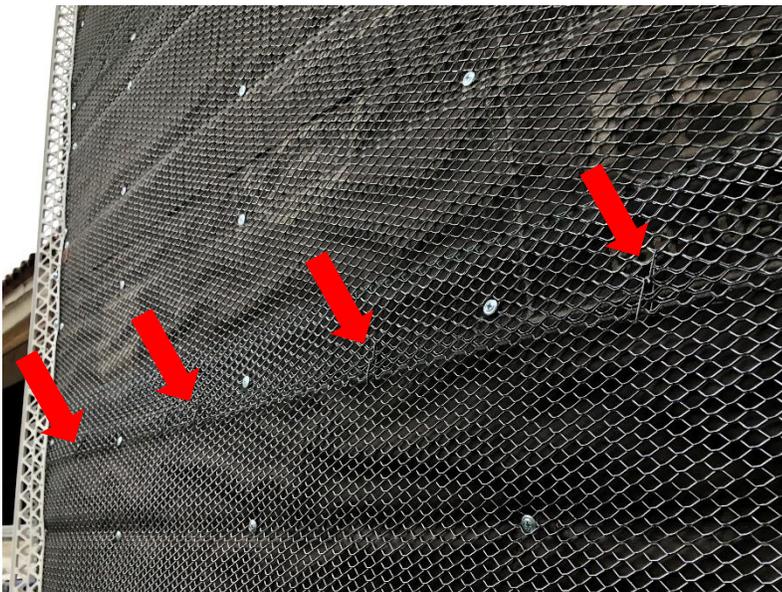

**BUILDING 6
SECTION G**

Stucco Sub-contractor lath 2" minimum per the construction drawings and installed tie wire between fasteners.

PHOTOGRAPH #9



**BUILDING 6
SECTION H**

Stucco accessories and wire lath were installed per the drawings and specifications and is ready for scratch coat.


PHOTOGRAPH #10



**BUILDING 6
SECTION H**

Vinyl stucco accessories attached at 7" intervals per the specifications.


PHOTOGRAPH #11

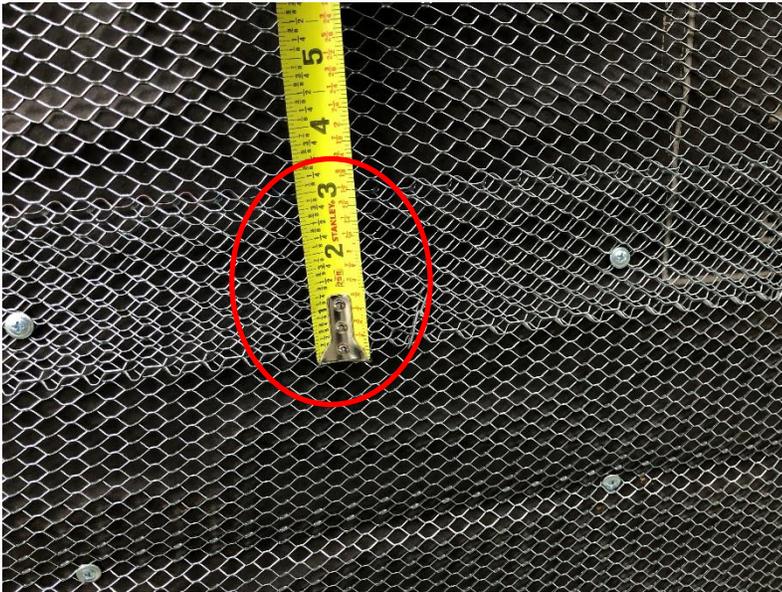

**BUILDING 6
SECTION H**

Stucco Sub-contractor lath 2" minimum per the construction drawings and installed tie wire between fasteners.

PHOTOGRAPH #12

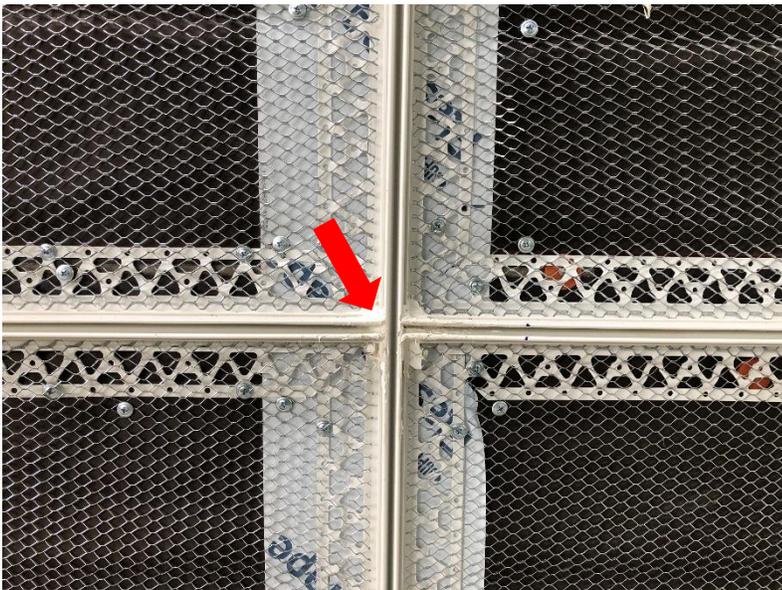

**BUILDING 6
SECTION H**

MasterSeal NP 150 sealant was applied to accessory ends, corners, and intersections.

PHOTOGRAPH #13



**BUILDING 6
SECTION H**

Stucco Sub-contractor began scratch coat application.

PHOTOGRAPH #14



**BUILDING 6
SECTION H**

Stucco Sub-contractor mixed approved Cemex Broco Stucco Cement with sand on-site.

PHOTOGRAPH #15



**BUILDING 6
SECTION H**

Stucco Sub-contractor mixed approved Cemex Broco Stucco Cement with sand on-site.

PHOTOGRAPH #16



**BUILDING 6
SECTION A**

Framing repairs in progress at wall studs and window openings with 2"X4" southern yellow pine.

PHOTOGRAPH #17



**BUILDING 6
SECTION A**

2"X6" pressure treated studs for breezeway column repairs.

PHOTOGRAPH #18



**BUILDING 6
SECTION B**

Framing repairs in progress at wall studs and window openings with 2"X4" southern yellow pine.

PHOTOGRAPH #19



**BUILDING 6
SECTION B**

Deteriorated floorboards and balcony framing were removed and replaced with new southern yellow pine. New floorboards are pressure treated 2"x6".

PHOTOGRAPH #20



**BUILDING 6
SECTION B**

Damaged box beam at breezeway and adjacent framing were replaced.

PHOTOGRAPH #21



**BUILDING 6
SECTION D**

Gable end reinforcement and cross bracing were installed per drawings and details.

PHOTOGRAPH #22



**BUILDING 3
SECTION F**

Contractor coated and installed balcony railings.

PHOTOGRAPH #23



**BUILDING 3
SECTION F**

Contractor to install remaining lag bolts in balcony railing base.

PHOTOGRAPH #24



**BUILDING 3
SECTION F**

Contractor applied Florida Paints
TropiCrete Waterborne Epoxy Floor
Coating.

PHOTOGRAPH #25



**BUILDING 2
SECTION F**

Contractor adjusted kick-out flashing per punchlist item request.