


### PHOTOGRAPHS

**PHOTOGRAPH #1**

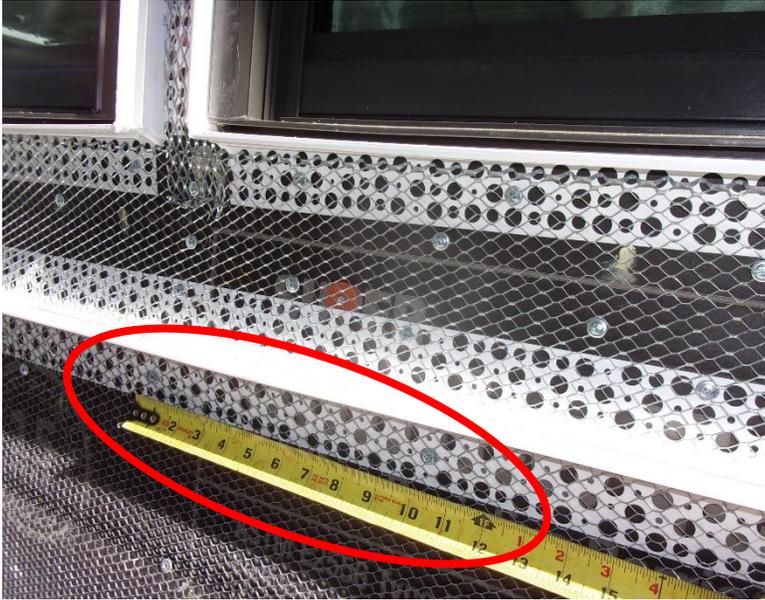

#### **BUILDING 6 SECTION A**

Sub-contractor lacked fasteners at attachment of vinyl accessories. Specification requires attachment at minimum of 7" O.C.


**PHOTOGRAPH #2**



#### **BUILDING 6 SECTION A**

Contractor adding missing fasteners at vinyl stucco accessories to meet the specified minimum of 7" O.C.

**PHOTOGRAPH #3**

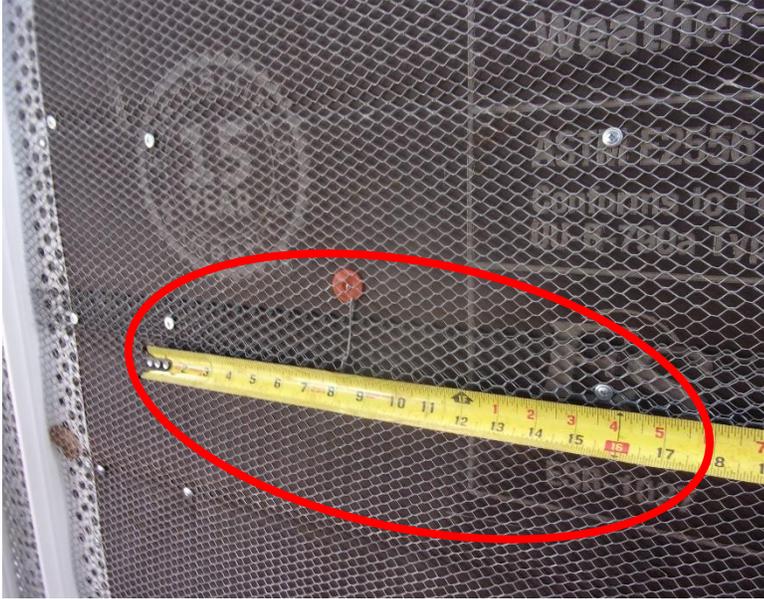

**BUILDING 6  
SECTION A**

Sub-contractor has attached metal lathing to framing studs at 16" O.C. and provided tie wire connections at lathing overlaps.

**PHOTOGRAPH #4**



**BUILDING 6  
SECTION A**

New galvanized kick out flashing installed and sealed at deck repairs as per drawings.

**PHOTOGRAPH #5**



**BUILDING 6  
SECTION A**

Sub-contractor has applied scratch coat of three coat 7/8" stucco system as per specifications.

**PHOTOGRAPH #6**



**BUILDING 6  
SECTION A**

CEMEX BROCO stucco cement bag mix used for three coat 7/8" stucco system.

**PHOTOGRAPH #7**



**BUILDING 6  
SECTION A**

Contractors repair materials and equipment in breezeway walk path.


**PHOTOGRAPH #8**



**BUILDING 6  
SECTION B**

Sub-contractor has installed vinyl stucco accessories and metal lathing for application of new stucco.

**PHOTOGRAPH #9**

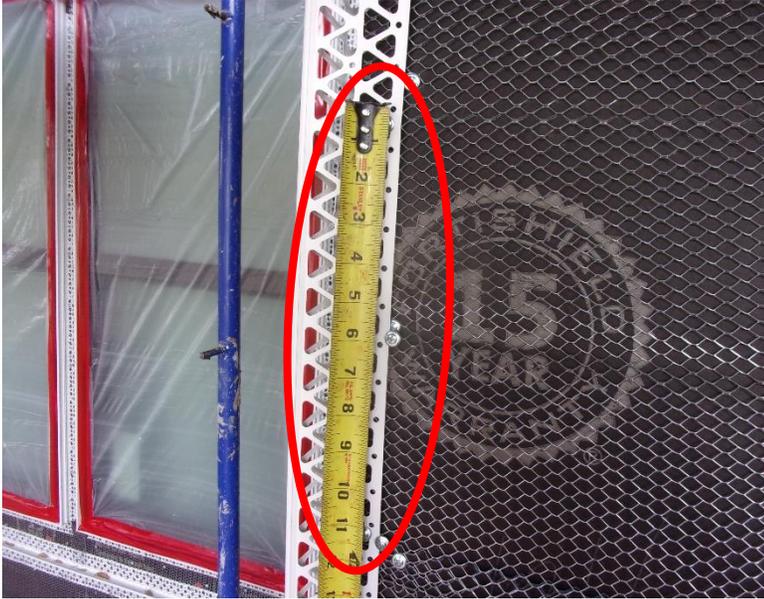

**BUILDING 6  
SECTION B**

Stucco accessories fastened with self-tapping screws at minimum 7" O.C.as per drawings and specifications.


**PHOTOGRAPH #10**



**BUILDING 6  
SECTION B**

Sealant missing butt joints and transitions of vinyl accessories.


**PHOTOGRAPH #11**

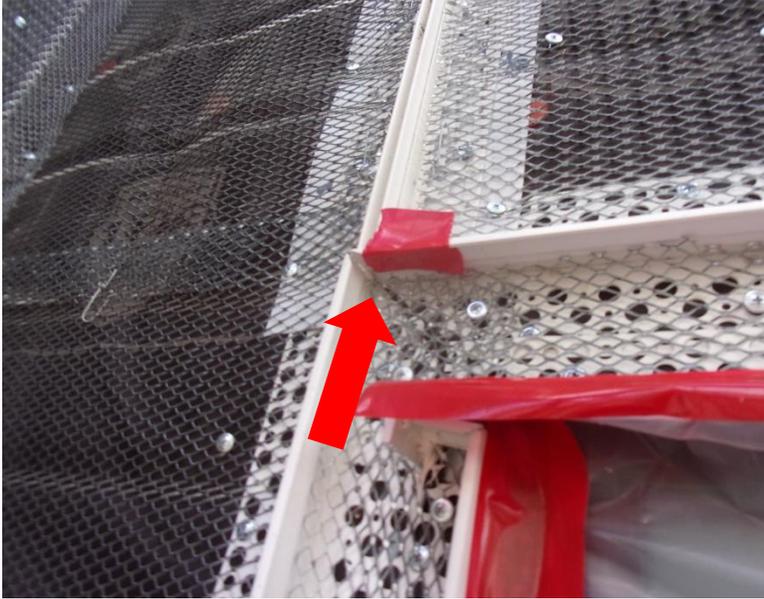

**BUILDING 6  
SECTION B**

Missing sealants at butt joints and transitions of vinyl accessories corrected by sub-contractor.

**PHOTOGRAPH #12**

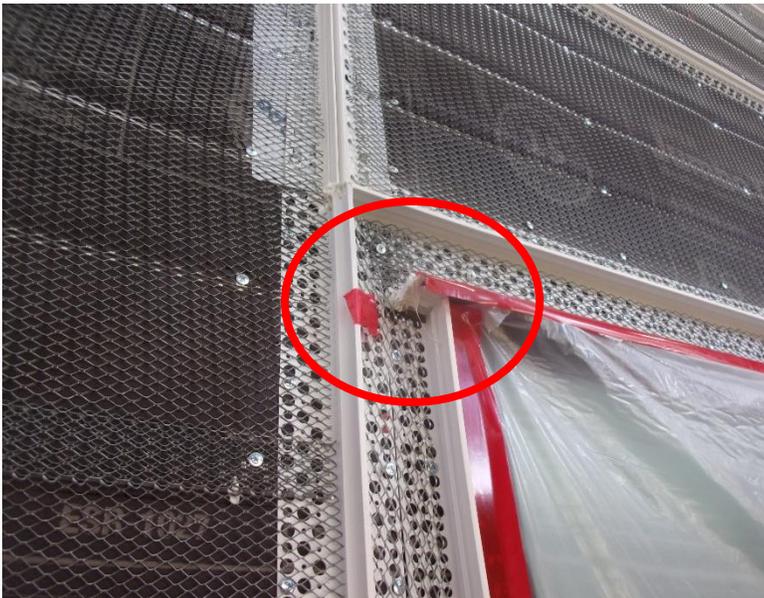

**BUILDING 6  
SECTION B**

Missing sealants at butt joints and transitions of vinyl accessories corrected by sub-contractor.

**PHOTOGRAPH #13**



**BUILDING 6  
SECTION B**

**Unit #613-** Drywall taping and finishing in progress at new PGT windows.

**PHOTOGRAPH #14**



**BUILDING 6  
SECTION C**

Sub-contractor in process of installing vinyl stucco accessories and metal lathing for application of new stucco.

**PHOTOGRAPH #15**



**BUILDING 6  
SECTION D**

Jumbo Tex super 60 water resistant barrier applied and new stucco accessory installation in progress.

**PHOTOGRAPH #16**



**BUILDING 6  
SECTION D**

Sealant installed at base plate to concrete foundation as per drawings from ESI #1 alternate #3.

**PHOTOGRAPH #17**



**BUILDING 6  
SECTION E- BREEZEWAY**

Removal of loose paint and rust at  
stairway railing in progress.

**PHOTOGRAPH #18**



**BUILDING 6  
SECTION G**

**Unit #612-** Drywall taping and finishing in  
progress at new PGT windows.