

PHOTOGRAPHS


PHOTOGRAPH #1



**BUILDING 7
SECTION A**

Framing repairs, Simpson Strong-Tie connectors and termite treatment is complete. Contractor has covered with plastic to protect open walls from weather damage.

PHOTOGRAPH #2

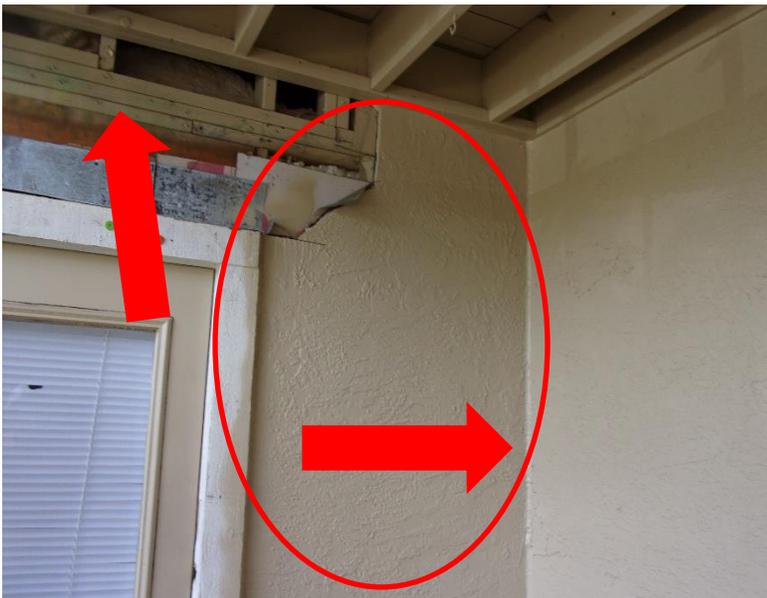

**BUILDING 7
SECTION A**

Additional framing repairs will require full stucco removal and replacement at Lanai return wall to the inside corner.

PHOTOGRAPH #3



**BUILDING 7
SECTION A**

Breezeway stucco and ceiling primed, and finish painted with Scott Paint Ultra Exterior Supercoat Acrylic.

PHOTOGRAPH #4



**BUILDING 7
SECTION A**

Breezeway stucco and ceiling primed, and finish painted with Scott Paint Ultra Exterior Supercoat Acrylic.

PHOTOGRAPH #5



**BUILDING 7
SECTION B**

Lanai stucco and ceiling primed, and finish painted with Scott Paint Ultra Exterior Supercoat Acrylic.

PHOTOGRAPH #6



**BUILDING 7
SECTION C**

Contractor has applied Dupont Tyvek HomeWrap water resistant barrier over new Plywood Sheathing.

PHOTOGRAPH #7



**BUILDING 7
SECTION D**

Contractor has applied Dupont Tyvek HomeWrap water resistant barrier over new Plywood Sheathing.

PHOTOGRAPH #8



**BUILDING 7
SECTION E**

Stucco sub-contractor has applied second water resistant barrier and begun to install vinyl stucco accessories at windows and soffit transition.


PHOTOGRAPH #9



**BUILDING 7
SECTION E**

"J" channel Vinyl stucco stop accessories set to provide $\frac{1}{4}$ " gap for new sealants at window perimeters.

PHOTOGRAPH #10

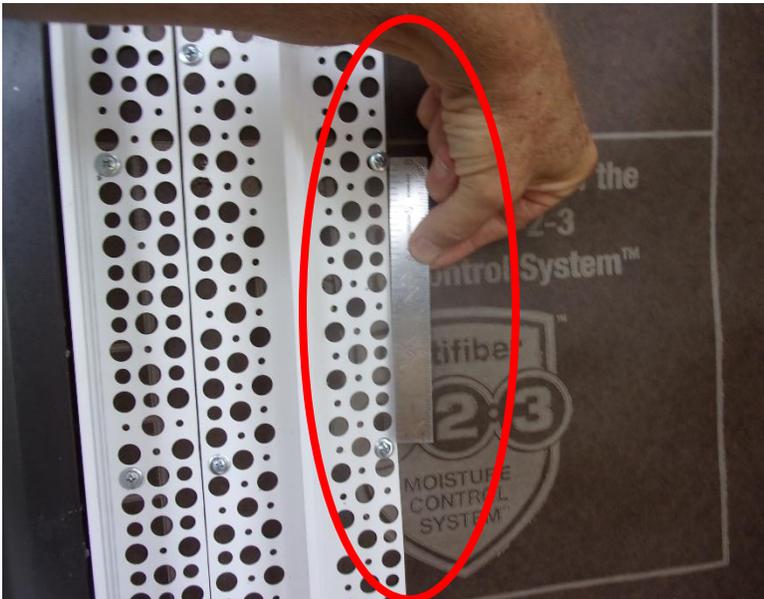

**BUILDING 7
SECTION E**

"J" channel Vinyl stucco stop accessories secured at no more than seven-inch intervals as per ASTM C1063 standards.


PHOTOGRAPH #11



**BUILDING 7
SECTION F**

Continuous vertical self-adhering Dupont straight flash applied over WRB prior to installation of new control joint accessories as per project drawings.


PHOTOGRAPH #12

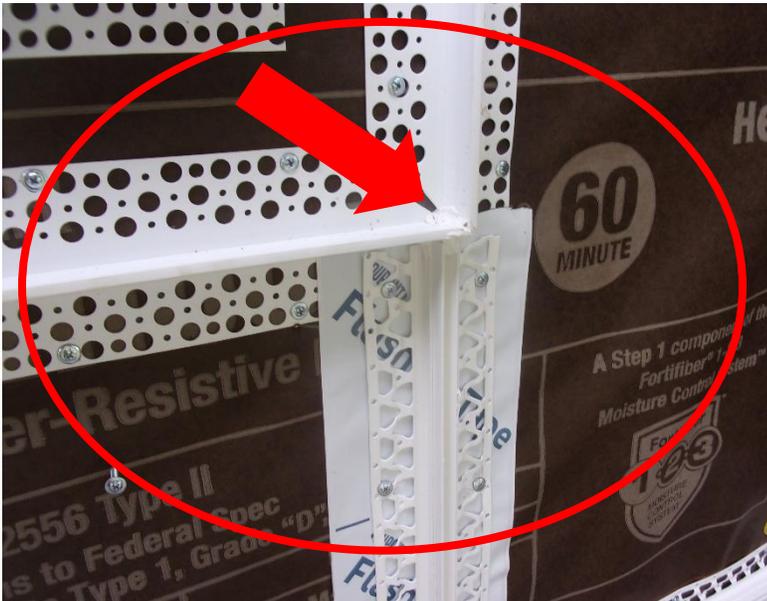

**BUILDING 7
SECTION F**

New urethane sealant installed at all stucco accessory corner and butt joints transitions.

PHOTOGRAPH #13

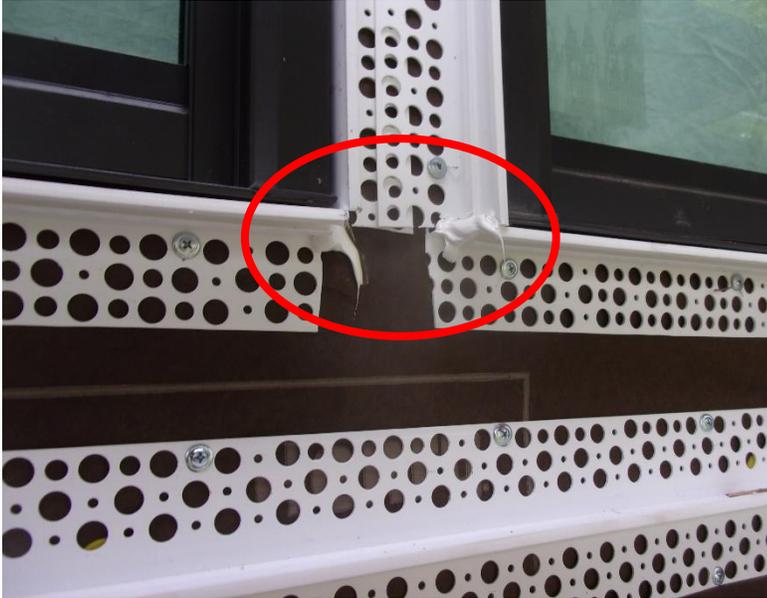

**BUILDING 7
SECTION F**

New urethane sealant installed at all stucco accessory corner and butt joints transitions.

PHOTOGRAPH #14



**BUILDING 7
SECTION F**

New urethane sealant installed at all stucco accessory corner and butt joints transitions.

PHOTOGRAPH #15



**BUILDING 7
SECTION G**

New galvanized kick out flashing installation in progress at balcony decks.

PHOTOGRAPH #16



**BUILDING 7
SECTION H**

Stucco subcontractor has installed vinyl stucco accessories over secondary water-resistant barrier and installed galvanized metal lathing as per drawings and specifications.

PHOTOGRAPH #17



**BUILDING 7
SECTION H**

“L” shaped four galvanized self-furring lath strips used at inside corners for best application of new stucco.

PHOTOGRAPH #18



**BUILDING 7
SECTION H**

Contractor has installed new wood soffit and vinyl venting as per drawings and specifications.

PHOTOGRAPH #19



**BUILDING 8
SECTION H**

Contractor in process of installing new Simpson strong- Tie connectors and hardware at gable end wall.

PHOTOGRAPH #20



**BUILDING 8
SECTION G**

Contractor in process of installing new 5/8" Simpson Strong- Tie Titen HD fasteners at base plate.

PHOTOGRAPH #21



**BUILDING 8
SECTION G**

Breezeway railings in process of surface preparation (removing loose paint and rust) with hand grinders.

PHOTOGRAPH #22



**BUILDING 8
SECTION F**

Additional header and top plate repairs in progress above door at Lanai.

PHOTOGRAPH #23



**BUILDING 8
SECTION F**

Top plate repair has stopped short of damage and top plate repair is not properly staggered for support on framing studs.