

PHOTOGRAPHS

PHOTOGRAPH #1



**BUILDING 7
SECTION A**

Sub-Contractor has completed 3 coat 7/8" stucco system at bearing walls.

PHOTOGRAPH #2



**BUILDING 7
SECTION B**

Sub-Contractor has completed 3 coat 7/8" stucco system at bearing walls.

PHOTOGRAPH #3



**BUILDING 7
SECTION B**

New backing rod and BASF 150 sealants applied at window frames.

PHOTOGRAPH #4



**BUILDING 7
SECTION B**

New backing rod and BASF 150 sealants applied at window frames.

PHOTOGRAPH #5



**BUILDING 7
SECTION B**

Kick out roof flashing is lacking kick out angle, full bed of mastic and trimming away of eave closure metal at kick out.


PHOTOGRAPH #6



**BUILDING 7
SECTION B**

Kick out roof flashing is lacking kick out angle, full bed of mastic and trimming away of eave closure metal at kick out.

PHOTOGRAPH #7

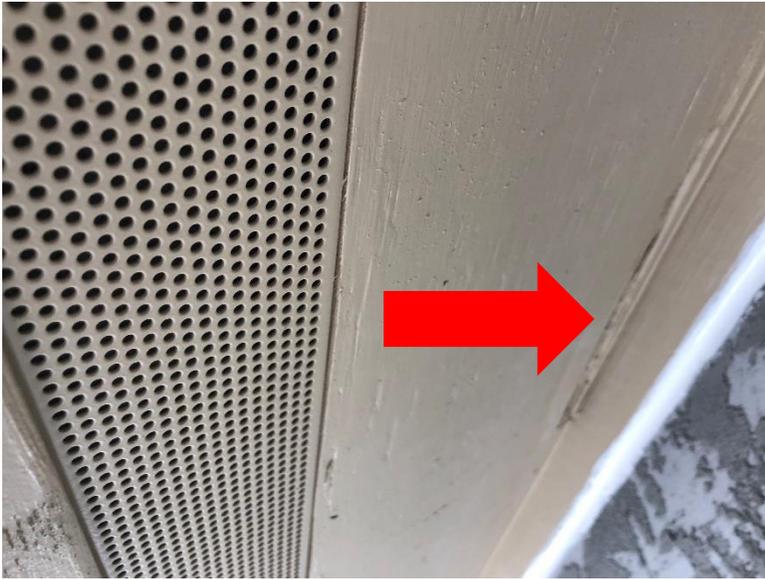

**BUILDING 7
SECTION C**

New plywood installed at soffit is delaminated and damaged.

PHOTOGRAPH #8



**BUILDING 7
SECTION D**

Contractor applied new Florida Paints Ultra Exterior Supercoat Paint to new stucco.


PHOTOGRAPH #9



**BUILDING 7
SECTION D**

Kick out roof flashing is lacking kick out angle and separation from edge of barrel tile.

PHOTOGRAPH #10

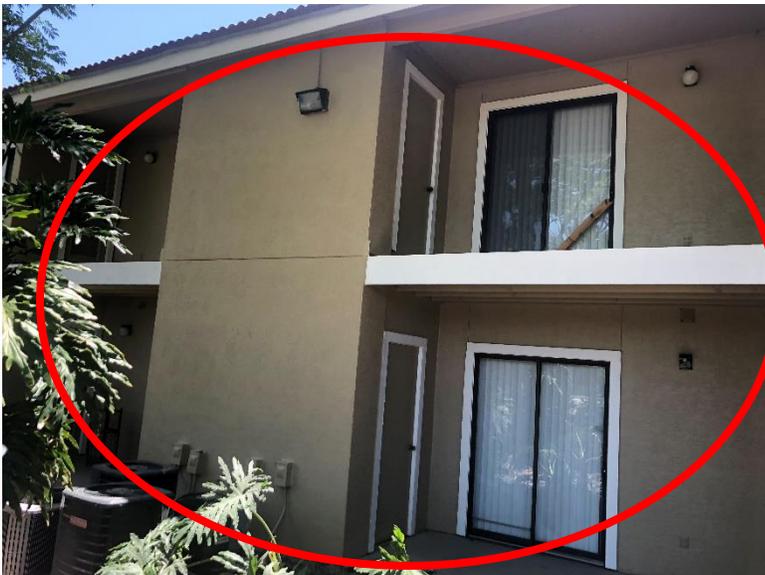

**BUILDING 7
SECTION F**

Contractor applied new Florida Paints Ultra Exterior Supercoat Paint to new stucco, balcony walls and ceilings.

PHOTOGRAPH #11



**BUILDING 7
SECTION H**

Contractor applied new Florida Paints Ultra Exterior Supercoat Paint to new stucco at gable end walls.

PHOTOGRAPH #12



**BUILDING 7
SECTION H**

Contractor applied new Florida Paints Ultra Exterior Supercoat Paint to new stucco.

PHOTOGRAPH #13



**BUILDING 8
SECTION H**

Contractor has applied Tyvek CommercialWrap water resistant barrier over new plywood sheathing.

PHOTOGRAPH #14



**BUILDING 8
SECTION H**

Tyvek removed to view plywood fastening corrections noted from last visit. Corrections had been made at this location.

PHOTOGRAPH #15



**BUILDING 8
SECTION H**

Tyvek removed to view damaged plywood replacement noted from last visit. Corrections had not been made at this location.

PHOTOGRAPH #16



**BUILDING 8
SECTION H**

New 770 series PGT windows installed at gable end wall.

PHOTOGRAPH #17



**BUILDING 8
SECTION H**

Unit # 811 - Gaps measured from window frame to jamb meet drawing requirements for fin frame jamb installation.

PHOTOGRAPH #18



**BUILDING 8
SECTION H**

Contractor installing and flashing new Green Heck louvers at attic space in gable end wall.

PHOTOGRAPH #19



**BUILDING 8
SECTION G**

Tyvek opened to view plywood fastening corrections noted from last visit. Corrections had not been made at this location.

PHOTOGRAPH #20



**BUILDING 8
SECTION F**

Tyvek opened to view plywood fastening corrections noted from last visit. Corrections had not been made at this location.

PHOTOGRAPH #21



**BUILDING 8
SECTION F**

Contractor has applied Tyvek HomeWrap water resistant barrier over new plywood sheathing.

PHOTOGRAPH #22



**BUILDING 8
SECTION E**

Contractor has applied Tyvek HomeWrap water resistant barrier over new plywood sheathing.