

PHOTOGRAPHS

PHOTOGRAPH #1



**BUILDING 8
SECTION D**

Stucco Subcontractor has protected windows and applied scratch coat of three coat 7/8" stucco system.

PHOTOGRAPH #2



**BUILDING 8
SECTION D**

Stucco mixing lay down area with mixer sand and bagged stucco mix.

PHOTOGRAPH #3



**BUILDING 8
SECTION D**

Bagged Broco Stucco Cement mixed with sand at site used for stucco applications.

PHOTOGRAPH #4



**BUILDING 8
SECTION D**

Stucco Sub contractor has complete finish texture coat of three coat 7/8" stucco system.

PHOTOGRAPH #5



**BUILDING 8
SECTION C**

Stucco Subcontractor has protected windows and begun to apply scratch coat of three coat 7/8" stucco system.

PHOTOGRAPH #6



**BUILDING 8
SECTION C**

Stucco Sub contractor has complete finish texture coat of three coat 7/8" stucco system.


PHOTOGRAPH #7



**BUILDING 8
SECTION B**

Stucco Sub Contractor has completed application of vinyl stucco accessories and self-furring metal lath as per specifications and drawings.


PHOTOGRAPH #8

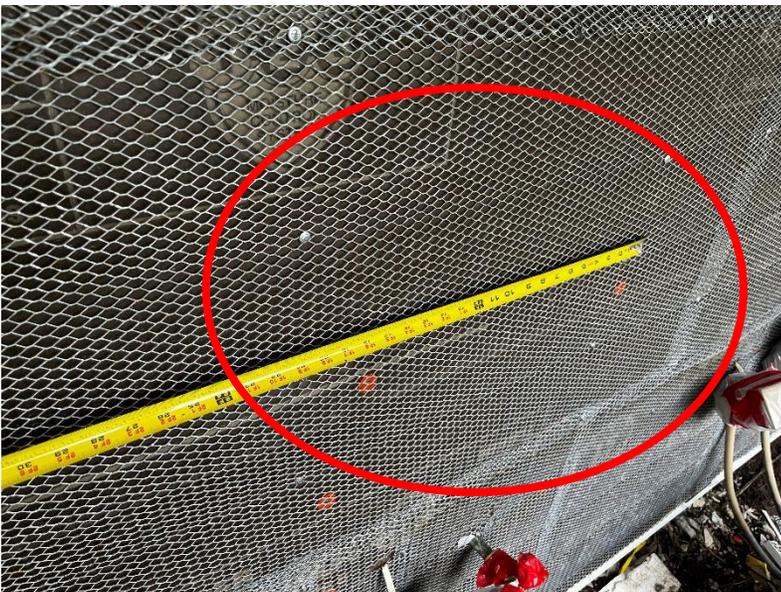

**BUILDING 8
SECTION B**

New galvanized metal lathing attached at framing members 16" O.C. as per drawings.

PHOTOGRAPH #9

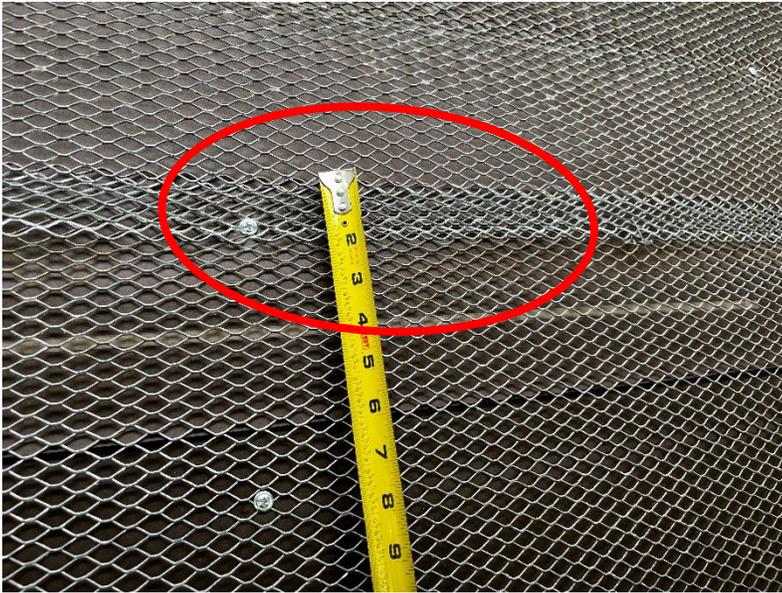

**BUILDING 8
SECTION B**

New galvanized self-furring metal lathing over lapped 2" meets minimum requirement as per drawings and ASTM C1063.

PHOTOGRAPH #10



**BUILDING 8
SECTION A**

Stucco Sub Contractor has completed application of vinyl stucco accessories and self-furring metal lath as per specifications and drawings.


PHOTOGRAPH #11



**BUILDING 8
SECTION G**

Breezeway railings were cleaned (Removing loose paint and rust) with grinders. Contractor has now primed and successfully painted the railings with a finish coat.

PHOTOGRAPH #12

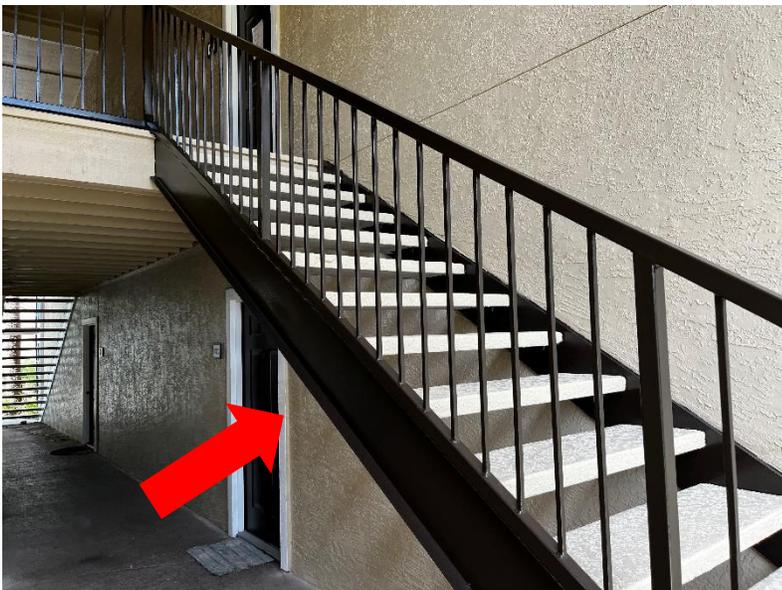

**BUILDING 8
SECTION E**

Breezeway railings were cleaned (Removing loose paint and rust) with grinders. Contractor has now primed and successfully painted the railings with a finish coat.

PHOTOGRAPH #13



**BUILDING 13
SECTION H**

Contractor has installed Dupont Tyvek HomeWrap water resistant barrier temporarily covering the window openings.

PHOTOGRAPH #14



**BUILDING 13
SECTION H**

Dupont Tyvek 3" seam tape applied at all Tyvek HomeWrap sheet over laps.

PHOTOGRAPH #15



**BUILDING 13
SECTION F**

Contractor has begun to install specified 15/32" plywood sheathing fastened to framing members as per drawings and specifications.

PHOTOGRAPH #16



**BUILDING 13
SECTION E**

Copper Green wood preservative applied to new wood framing at breezeway locations.

PHOTOGRAPH #17



**BUILDING 13
SECTION E**

Contractor applying Florida Paints Ultra Supercoat finish paint by backtrolling sprayed materials at breezeways walls.

PHOTOGRAPH #18



**BUILDING 13
SECTION E**

Contractor applying Florida Paints Ultra Supercoat finish paint by backtrolling sprayed materials at breezeways walls.

PHOTOGRAPH #19



**BUILDING 13
SECTION B**

Balcony framing and decking damage reviewed and marked for repairs by Delta.

PHOTOGRAPH #20



**BUILDING 13
SECTION B**

Balcony framing and decking damage reviewed and marked for repairs by Delta.

PHOTOGRAPH #21



**BUILDING 13
SECTION A**

Breezeway framing damage reviewed and marked for repairs by Delta.