

PHOTOGRAPHS

PHOTOGRAPH #1



**BUILDING 8
SECTION D- UNIT #817**

RL James performing drywall repairs around new window installations has covered owners flooring.

PHOTOGRAPH #2



**BUILDING 8
SECTION D- UNIT #817**

RLJ has installed new BASF sealant at interior side of Dupont Flashing to PGT window framing as per drawings and specifications.

PHOTOGRAPH #3



**BUILDING 8
SECTION C- UNIT #817**

RLJ has installed new BASF sealant at interior side of Dupont Flashing to PGT window framing as per drawings and specifications.

PHOTOGRAPH #4



**BUILDING 8
SECTION C**

RLJ has finished stairway railing with Florida Paint Sundeavor Hi- Performance Urethane Enamel.

PHOTOGRAPH #5



**BUILDING 8
SECTION C**

RLJ has finished stairway railing with Florida Paint Sundeavor Hi- Performance Urethane Enamel.

PHOTOGRAPH #6



**BUILDING 8
SECTION B**

Simpson Strong- Tie clips and screws have not been installed at balconies Built up beams as per drawings.

PHOTOGRAPH #7



**BUILDING 8
SECTION A**

RLJ has recoated stairway handrails with Florida Paints epoxy mastic that appears to have cured properly.

PHOTOGRAPH #8



**BUILDING 8
SECTION A**

RLJ has recoated stairway handrails with Florida Paints epoxy mastic that appears to have cured properly.

PHOTOGRAPH #9



**BUILDING 13
SECTION A**

RLJ has finished stairway railing with Florida Paint Sundeavor Hi- Performance Urethane Enamel.

PHOTOGRAPH #10



**BUILDING 8
SECTION F**

Simpson Strong- Tie clips and screws have not been installed at balconies Built up beams as per drawings.

PHOTOGRAPH #11



**BUILDING 8
SECTION G – UNIT #818**

Window header flashing has been caulked shut not allowing weep as designed and will require correction.

PHOTOGRAPH #12



**BUILDING 13
SECTION H**

Stucco sub-contractor has begun to apply Super Jumbo Tex WRB over Dupont Tyvek.

PHOTOGRAPH #13



**BUILDING 13
SECTION H**

Sub-Contractor applying new vinyl control joints and stucco accessories over Jumbo Tex WRB.

PHOTOGRAPH #14



**BUILDING 13
SECTION H- UNIT #1312**

Independent Testing Agency performed water testing at single PGT SH7700A window as per AMMA 502 with no failures or water penetration.

PHOTOGRAPH #15



**BUILDING 13
SECTION G – UNIT #1312**

Independent Testing Agency performed water testing at double PGT SH7700A window as per AMMA 502 with no failures or water penetration.

PHOTOGRAPH #16



**BUILDING 13
SECTION G- UNIT #1312**

Independent Testing Agency performed water testing at double PGT SH7700A window as per AMMA 502 with no failures or water penetration.

PHOTOGRAPH #17



**BUILDING 13
SECTION G**

Stucco sub-contractor has begun to apply Super Jumbo Tex WRB over Dupont Tyvek.

PHOTOGRAPH #18



**BUILDING 13
SECTION F**

Stucco sub-contractor has begun to apply Super Jumbo Tex WRB over Dupont Tyvek

PHOTOGRAPH #19



**BUILDING 13
SECTION F**

Stucco sub-contractor has begun to apply Super Jumbo Tex WRB over Dupont Tyvek.

PHOTOGRAPH #20



**BUILDING 13
SECTION D**

RLJ in process of gable end reinforcement repairs as per drawings.

PHOTOGRAPH #21



**BUILDING 13
SECTION D**

Southern Yellow Pine 2X6 L-scabs attached to existing 2x4 gable end stud for reinforcement as per drawings.

PHOTOGRAPH #22



**BUILDING 13
SECTION D**

Simpson Strong – Tie LSTA -21 strap attached at end of lateral braces to retrofit studs.

PHOTOGRAPH #23



**BUILDING 13
SECTION C**

RLJ has sealed base plate to slab with BASF urethane sealant as per drawing S-6.4. A

PHOTOGRAPH #24



**BUILDING 13
SECTION B**

RLJ has begun installing Simpson Strong tie connector straps and hardware.

PHOTOGRAPH #25



**BUILDING 18
SECTION H**

RLJ has removed existing stucco and begun removal of existing sheathing board.

PHOTOGRAPH #26



**BUILDING 18
SECTION H**

Gable end wall covered with heavy duty plastic sheathing for protection from weather during repairs.


PHOTOGRAPH #27



**BUILDING 18
SECTION G**

RLJ has removed existing stucco and begun removal of existing sheathing board.

PHOTOGRAPH #28

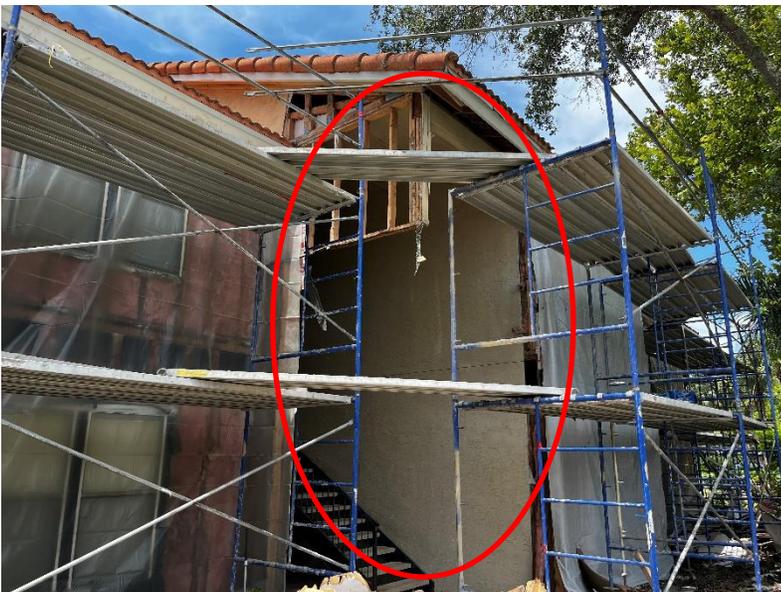

**BUILDING 18
SECTION G**

During stucco demo damaged framing and built-up post at corner has collapsed.