

PHOTOGRAPHS


PHOTOGRAPH #1



**BUILDING 8
SECTION A- BREZEWAY**

Flooring coated with Florida Paints TropiCrete Exterior Concrete Sealer .

PHOTOGRAPH #2

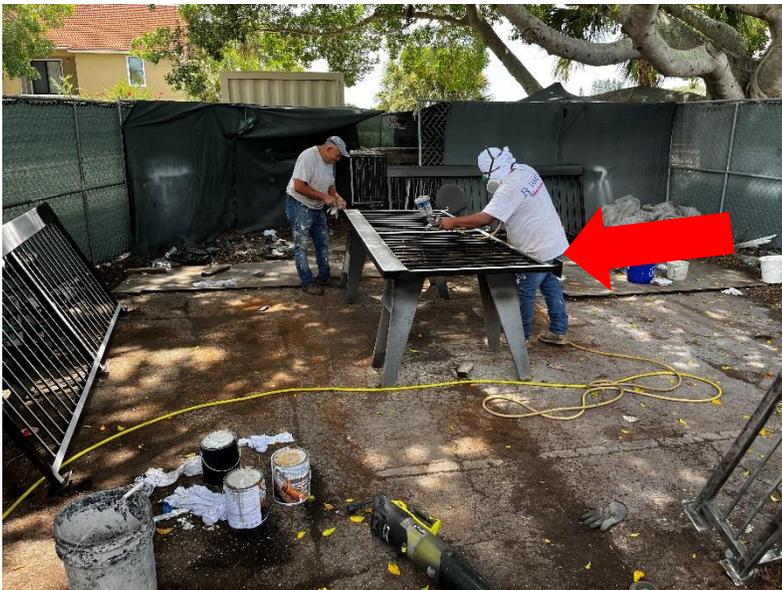

**BUILDING 8
SECTION A**

Steel balcony railings finish coated with Florida Paints Urethane Aliphatic gloss enamel.

PHOTOGRAPH #3



**BUILDING 8
SECTION B**

Final cleanup of stucco and construction debris is not complete.

PHOTOGRAPH #4



**BUILDING 8
SECTION B**

Simpson Strong-Tie #SDW22458 Screws and shear clips installed at balcony built up beams.

PHOTOGRAPH #5



**BUILDING 8
SECTION B**

Flooring coated with Florida Paints
TropiCrete Exterior Concrete Sealer.

PHOTOGRAPH #6



**BUILDING 8
SECTION E- UNIT #828**

Trim Painting at single window band is not
complete

PHOTOGRAPH #7



**BUILDING 8
SECTION F**

Simpson Strong-Tie #SDW22458 Screws and shear clips installed at balcony built up beams.

PHOTOGRAPH #8



**BUILDING 13
SECTION G**

Stucco sub-contractor has applied stucco accessories and galvanized metal self-furring lathing as per drawings.


PHOTOGRAPH #9



**BUILDING 13
SECTION G**

Metal lath overlap has not been tied between framing supports with tie wire at this location.


PHOTOGRAPH #10

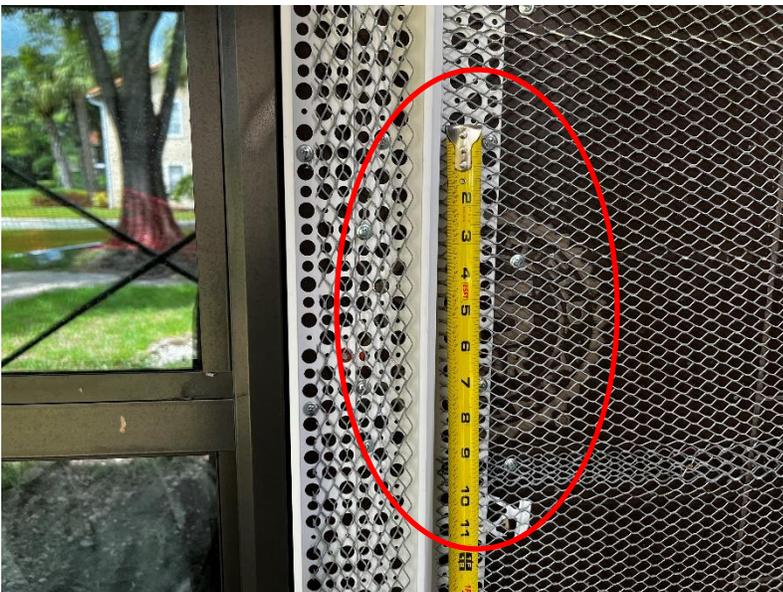

**BUILDING 13
SECTION F**

Stucco sub-contractor has fastened stucco joints and stop accessories a 7" O.C. as per ASTM C1063.

PHOTOGRAPH #11

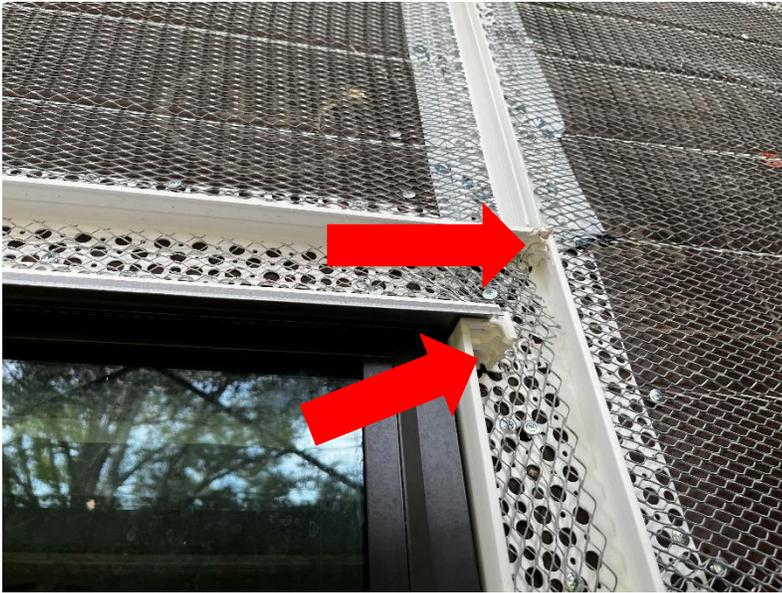

**BUILDING 13
SECTION F**

New urethane sealants applied at stucco accessory transitions and butt joints as per drawings.

PHOTOGRAPH #12



**BUILDING 13
SECTION E**

Stucco sub-contractor has applied stucco accessories and galvanized metal self-furring lathing as per drawings.

PHOTOGRAPH #13



**BUILDING 13
SECTION D**

RLJ has installed 15/32" plywood sheathing and covered with plastic protection.

PHOTOGRAPH #14



**BUILDING 13
SECTION C**

RLJ has installed 15/32" plywood sheathing and covered with plastic protection.

PHOTOGRAPH #15



**BUILDING 13
SECTION B**

Pest control contractor has applied Bora-Care termite treatment to framing as per specifications.

PHOTOGRAPH #16



**BUILDING 13
SECTION B**

Pest control contractor has applied Bora-Care termite treatment to framing as per specifications.

PHOTOGRAPH #17



**BUILDING 18
SECTION H**

RLJ continuing cross bracing reinforcement repairs at gable ends as per drawings and specifications

PHOTOGRAPH #18



**BUILDING 13
SECTION H**

Second floor plate and flooring truss framing damage inspected and marked for repairs.

PHOTOGRAPH #19



**BUILDING 18
SECTION H**

Damaged framing at subfloor, studs, plates and window headers marked for repairs.

PHOTOGRAPH #20



**BUILDING 13
SECTION H**

Damaged gable end truss and second floor top plate framing marked for repairs.

PHOTOGRAPH #21



**BUILDING 13
SECTION G**

Damaged bottom plate and window stud framing marked for repairs.

PHOTOGRAPH #22



**BUILDING 13
SECTION G**

Damaged window headers and framing marked for repairs.