

PHOTOGRAPHS


PHOTOGRAPH #1



**BUILDING 8
UNIT #828 ATTIC**

Contractor has performed scab repairs at trusses as per drawings.

PHOTOGRAPH #2

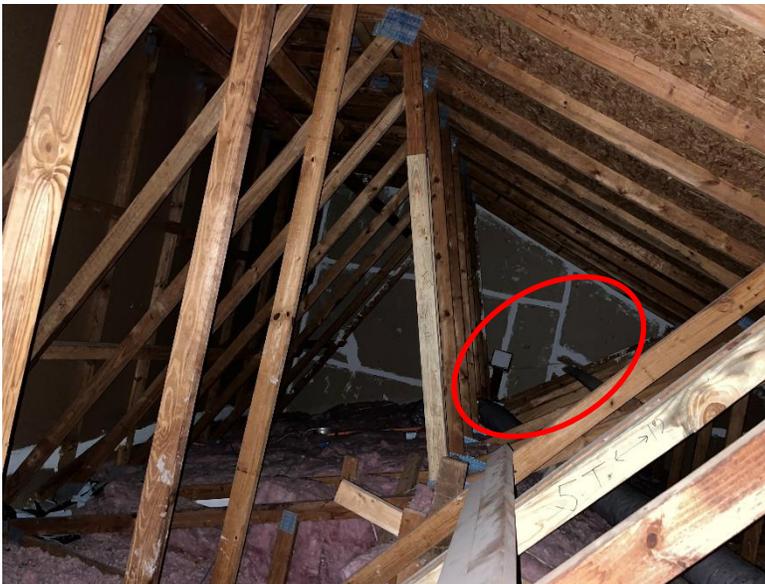

**BUILDING 8
UNIT #828 ATTIC**

Fire rated gypsum board installed at holes in existing fire walls and fire caulk applied at perimeters.

PHOTOGRAPH #3



**BUILDING 13
SECTION E BREEZEWAY**

Stucco sub-contractor attaching vinyl corner beading to framing at 7" O.C. max per ASTM C1063 and drawings.

PHOTOGRAPH #4



**BUILDING 13
SECTION D**

Lathing inspection completed and elevating approved for stucco application.

PHOTOGRAPH #5



**BUILDING 13
SECTION C**

Stucco subcontractor applying self-furring galvanized metal lath as per specification and drawings.


PHOTOGRAPH #6



**BUILDING 18
SECTION H**

Plywood sheathing attached to framing in field members at less than 6" O.C. with 8d common nails as per drawings.

PHOTOGRAPH #7

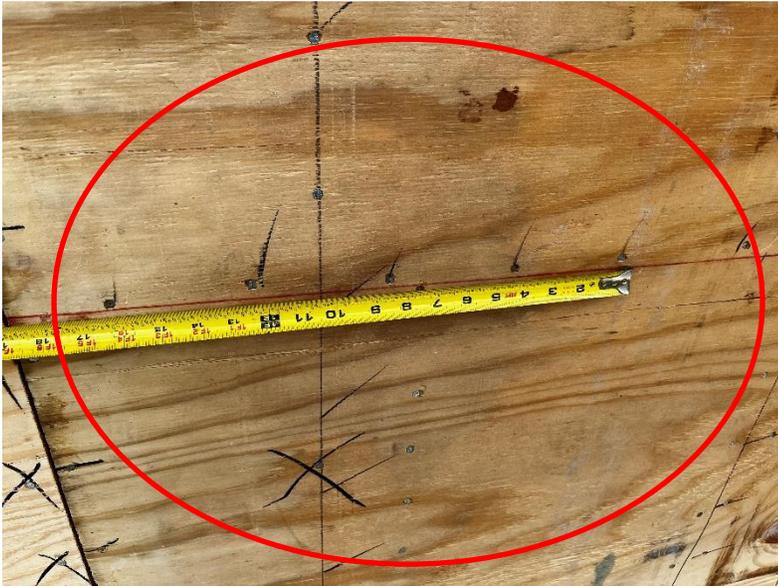

**BUILDING 18
SECTION H**

Plywood sheathing attached along perimeter to framing at 4" O.C. with 8d common nails as per drawings.

PHOTOGRAPH #8



**BUILDING 18
SECTION H**

New Green Heck louvers temporarily installed at gable end.

PHOTOGRAPH #9



**BUILDING 18
SECTION H**

4'x 8' - 15/32" pressure treated plywood for bottom row sheathing as per plans and drawings.

PHOTOGRAPH #10



**BUILDING 18
SECTION G BREEZEWAY**

Contractor has replaced damaged Breezeway framing box beam and studs.

PHOTOGRAPH #11



**BUILDING 18
SECTION G BREEZEWAY**

RLJ has corrected installation of threaded rods at new breezeway pedestal detail as per drawings.

PHOTOGRAPH #12



**BUILDING 18
SECTION F**

RLJ has corrected installation of threaded rods at new balcony pedestal detail as per drawings.

PHOTOGRAPH #13



**BUILDING 18
SECTION E**

Balconies and framing inspected and marked for repairs.

PHOTOGRAPH #14



**BUILDING 18
SECTION E**

Damaged framing studs marked for repairs.

PHOTOGRAPH #15



**BUILDING 18
SECTION D**

Gable end framing inspected and marked for repairs.

PHOTOGRAPH #16



**BUILDING 18
SECTION D**

Damaged window headers marked for repairs.

PHOTOGRAPH #17



**BUILDING 18
SECTION D**

Damaged bottom plates , floor trusses, window headers and window framing marked for repairs.

PHOTOGRAPH #18



**BUILDING 18
SECTION D**

Damaged window framing marked for repairs.

PHOTOGRAPH #19



**BUILDING 18
SECTION D**

RLJ has begun gable end bracing as per drawings and specifications.