

**PHOTOGRAPH #1**



**BUILDING 13  
SECTION A – UNIT 1321**

Contractor has Installed railings with anchor bolts at built up balcony beam and wall framing as per drawings.

**PHOTOGRAPH #2**



**BUILDING 13  
SECTION A- UNIT 1321**

Contractor has Installed railings with anchor bolts at built up balcony beam and wall framing as per drawings.

**PHOTOGRAPH #3**



**BUILDING 13  
SECTION A- UNIT 1321**

Contractor has Installed railings with anchor bolts at built up balcony beam and wall framing as per drawings.

**PHOTOGRAPH #4**



**BUILDING 13  
SECTION A – UNIT 1321**

Contractor has Installed railings with anchor bolts at built up balcony beam and wall framing as per drawings.

**PHOTOGRAPH #5**



**BUILDING 13  
ATTIC REPAIRS - UNIT 1327**

Gusset repairs at roof trusses performed and quantified.

**PHOTOGRAPH #6**



**BUILDING 13  
ATTIC REPAIRS - UNIT 1327**

Scab repairs at roof trusses performed and quantified.

**PHOTOGRAPH #7**



**BUILDING 13  
ATTIC REPAIRS - UNIT 1327**

Fire board repairs performed in attic space by contractor and quantified.

**PHOTOGRAPH #8**



**BUILDING 13  
SECTION E - UNIT 1324**

Broken stair pad has not been repaired at breezeway stairway.

**PHOTOGRAPH #9**



**BUILDING 18  
SECTION A- UNIT #1811**

Contractor has shored up wall inside of unit preparing to remove sliding glass doors and replace damaged headers and framing.

**PHOTOGRAPH #10**



**BUILDING 18  
SECTION A-UNIT #1811**

Additional damaged framing studs marked for replacement after stucco was fully removed by contractor.

**PHOTOGRAPH #11**



**BUILDING 18  
SECTION A-UNIT #1811**

Contractor has replaced damaged headers and reinstalled Sliding glass door.

**PHOTOGRAPH #12**



**BUILDING 18  
SECTION A-UNIT #1811**

Contractor installing new 15/32" plywood sheathing with fasteners at framing studs 16" O.C. as per drawings and specification.

**PHOTOGRAPH #13**



**BUILDING 18  
SECTION A**

DuPont Tyvek HomeWrap water resistive barrier applied over new plywood sheathing.


**PHOTOGRAPH #14**



**BUILDING 18  
SECTION B**

Contractor has installed new 15/32" plywood sheathing using pressure treated plywood at bottom row as per specifications.

**PHOTOGRAPH #15**

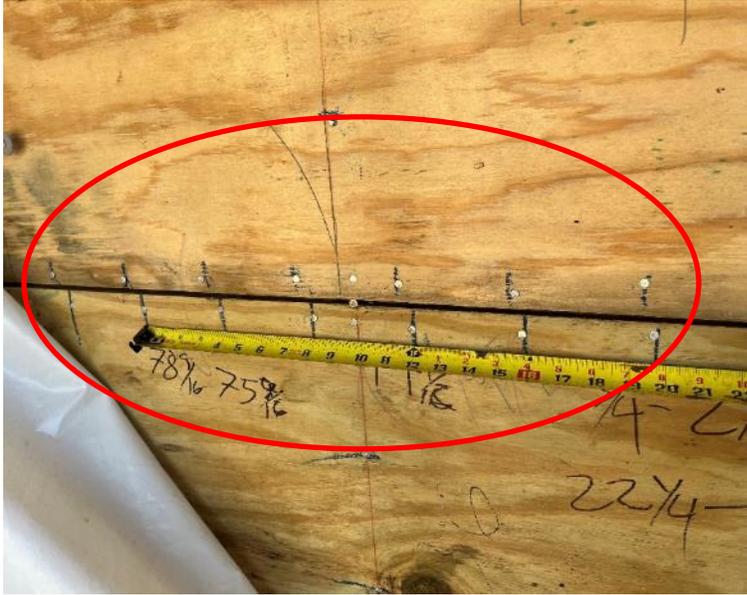

**BUILDING 18  
SECTION B**

Contractor installing new 15/32" plywood sheathing with fasteners at perimeters at 4" O.C. as per drawings and specification.


**PHOTOGRAPH #16**



**BUILDING 18  
SECTION B**

DuPont Tyvek HomeWrap water resistive barrier applied over new plywood sheathing.

**PHOTOGRAPH #17**

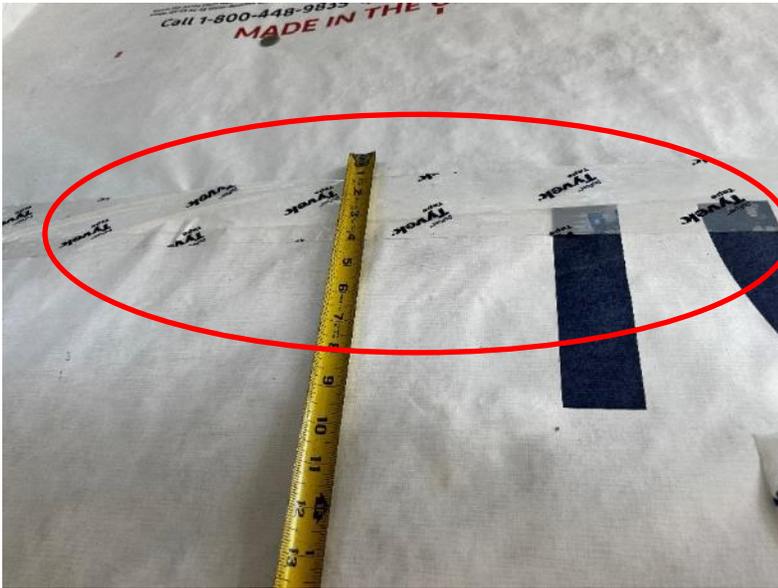

**BUILDING 18  
SECTION B**

Contractor applied Tyvek 3" tape at overlap of HomeWrap water resistive barrier as per manufacture requirements and specification.

**PHOTOGRAPH #18**



**BUILDING 18  
SECTION B- UNIT 1815**

Gap from windows to head framing greater than max. 5/16" allowed by PGT NOA.

**PHOTOGRAPH #19**



**BUILDING 18  
SECTION C**

Stucco subcontractor applying Jumbo Tex 60 water resistive barrier over Tyvek HomeWrap WRB.

**PHOTOGRAPH #20**



**BUILDING 18  
SECTION C-UNIT 1817**

Gap from windows to head framing greater than max. 5/16" allowed by PGT NOA .

**PHOTOGRAPH #21**



**BUILDING 18  
SECTION C- UNIT 1817**

Stucco subcontractor has begun to apply vinyl stucco accessories at window openings over Jumbo Tex 60 water resistive barrier.

**PHOTOGRAPH #22**



**BUILDING 18  
SECTION D**

Stucco subcontractor has applied finish coat of stucco as per ASTM C 926.

**PHOTOGRAPH #23**



**BUILDING 18  
SECTION E**

Stucco subcontractor has applied finish coat of stucco as per ASTM C 926.

**PHOTOGRAPH #24**



**BUILDING 18  
SECTION F**

Finish stucco primed with Florida Paints SunFlex Masonry and Concrete acrylic primer.

**PHOTOGRAPH #25**



**BUILDING 18  
SECTION F**

Finish stucco primed and finish coated with Florida Paints Glades Exterior 100% acrylic finish paint.

**PHOTOGRAPH #26**



**BUILDING 18  
SECTION G**

Finish stucco primed and finish coated with Florida Paints Glades Exterior 100% acrylic finish paint.

**PHOTOGRAPH #27**



**BUILDING 18  
SECTION H**

RLJ applying Florida Paints Glades Exterior 100% acrylic finish paint by spray and back rolling technique.

**PHOTOGRAPH #28**



**BUILDING 18  
SECTION H**

RLJ applying Florida Paints Glades Exterior 100% acrylic finish paint by spray and back rolling technique.