

**PHOTOGRAPH #1**



**BUILDING 11  
SECTION H**

Contractor has installed new PGT windows with Dupont flashings as per manufacturers recommendations and PM drawings.

**PHOTOGRAPH #2**



**BUILDING 11  
SECTION H**

Window flange fastened to framing studs with 2 1/2" 8d common nails 5" O.C.

**PHOTOGRAPH #3**



**BUILDING 11  
SECTION H**

Window flange fastened to framing studs with 2 1/2" 8d common nails 5" O.C.

**PHOTOGRAPH #4**



**BUILDING 11  
SECTION H – UNIT 1112**

Gap between window header and window frame exceeds maximum 5/16" allowance by manufacturers NOA. And will require corrective measures for approval.

**PHOTOGRAPH #5**



**BUILDING 11  
SECTION G**

New 15/32" plywood sheathing inspected for approval to cover with water vapor barriers and begin window installation.

**PHOTOGRAPH #6**



**BUILDING 11  
SECTION F**

New 15/32" plywood sheathing inspected for approval to cover with water resistant barriers and begin window installation.

**PHOTOGRAPH #7**



**BUILDING 11  
SECTION F**

Contractor has covered new sheathing with Tyvek HomeWrap water resistant barrier.

**PHOTOGRAPH #8**



**BUILDING 11  
SECTION E**

Contractor making fastening corrections at new plywood sheathing marked by Delta.


**PHOTOGRAPH #9**



**BUILDING 11  
SECTION E**

Contractor has covered new sheathing with Tyvek HomeWrap water resistant barrier.

**PHOTOGRAPH #10**

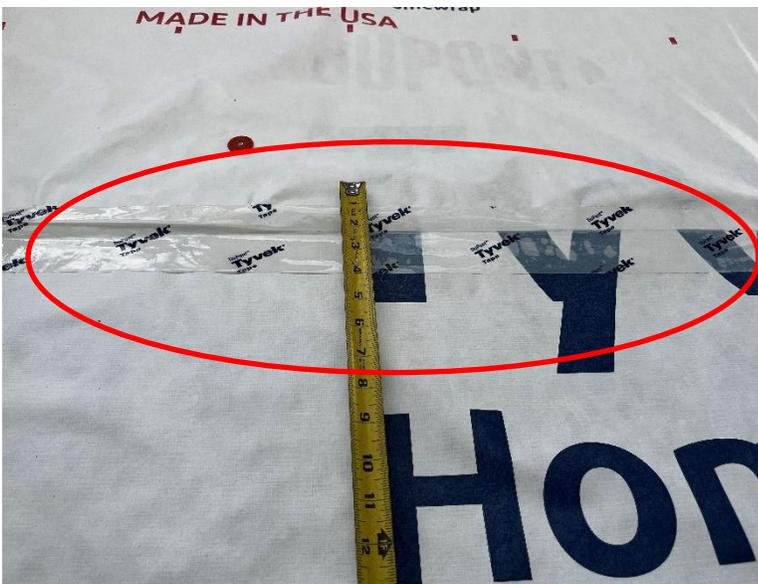

**BUILDING 11  
SECTION E**

4" Tyvek seam tape used at overlapping water barrier seams.

**PHOTOGRAPH #11**



**BUILDING 11  
SECTION E**

Contractor in process of grinding balcony railings in preparation for new primer and paint finish.

**PHOTOGRAPH #12**



**BUILDING 12  
SECTION G**

Completed framing repairs quantified and documented for billing.

**PHOTOGRAPH #13**



**BUILDING 12  
SECTION G**

New plywood, trim and venting accessories installed at soffit as per drawings and specifications.

**PHOTOGRAPH #14**



**BUILDING 12  
SECTION E**

Contractor in process of installing Simson Strong-Tie connectors at framing and base plate.

**PHOTOGRAPH #15**



**BUILDING 12  
SECTION E-**

Completed framing repairs quantified and documented for billing.