

PHOTOGRAPH #1



**BUILDING 11
SECTION H**

Stucco sub-contractor has performed application of stucco lathing and vinyl stucco accessories.


PHOTOGRAPH #2



**BUILDING 11
SECTION H**

Landscaping has yet to be removed in order to apply stucco at base of wall.


PHOTOGRAPH #3

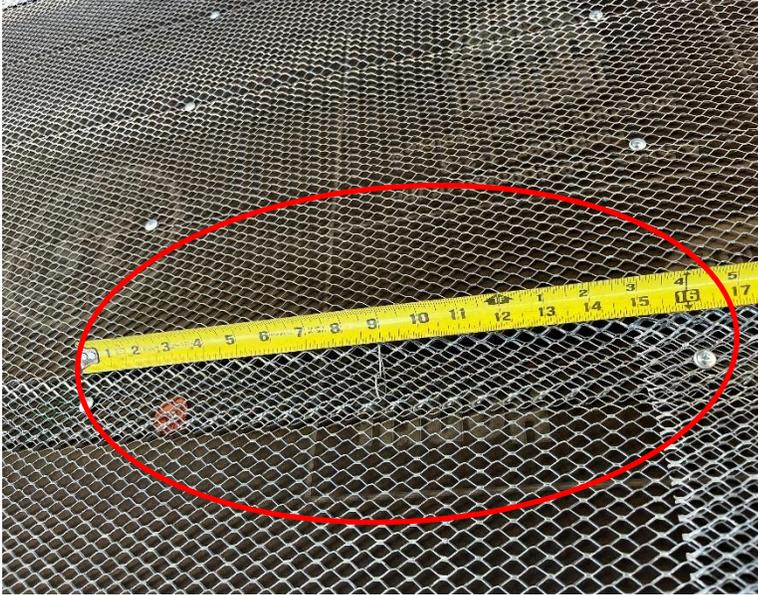

**BUILDING 11
SECTION H**

New galvanized self-furring lath over lapped, fastened and tied as per drawings to meet ASTM C847.

PHOTOGRAPH #4

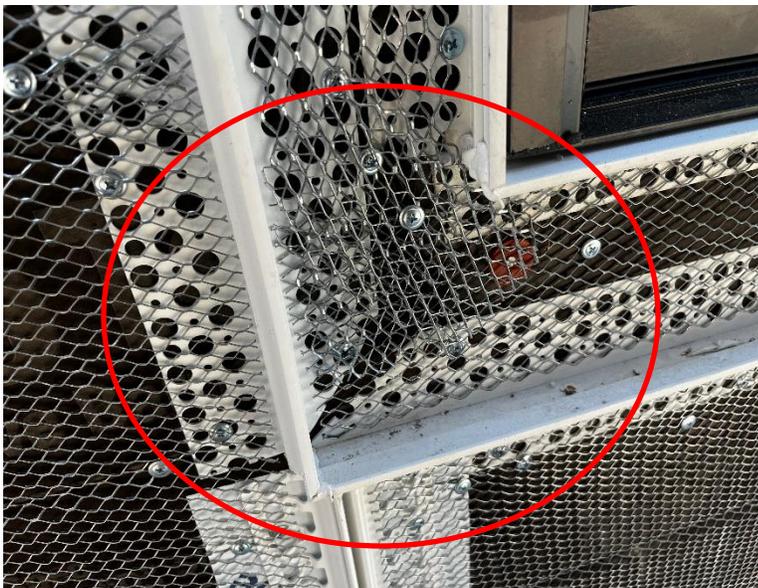

**BUILDING 11
SECTION H**

2"x4" metal lath Butterfly tied to self-furring lath installed.

PHOTOGRAPH #5



**BUILDING 11
SECTION H**

Galvanized L- flashing with drip edge spaced 1/4" from J- channel stucco accessory at head of windows.

PHOTOGRAPH #6



**BUILDING 11
SECTION F**

Stucco sub-contractor installing control joints and window banding vinyl stucco accessories over secondary WRB as per drawings and details.

PHOTOGRAPH #7



**BUILDING 11
SECTION F**

Simpson Strong HGA10KT Shear clip and SDW22458 Screws installed at balcony built up beam as per drawings.

PHOTOGRAPH #8



**BUILDING 12
SECTION F**

6" wide Dupont flashing tape applied over secondary WRB before application of vertical control joint accessory as per drawings.

PHOTOGRAPH #9



**BUILDING 11
SECTION D - UNIT 1117**

Contractor replacing damaged window framing with new #2 southern yellow pine 2"X4" framing.

PHOTOGRAPH #10



**BUILDING 11
SECTION B - UNIT 1125**

Delta reviewed upper balcony deck and marked for full built-up beam and deck board replacement.

PHOTOGRAPH #11



**BUILDING 11
SECTION B- UNIT 1123**

Delta reviewed upper balcony deck and marked for full built-up beam and deck board replacement.

PHOTOGRAPH #12



**BUILDING 11
SECTION B- UNIT 1123**

Delta reviewed upper balcony deck and marked for full built-up beam and deck board replacement.


PHOTOGRAPH #13



**BUILDING 12
SECTION H**

Contractor installing new 15/32" plywood sheathing at gable end wall.

PHOTOGRAPH #14

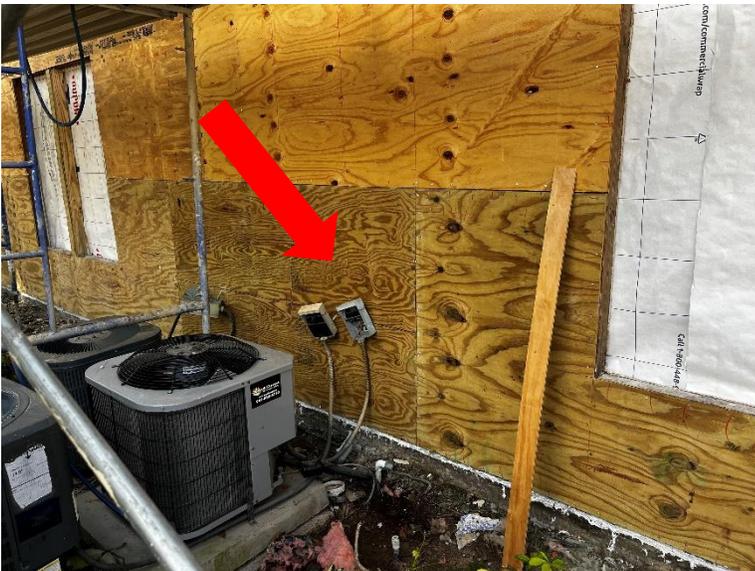

**BUILDING 12
SECTION H**

Bottom row of plywood sheathing is pressure treated plywood as per PM specifications.

PHOTOGRAPH #15



**BUILDING 12
SECTION G**

Contractor has prepared metal stairway railings for primer and paint by hand grinding.

PHOTOGRAPH #16



**BUILDING 12
SECTION F**

Simpson Strong HGA10KT Shear clip and SDW22458 Screws installed at balcony built up beam as per drawings.

PHOTOGRAPH #17



**BUILDING 12
SECTION F**

Contractor adding additional urethane sealant at bottom plate before attachment of new plywood to seal plywood at the bottom edge.


PHOTOGRAPH #18



**BUILDING 12
SECTION F**

Simpson Strong-Tie connectors, straps and screws installed at framing studs to top plate and top plate to trusses.

PHOTOGRAPH #19

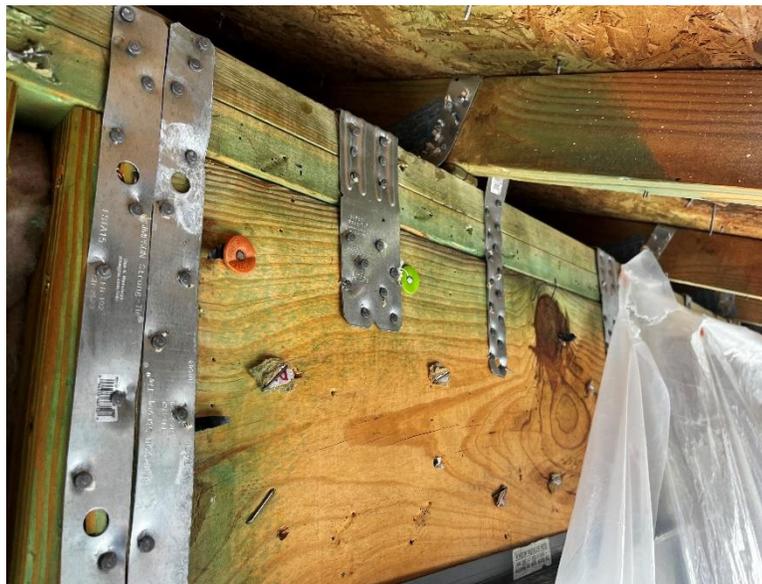

**BUILDING 12
SECTION F**

Simpson Strong-Tie connectors, straps and screws installed at window headers to top plate and top plate to trusses.

PHOTOGRAPH #20



**BUILDING 12
SECTION F**

Simpson Strong strap connected corner post to top plate but missing connection from top plate to truss.


PHOTOGRAPH #21



**BUILDING 12
SECTION F**

Contractor added straps to connect top plate to truss as directed.

PHOTOGRAPH #22

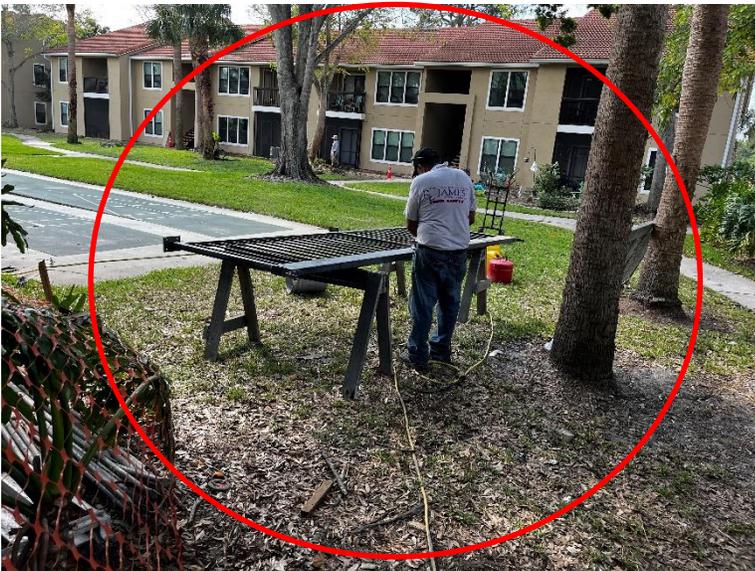

**BUILDING 12
SECTION F**

Contractor in process of prepared metal balcony railings for primer and paint by hand grinding.