


PHOTOGRAPH #1



**BUILDING 11
SECTION H**

Stucco sub-contractors applying finish texture coat of stucco over brown coat.

PHOTOGRAPH #2

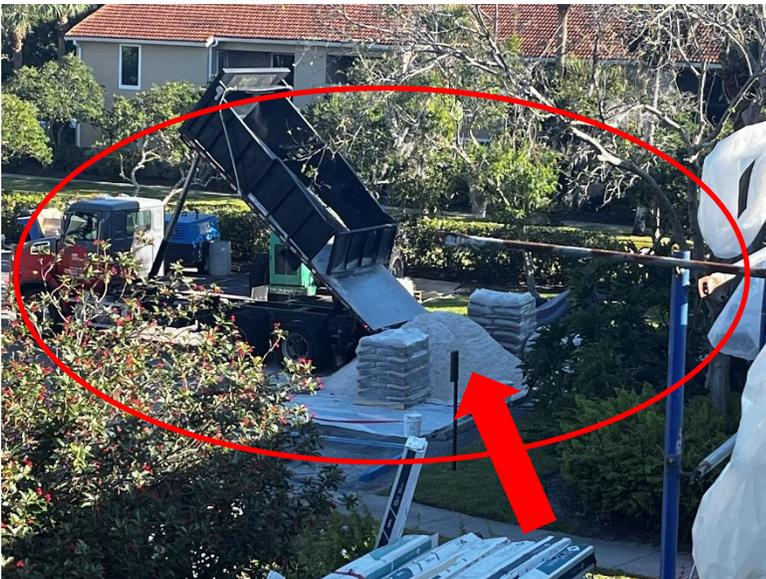

**BUILDING 11
SECTION H**

Delivery of new sand for stucco mixing in parking lot.

PHOTOGRAPH #3



**BUILDING 11
SECTION H**

Stucco sub-contractor has applied scratch coat of stucco using approved AMEX Broco bagged stucco cement and sand.


PHOTOGRAPH #4



**BUILDING 11
SECTION G**

Stucco sub-contractor has begun to apply brown coat of stucco over scratch coat.

PHOTOGRAPH #5

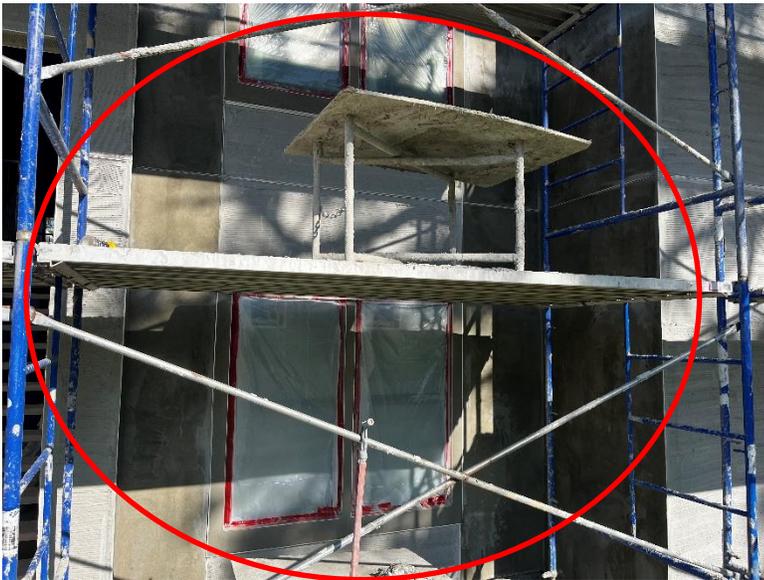

**BUILDING 11
SECTION G**

Stucco sub-contractor has begun to apply brown coat of stucco over scratch coat.

PHOTOGRAPH #6



**BUILDING 11
SECTION F**

Stucco contractor has applied full three coat 7/8" thick stucco system to wall.

PHOTOGRAPH #7



**BUILDING 11
SECTION E**

Stucco contractor has applied full three coat 7/8" thick stucco system to wall.

PHOTOGRAPH #8



**BUILDING 11
SECTION E- UNIT 1118**

Windows masked and new backing rod installed in preparation for sealant application at window perimeters.

PHOTOGRAPH #9



**BUILDING 11
SECTION E - UNIT 1118**

Soft Cell backing rod used at window perimeters prior to new sealant application.

PHOTOGRAPH #10



**BUILDING 11
SECTION D**

Contractor has installed new 15/32" plywood sheathing as per specifications and drawings.


PHOTOGRAPH #11



**BUILDING 11
SECTION D**

Urethane Sealant applied at bottom plate to concrete foundation and bottom plate to new plywood at base as per drawings and details.

PHOTOGRAPH #12

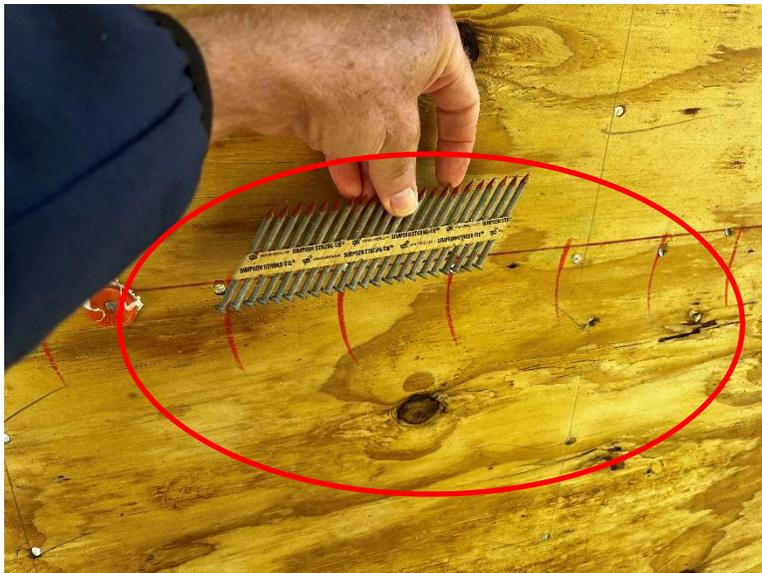

**BUILDING 11
SECTION D**

Contractor attaching new plywood sheathing to wall framing with Simpson Strong -Tie 8d nails spaced along perimeter at 4"O.C.


PHOTOGRAPH #13



**BUILDING 11
SECTION C**

Termite contractor has sprayed Bora Care termite treatment on wall framing.

PHOTOGRAPH #14

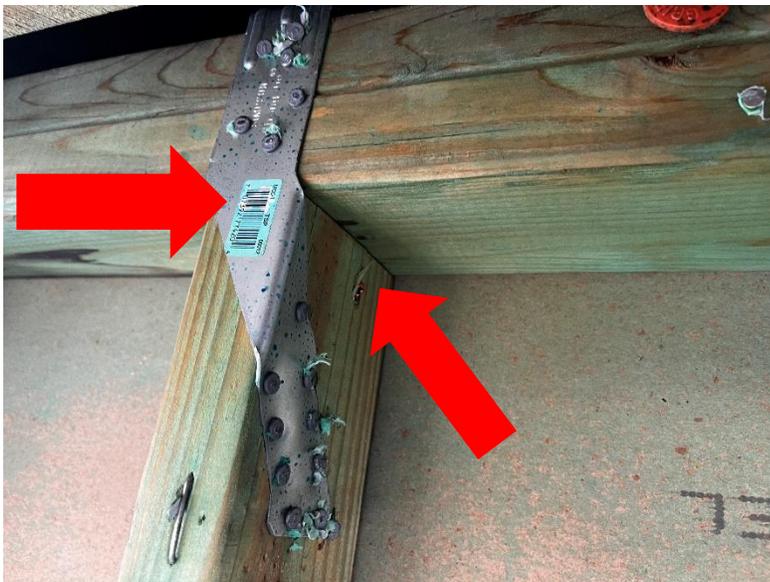

**BUILDING 11
SECTION B**

New TSP Simpson Strong-Tie connector and SDWC screw installed at wall stud to top plate as per drawings.


PHOTOGRAPH #15



**BUILDING 11
SECTION B**

Contractor has completed installing straps and connectors at exterior walls as per drawings.

PHOTOGRAPH #16

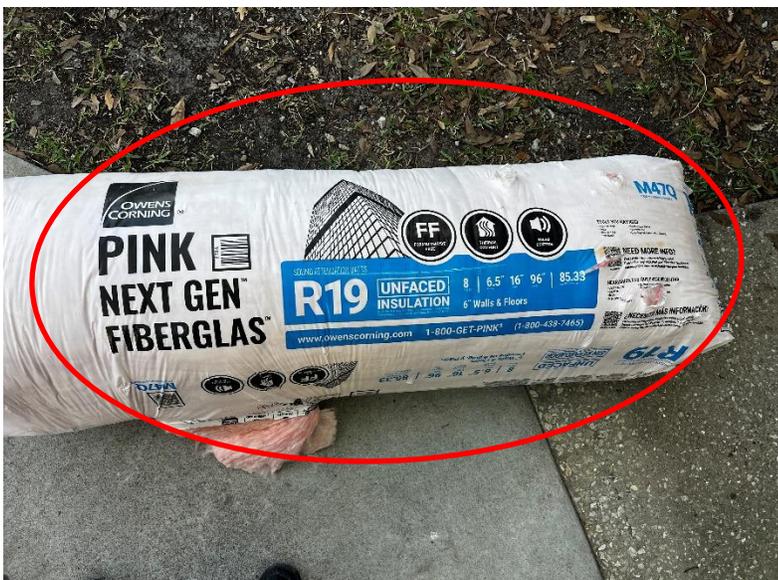

**BUILDING 11
SECTION B**

OWENS CORNING R19 insulation place between wall framing of interior spacing walls at locations of missing or damaged insulation.

PHOTOGRAPH #17



**BUILDING 11
SECTION A**

Contractor has completed installing straps and connectors at exterior walls as per drawings.


PHOTOGRAPH #18



**BUILDING 12
SECTION H**

Stucco sub-contractor has installed new vinyl stucco accessories and galvanized lathing over water resistant barriers.

PHOTOGRAPH #19

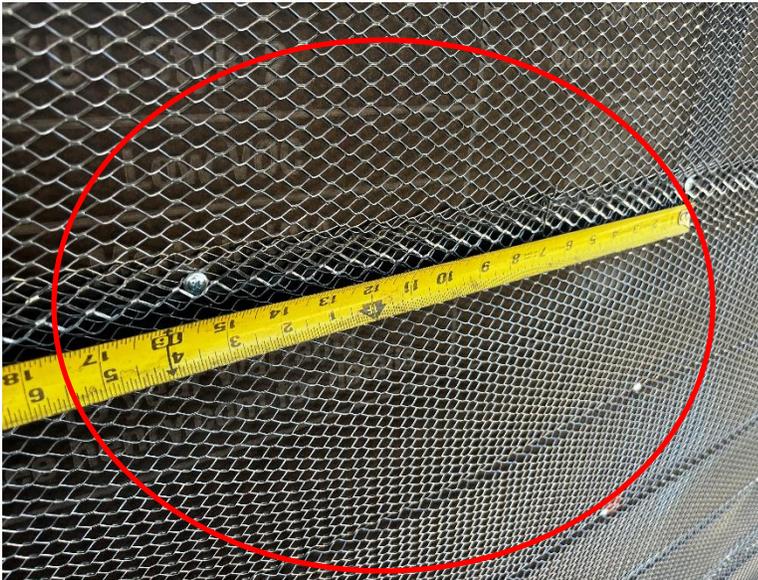

**BUILDING 12
SECTION H**

Metal lathing fastened to wall framing at 16" O.C. and tied at overlapping between fasteners.

PHOTOGRAPH #20



**BUILDING 12
SECTION H**

#8 - 1½" wafer head self-taping screws used for attachment of galvanized lathing to wall framing.

PHOTOGRAPH #21



**BUILDING 12
SECTION H**

Overlapping of galvanized lathing 2" at ends of lathing sheets.

PHOTOGRAPH #22



**BUILDING 12
SECTION H**

Tie wires at overlapping lathing between framing missed and marked for correction by contractor.


PHOTOGRAPH #23



**BUILDING 12
SECTION H**

Contractor has made corrections by providing tie wires at lathing overlapping as required by ASTM C1063.

PHOTOGRAPH #24

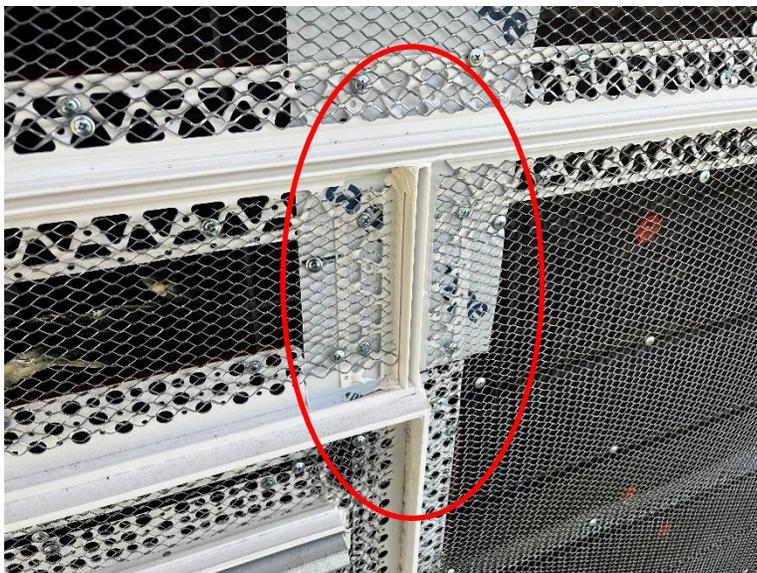

**BUILDING 12
SECTION G**

New vinyl stucco accessories sealed at butts and transitions with urethane sealant as per drawings.

PHOTOGRAPH #25



**BUILDING 12
SECTION G**

New vinyl stucco accessories sealed at butts and transitions with urethane sealant as per drawings.

PHOTOGRAPH #26



**BUILDING 12
SECTION F**

New soffit plywood, trim and vinyl venting installed as per drawings.