


PHOTOGRAPH #1



**BUILDING 11
SECTION H**

Contractor masking window framing in preparation for new MasterSeal 150 sealant at window perimeter.

PHOTOGRAPH #2

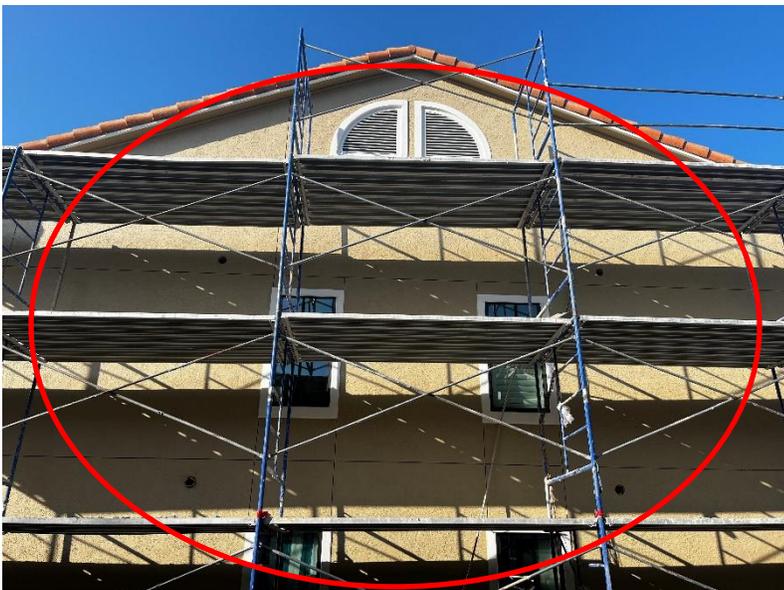

**BUILDING 11
SECTION H**

New Florida Paints primer and finish applied to new stucco at gable end wall.

PHOTOGRAPH #3



**BUILDING 11
SECTION G**

New Florida Paints primer and finish applied to new stucco.

PHOTOGRAPH #4



**BUILDING 11
SECTION G**

Contractor has removed framing scaffolding and begun to clean grounds.

PHOTOGRAPH #5



**BUILDING 11
SECTION F**

Contractor has primed and painted new stucco and in process of removing scaffolding.

PHOTOGRAPH #6



**BUILDING 11
SECTION F**

Sealant at window perimeter has sand stuck to sealant surface and will require painting for proper appearance.

PHOTOGRAPH #7



**BUILDING 11
SECTION F- UNIT 1126**

Simpson Strong- Tie Screws required at balcony deck ledger to blocking have not yet been installed as per drawings.

PHOTOGRAPH #8



**BUILDING 11
SECTION E**

Contractor has primed and painted new stucco and in process of removing scaffolding.

PHOTOGRAPH #9



**BUILDING 11
SECTION D**

New PGT SH7700A single hung windows being installed at gale end wall.

PHOTOGRAPH #10



**BUILDING 11
SECTION D - UNIT 1118**

Dupont FlexWrap applied at windowsill and Straight Flash applied at window jams prior to installation of new window.

PHOTOGRAPH #11



**BUILDING 11
SECTION D - UNIT 1118**

Loctite spray adhesive used to enhance bond of Dupont flashing to Tyvek HomeWrap as per manufacturers recommendations.

PHOTOGRAPH #12



**BUILDING 11
SECTION D - UNIT 1118**

Urethane Sealant applied between new window flange and Dupont flashings as per manufacturers recommendations.

PHOTOGRAPH #13



**BUILDING 11
SECTION D - UNIT 1117**

New window seated into opening and fastened with 2 1/2" 8d common nails spaced along perimeter at 5" O.C.

PHOTOGRAPH #14



**BUILDING 11
SECTION D - UNIT 1117**

New window seated into opening and fastened with 2 1/2" 8d common nails spaced along perimeter at 5" O.C.


PHOTOGRAPH #15



**BUILDING 11
SECTION D - UNIT 1117**

Interior gap from window frame to head framing meets manufactures Max. 5/16" requirements.

PHOTOGRAPH #16

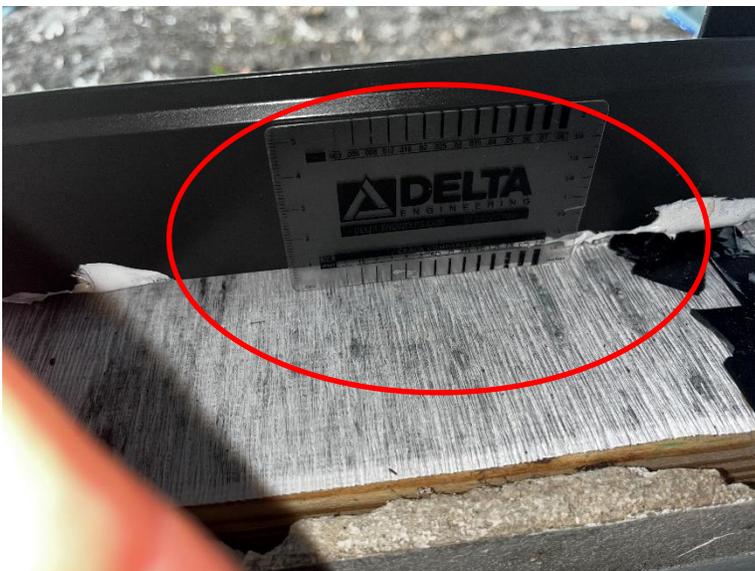

**BUILDING 11
SECTION D - UNIT 1117**

Interior gap from window frame to sill framing meets manufactures Max. 5/16" requirements.

PHOTOGRAPH #17



**BUILDING 11
SECTION C**

Contractor has applied new Tyvek HomeWrap WRB over new 15/32" plywood sheathing.

PHOTOGRAPH #18



**BUILDING 11
SECTION B**

Missed fasteners and damaged plywood marked for corrections.


PHOTOGRAPH #19



**BUILDING 11
SECTION B**

Contractor making corrections and adding fasteners where required as per drawings and specifications.

PHOTOGRAPH #20

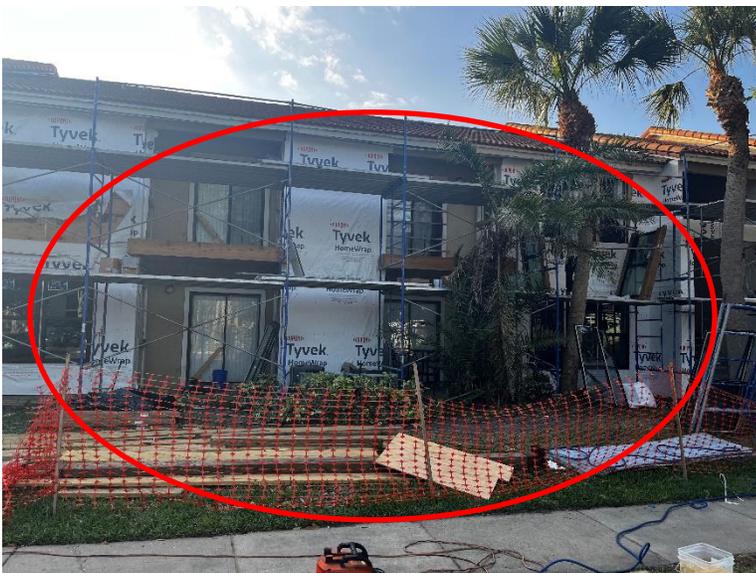

**BUILDING 11
SECTION B**

Contractor has applied new Tyvek HomeWrap WRB over new 15/32" plywood sheathing.

PHOTOGRAPH #21



**BUILDING 11
SECTION B**

New PGT windows installed with Dupont flashing as per manufacturers recommendation and drawings.

PHOTOGRAPH #22



**BUILDING 11
SECTION B-UNIT 1113**

Interior gap from window frame to head framing meets manufactures Max. 5/16" requirements


PHOTOGRAPH #23



**BUILDING 11
SECTION B- UNIT 1113**

Interior gap from window frame to jamb framing meets manufactures Max. 5/16" requirements.

PHOTOGRAPH #24

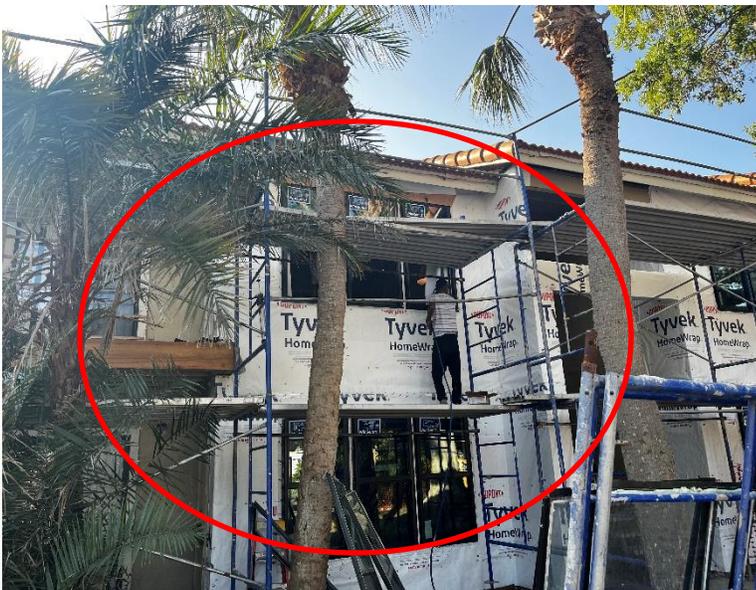

**BUILDING 11
SECTION A**

New PGT windows installed with Dupont flashing as per manufactures recommendation and drawings.

PHOTOGRAPH #25



**BUILDING 12
SECTION H**

Stucco sub-contractor applying brown coat of stucco over scratch coat.

PHOTOGRAPH #26



**BUILDING 12
SECTION H**

Stucco sub-contractor has completed application of full three coat 7/8" stucco system.

PHOTOGRAPH #27



**BUILDING 12
SECTION F**

Stucco sub-contractor has protected windows and applied scratch coat of stucco.

PHOTOGRAPH #28



**BUILDING 12
SECTION F**

Vinyl corner bead accessories fastened to framing at no more than 7" intervals.

PHOTOGRAPH #29



**BUILDING 12
SECTION F**

Stucco sub-contractor applying galvanized self-furring lathing and vinyl stucco accessories in preparation for stucco applications.