

PHOTOGRAPH #1



**BUILDING 11
SECTION D**

Stucco sub-contractor has protected new windows and adjacent surfaces with plastic and begun application of scratch coat of stucco.

PHOTOGRAPH #2



**BUILDING 11
SECTION D**

BROCO bag mix stucco mixed with sand on site.

PHOTOGRAPH #3



**BUILDING 11
SECTION D**

Stucco sub-contractor has applied scratch coat of stucco at gable end walls.

PHOTOGRAPH #4



**BUILDING 11
UNIT #1117- WATER TESTING**

Independent Testing Agency setting up for retesting double window that had previously failed testing.

PHOTOGRAPH #5



**BUILDING 11
UNIT #1117- WATER TESTING**

Independent Testing Agency performed water infiltration testing of window as per AAMA 502 specifications. Testing passed with no water observed.

PHOTOGRAPH #6



**BUILDING 11
UNIT #1127- ATTIC REPAIRS**

Contractor has performed scab repairs at damaged trusses.

PHOTOGRAPH #7



**BUILDING 11
UNIT #1127- ATTIC REPAIRS**

Contractor has performed gusset repairs where required at trusses as per repair drawings.

PHOTOGRAPH #8



**BUILDING 11
UNIT #1127- ATTIC REPAIRS**

Fire wall repairs had not been completed upon inspection.

PHOTOGRAPH #9



**BUILDING 11
UNIT #1127- ATTIC REPAIRS**

Contractor completed fire wall repairs upon notification of incomplete repairs.

PHOTOGRAPH #10



**BUILDING 11
UNIT #1125- ATTIC REPAIRS**

Contractor has performed scab repairs at damaged trusses.

PHOTOGRAPH #11



**BUILDING 11
UNIT #1125- ATTIC REPAIRS**

Contractor has performed firewall and fire sealants repairs at attic space firewalls.

PHOTOGRAPH #12



**BUILDING 11
UNIT #1112- WATER TESTING**

Independent Testing Agency performed water infiltration testing of window as per AAMA 502 specifications. Testing passed with no water observed.


PHOTOGRAPH #13



**BUILDING 11
UNIT #1112- WATER TESTING**

Independent Testing Agency performed water infiltration testing of window as per AAMA 502 specifications. Testing passed with no water observed

PHOTOGRAPH #14

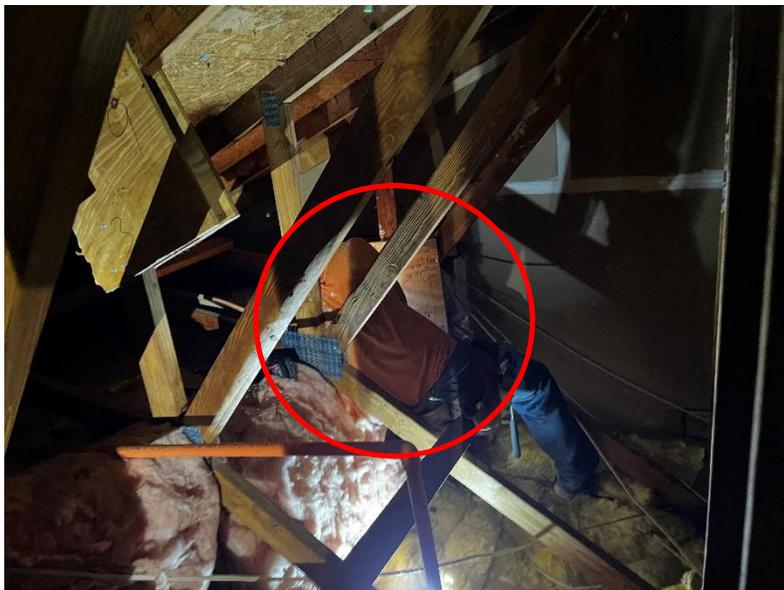

**BUILDING 11
UNIT #1126- ATTIC REPAIRS**

Contractor performing gusset repairs where required at trusses as per repair drawings.

PHOTOGRAPH #15



**BUILDING 11
UNIT #1126- ATTIC REPAIRS**

Previous gusset and framing repairs done by other contractors observed in one section of attic.

PHOTOGRAPH #16



**BUILDING 11
UNIT #1126- ATTIC REPAIRS**

Contractor has performed firewall and fire sealants repairs at attic space firewalls.

PHOTOGRAPH #17



**BUILDING 11
SECTION E**

Breezeway stairways primed with Florida Paint Epoxy primer.

PHOTOGRAPH #18



**BUILDING 12
SECTION D**

Contractor performing framing repairs and framing connectors as per drawings and specifications.

PHOTOGRAPH #19



**BUILDING 12
SECTION D**

5/8" Simpson Titen HD anchors installed at sill plate @ 24" O.C.

PHOTOGRAPH #20



**BUILDING 12
SECTION D**

Simpson MTS 18 connector strap has not been installed from Truss to Double Top plate and SDWC 15600 screws have not been installed with connectors at double top plate as per drawings and specifications.

PHOTOGRAPH #21



**BUILDING 12
SECTION D**

Simpson MST A49 and MST A36 framing connector straps have been installed as per drawings and specifications.

PHOTOGRAPH #22



**BUILDING 12
SECTION D**

Sealant installed at existing footing to sill plate and Copper Green wood preservative applied at framing as per drawings and specifications.