

PHOTOGRAPH #1



**BUILDING 11
SECTION A**

Stucco sub-contractor has completed full three coat 7/8" stucco system as per drawings and specifications.

PHOTOGRAPH #2



**BUILDING 11
SECTION B**

Stucco sub-contractor has completed full three coat 7/8" stucco system as per drawings and specifications.

PHOTOGRAPH #3



**BUILDING 11
SECTION C**

Stucco sub-contractor has applied scratch coat and in process of applying brown coat as per drawings and specifications.

PHOTOGRAPH #4



**BUILDING 11
SECTION D**

Stucco sub-contractor has completed full three coat 7/8" stucco system as per drawings and specifications.

PHOTOGRAPH #5



**BUILDING 11
SECTION E**

Sealant applied at new screen enclosure to stucco is poorly applied and required to be removed and replaced.

PHOTOGRAPH #6



**BUILDING 11
SECTION F**

Sealant applied at new screen enclosure to stucco is poorly applied and required to be removed and replaced.

PHOTOGRAPH #7



**BUILDING 11
SECTION F**

Contractor has not yet installed Simpson #SDW22458 screws @ ledger and corner blocking as per drawings.

PHOTOGRAPH #8



**BUILDING 11
SECTION H**

Stucco sub-contractor has completed full three coat 7/8" stucco system as per drawings and specifications.


PHOTOGRAPH #9



**BUILDING 12
SECTION D**

Bora Care termite treatment applied by pest contractor and new plywood sheathing in progress.

PHOTOGRAPH #10

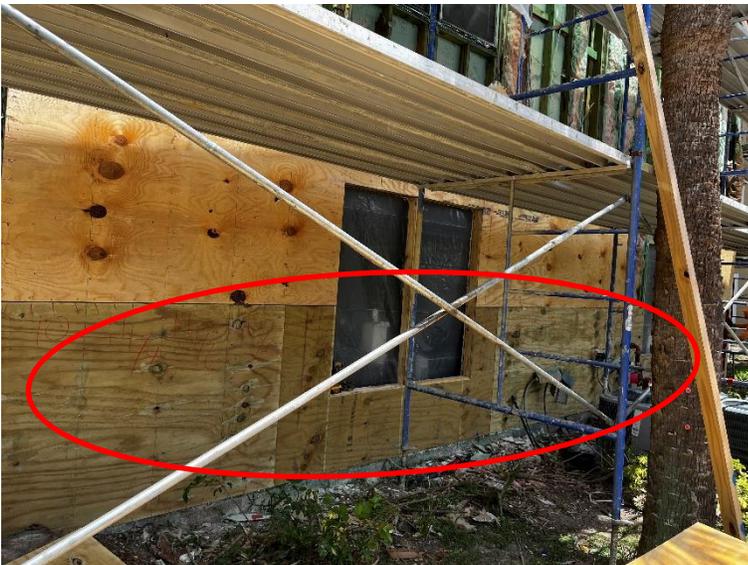

**BUILDING 12
SECTION D**

Contractor installing new pressure treated 15/32" plywood sheathing at bottom 4'X8' sheet as per specifications.

PHOTOGRAPH #11



**BUILDING 12
SECTION D**

Simpson MTS connector strap installed from Truss to Double Top plate and SDWC 15600 screws installed with connectors at double top plate as per drawings and specifications.

PHOTOGRAPH #12



**BUILDING 12
SECTION C**

Bora Care termite treatment applied by pest contractor and new insulation installed where missing or damaged.

PHOTOGRAPH #13



**BUILDING 12
SECTION C**

Contractor installing new Owens Corning insulation were missing or damaged as per contract and specifications.

PHOTOGRAPH #14



**BUILDING 12
SECTION C**

Contractor installing new Owens Corning insulation were missing or damaged as per contract and specifications.

PHOTOGRAPH #15



**BUILDING 12
SECTION B**

Bora Care termite treatment applied by pest contractor and Simpson MTS connector straps installed from Truss to Double Top plate and SDWC 15600 screws installed with connectors at double top plate as per drawings and specifications.

PHOTOGRAPH #16



**BUILDING 12
SECTION B**

Connector straps missed at return walls from studs to top plate and top plate to truss marked for correction.

PHOTOGRAPH #17



**BUILDING 12
SECTION B**

Contractor has installed connector straps missed at return walls from studs to top plate and top plate to truss.

PHOTOGRAPH #18



**BUILDING 9
SECTION E**

Contractor has mobilized repairs, provided access scaffolding, and removed balcony railings.

PHOTOGRAPH #19



**BUILDING 9
SECTION F**

Contractor has mobilized repairs, provided access scaffolding, and removed balcony railings.

PHOTOGRAPH #20



**BUILDING 9
SECTION F**

Contractor has removed stucco and sheathing exposing wall framing for repairs.

PHOTOGRAPH #21



**BUILDING 9
SECTION G**

Contractor has removed stucco and sheathing exposing wall framing for repairs.

PHOTOGRAPH #22



**BUILDING 9
SECTION H**

Contractor has removed stucco and sheathing exposing wall framing for repairs.