


PHOTOGRAPH #1



**BUILDING 11
SECTION A-BREEZEWAY**

Breezeway stair railings finish painted with Florida Paints urethane acrylic enamel.

PHOTOGRAPH #2

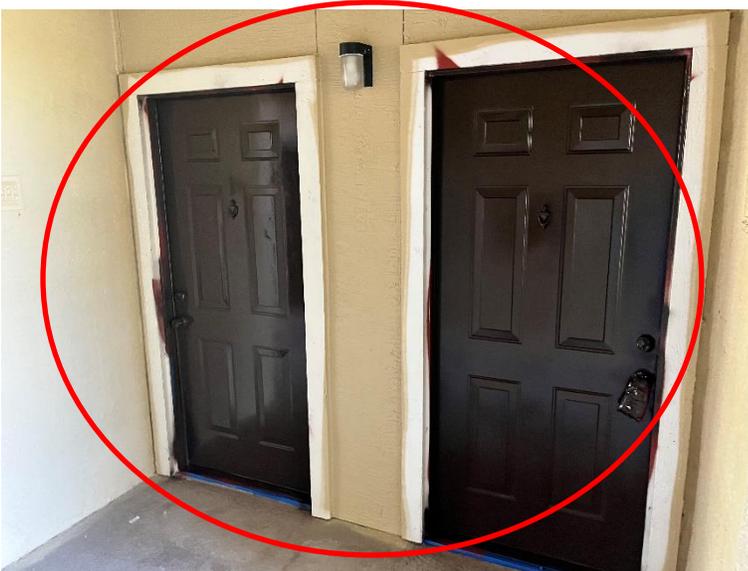

**BUILDING 11
SECTION A-BREEZEWAY**

Entrance doors spray painted with Florida Paints All Grip Semi-Gloss Exterior paint.

PHOTOGRAPH #3



**BUILDING 11
SECTION A-BREEZEWAY**

Entrance doors spray painted with Florida Paints All Grip Semi-Gloss Exterior paint.


PHOTOGRAPH #4



**BUILDING 11
SECTION A-BREEZEWAY**

Breezeway stairs painted with Florida Paints TropiCrete concrete sealer.

PHOTOGRAPH #5

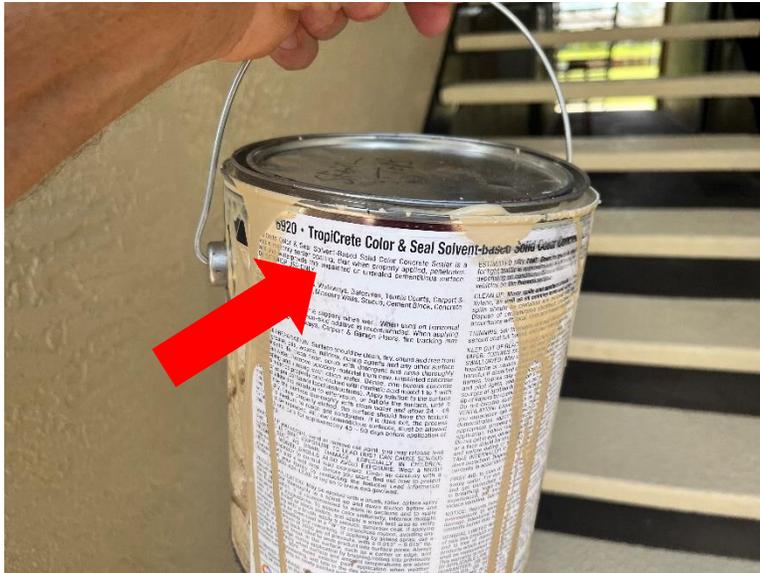

**BUILDING 11
SECTION A-BREEZEWAY**

Breezeway stairs painted with Florida Paints TropiCrete concrete sealer.

PHOTOGRAPH #6



**BUILDING 11
SECTION C- BREEZEWAY**

Breezeway stair railings finish painted with Florida Paints urethane acrylic enamel.


PHOTOGRAPH #7



**BUILDING 11
SECTION C- BREEZEWAY**

Deteriorated steel railings and pickets marked for welding repairs being performed by owner's contractor.


PHOTOGRAPH #8

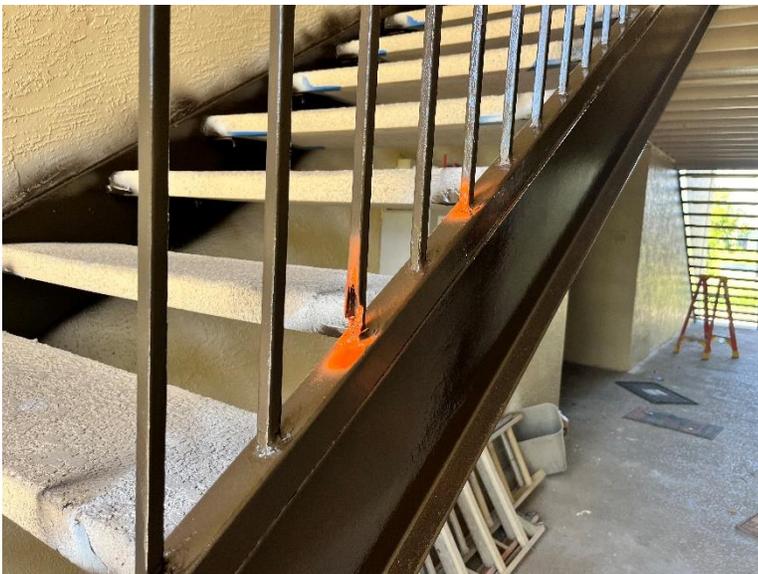

**BUILDING 11
SECTION C- BREEZEWAY**

Deteriorated steel railings and pickets marked for welding repairs being performed by owner's contractor.

PHOTOGRAPH #9

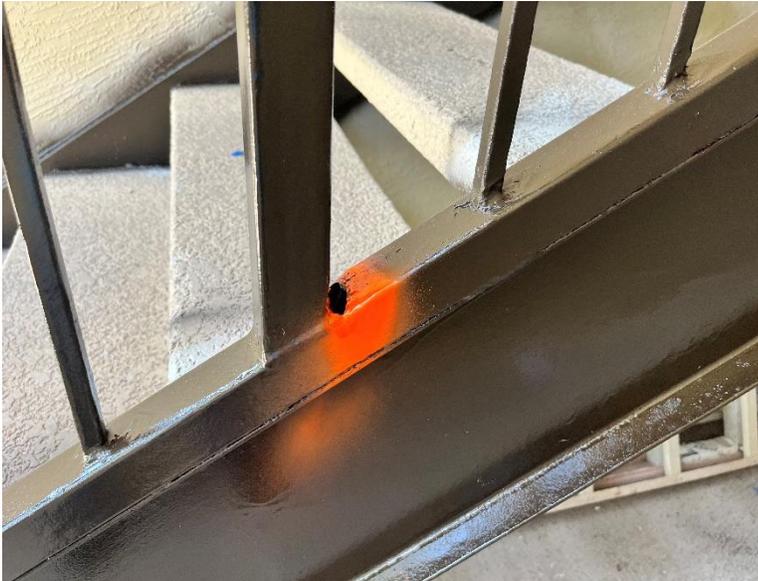

**BUILDING 11
SECTION C- BREEZEWAY**

Deteriorated steel railings and pickets marked for welding repairs being performed by owner's contractor.

PHOTOGRAPH #10



**BUILDING 12
SECTION A-UNIT 1221**

New PGT window still not installed due to homeowner availability.

PHOTOGRAPH #11



**BUILDING 12
SECTION C**

Stucco sub-contractor installing JumboTex-60 water resistant barrier and new vinyl stucco accessories at windows and control joints.


PHOTOGRAPH #12



**BUILDING 12
SECTION D**

Stucco sub-contractor installing JumboTex-60 water resistant barrier and new vinyl stucco accessories at windows and control joints.


PHOTOGRAPH #13

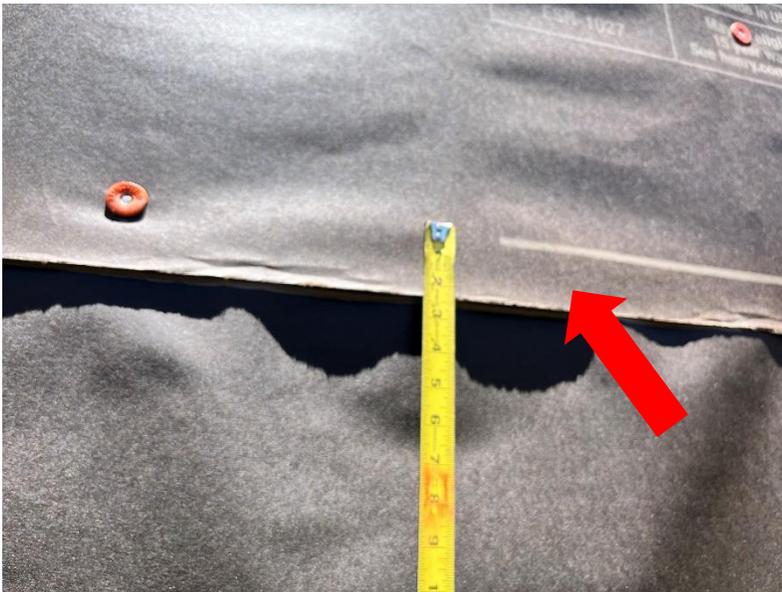

**BUILDING 12
SECTION D**

Minimum overlapping of 2" provided at Jumbo Tex water resistant barrier installed over new plywood sheathing.

PHOTOGRAPH #14

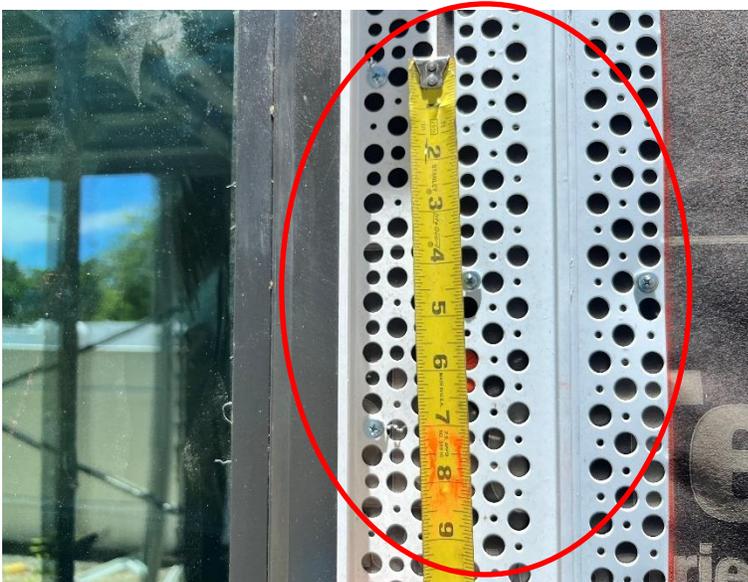

**BUILDING 12
SECTION D**

New vinyl stucco accessories attached to framing at no more than 7" intervals around window opening.

PHOTOGRAPH #15



**BUILDING 12
SECTION D**

AMICO V-grooved self-furred 2.5 lbs. galvanized metal lath delivered for installation.

PHOTOGRAPH #16



**BUILDING 9
SECTION F**

Contractor performing framing and balcony repairs.

PHOTOGRAPH #17



**BUILDING 9
SECTION F- UNIT 926**

Damaged wood decking and built-up beam at front face removed for replacement. Existing floor joists will remain.

PHOTOGRAPH #18



**BUILDING 9
SECTION F- UNIT 924**

Contractor replacing damaged built-up beam and balcony decking with pressure treated lumber as per drawings and specifications.

PHOTOGRAPH #19



**BUILDING 9
SECTION F-UNIT 924**

Contractor replacing damaged built-up beam and balcony decking with pressure treated lumber as per drawings and specifications.

PHOTOGRAPH #20



**BUILDING 9
SECTION H**

Contractor has begun framing repairs at plates and cripple studs between floors.