

PHOTOGRAPH #1



**BUILDING 12
SECTION A**

Painting in progress.

PHOTOGRAPH #2



**BUILDING 12
SECTION B**

Painting in progress.

PHOTOGRAPH #3



**BUILDING 12
SECTION C**

Painting in progress.

PHOTOGRAPH #4



**BUILDING 12
SECTION C**

Rust observed at bottom of stair railing picket.

PHOTOGRAPH #5



**BUILDING 12
SECTION C**

Rust and peeling paint observed at steel support for stairs.

PHOTOGRAPH #6



**BUILDING 9
SECTION H**

Installation of stucco lath and accessories in progress.

PHOTOGRAPH #7



**BUILDING 9
SECTION H**

Installation of stucco lath and accessories in progress.


PHOTOGRAPH #8



**BUILDING 9
SECTION H**

Contractor attaching stucco lath with 8x1-1/2" metal screws spaced at 16" O.C. in the horizontal directions and 7" O.C. in the vertical directions.

PHOTOGRAPH #9

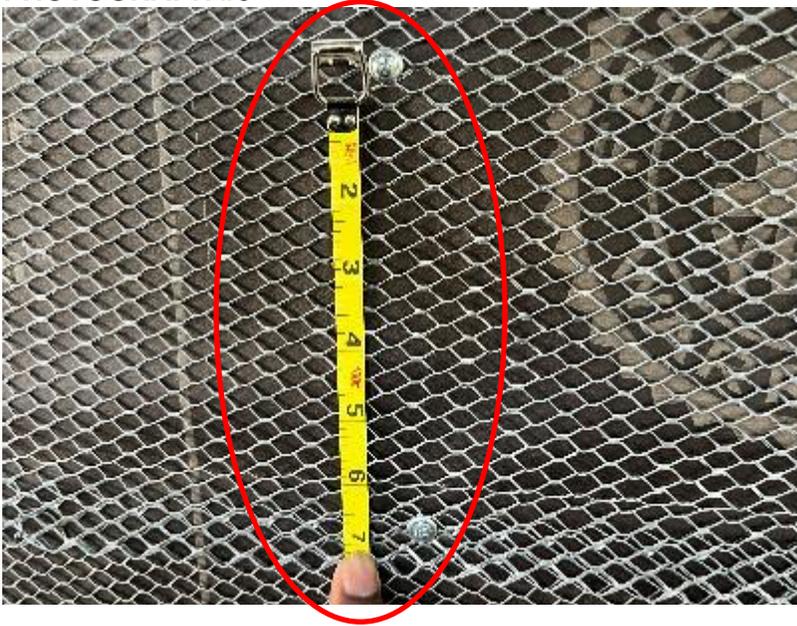

**BUILDING 9
SECTION H**

Contactor attaching stucco lath with 8x1-1/2" metal screws spaced at 16" O.C. in the horizontal directions and 7" O.C. in the vertical directions.

PHOTOGRAPH #10



**BUILDING 9
SECTION H**

Contactor attaching stucco lath with 8x1-1/2" metal screws spaced at 16" O.C. in the horizontal directions and 7" O.C. in the vertical directions.

PHOTOGRAPH #11



**BUILDING 9
SECTION H**

Water testing of single panel window conducted at unit #912. The window passed the water test.

PHOTOGRAPH #12



**BUILDING 9
SECTION H**

Water testing of single panel window conducted at unit #912. The window passed the water test.

PHOTOGRAPH #13



**BUILDING 9
SECTION G**

Section loss and hole at stair picket railing.

PHOTOGRAPH #14



**BUILDING 9
SECTION G**

Water testing of double panel window
conducted at unit #912.

PHOTOGRAPH #15



**BUILDING 9
SECTION G**

Water testing of double panel window conducted at unit #912.

PHOTOGRAPH #16



**BUILDING 9
SECTION G**

Water testing of double panel window conducted at unit #912:

During the water testing, water droplets were observed at the upper left seam of window frame. Water test failed.

PHOTOGRAPH #17



**BUILDING 9
SECTION G**

Installation of Super Jumbo Tex Weather-Resistive Barrier and stucco accessories in progress.

PHOTOGRAPH #18



**BUILDING 9
SECTION G**

Installation of Super Jumbo Tex Weather-Resistive Barrier and stucco accessories in progress.

PHOTOGRAPH #19



**BUILDING 9
SECTION D**

While nailing the strapping the contractor accidentally hit the main water line.

PHOTOGRAPH #20



**BUILDING 9
SECTION D**

While nailing the strapping the contractor accidentally hit water line.

PHOTOGRAPH #21



**BUILDING 9
SECTION D – UNIT #917**

Water intrusion observed at unit #917.

PHOTOGRAPH #22



**BUILDING 9
SECTION D**

Strapping, Simpson Strong connector applications and BoraCare Termite treatment performed in preparation for new sheathing:

Strapping nailing in progress.

PHOTOGRAPH #23



**BUILDING 9
SECTION D**

Strapping, Simpson Strong connector applications and BoraCare Termite treatment performed in preparation for new sheathing:

Strapping nailing in progress.

PHOTOGRAPH #24



**BUILDING 9
SECTION D**

Contractor has applied Copper Green wood preservative at lower two feet of wood framing as per specifications.

PHOTOGRAPH #25



**BUILDING 9
SECTION D**

Contractor has applied Copper Green wood preservative at lower two feet of wood framing as per specifications.

PHOTOGRAPH #26



**BUILDING 9
SECTION D**

Installation Simpson Strong connectors in progress.

PHOTOGRAPH #27



**BUILDING 9
SECTION D**

Installation Simpson Strong connectors in progress.

PHOTOGRAPH #28



**BUILDING 9
SECTION D**

Subcontractor applying BoraCare Termite treatment to framing.

PHOTOGRAPH #29



**BUILDING 9
SECTION D**

Subcontractor applying BoraCare Termite treatment to framing.

PHOTOGRAPH #30



**BUILDING 9
SECTION C**

Strapping, Simpson Strong connector applications and BoraCare Termite treatment performed in preparation for new sheathing:

Strapping nailing in progress.

PHOTOGRAPH #31



**BUILDING 9
SECTION C**

Strapping, Simpson Strong connector applications and BoraCare Termite treatment performed in preparation for new sheathing:

Strapping nailing in progress.

PHOTOGRAPH #32



**BUILDING 9
SECTION C**

Installation Simpson Strong connectors in progress.

PHOTOGRAPH #33



**BUILDING 9
SECTION C**

Installation Simpson Strong connectors in progress.
Contractor installing Simpson Strong-Tie SP1 at stud frames.

PHOTOGRAPH #34



**BUILDING 9
SECTION B**

Nailing of strapping in progress.

PHOTOGRAPH #35



**BUILDING 9
SECTION B**

Nailing of strapping in progress.

PHOTOGRAPH #36



**BUILDING 9
SECTION A**

Nailing of strapping in progress.

PHOTOGRAPH #37



**BUILDING 9
SECTION A**

Contractor has applied Copper Green wood preservative at lower two feet wood framing per specifications.