

PHOTOGRAPH #1



**BUILDING 12
SECTION A**

Balcony railings installed.

PHOTOGRAPH #2



**BUILDING 12
SECTION A**

Clean up of grounds has been performed.

PHOTOGRAPH #3



**BUILDING 12
SECTION A**

Simpson Strong Tie Screws and connector hardware has not yet been installed at the built-up beam.

PHOTOGRAPH #4



**BUILDING 12
SECTION B**

Balcony railing being installed with 4" galvanized fasteners as per drawings.

PHOTOGRAPH #5



**BUILDING 12
SECTION B**

Balcony railing being installed with 4" galvanized fasteners as per drawings

PHOTOGRAPH #6



**BUILDING 12
SECTION B**

Balcony railing being installed with 4" galvanized fasteners as per drawings.

PHOTOGRAPH #7



**BUILDING 12
SECTION C**

Walkway stucco walls have been painted.
Front doors have not been painted.

PHOTOGRAPH #8



**BUILDING 12
SECTION C**

Simpson Strong Tie Screws and
connector hardware has not yet been
installed at the built-up beam

PHOTOGRAPH #9



**BUILDING 12
SECTION C- UNIT 1227**

Water testing performed by independent testing agency and passed in accordance with AAMA 502.

PHOTOGRAPH #10



**BUILDING 12
SECTION C- UNIT 1227**

Water testing performed by independent testing agency and passed in accordance with AAMA 502.


PHOTOGRAPH #11



**BUILDING 12
SECTION D-UNIT 1218**

Water testing performed by independent testing agency and passed in accordance with AAMA 502.

PHOTOGRAPH #12

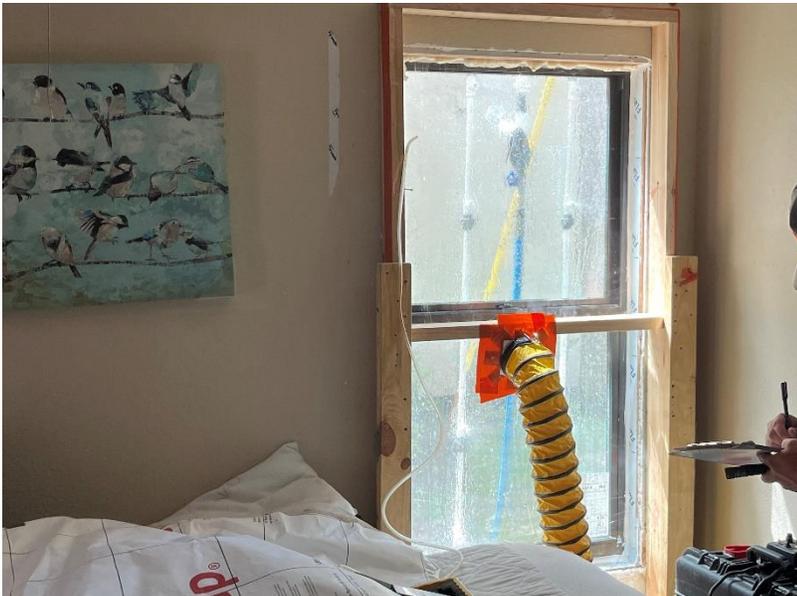

**BUILDING 12
SECTION D-UNIT 1218**

Water testing performed by independent testing agency and passed in accordance with AAMA 502.

PHOTOGRAPH #13



**BUILDING 12
SECTION E-UNIT 1218**

Contractor performing drywall and windowsill repairs at new window openings.

PHOTOGRAPH #14



**BUILDING 12
SECTION G-UNIT 1214**

New sealant applied at new Dupont sill flashing to new PGT window as per manufacturer's instruction and drawings.

PHOTOGRAPH #15



**BUILDING 9
SECTION H**

Stucco Sub-contractor applying new three coat 5/8" stucco system as per ASTM C926.

PHOTOGRAPH #16



**BUILDING 9
SECTION G**

Finish coat of stucco texture applied.

PHOTOGRAPH #17



**BUILDING 9
SECTION G**

Brocco stucco bag mix and sand being mixed on site.


PHOTOGRAPH #18



**BUILDING 9
SECTION F**

New self-furring metal lath and vinyl stucco accessories completed, and new windows protected with plastic cover.

PHOTOGRAPH #19

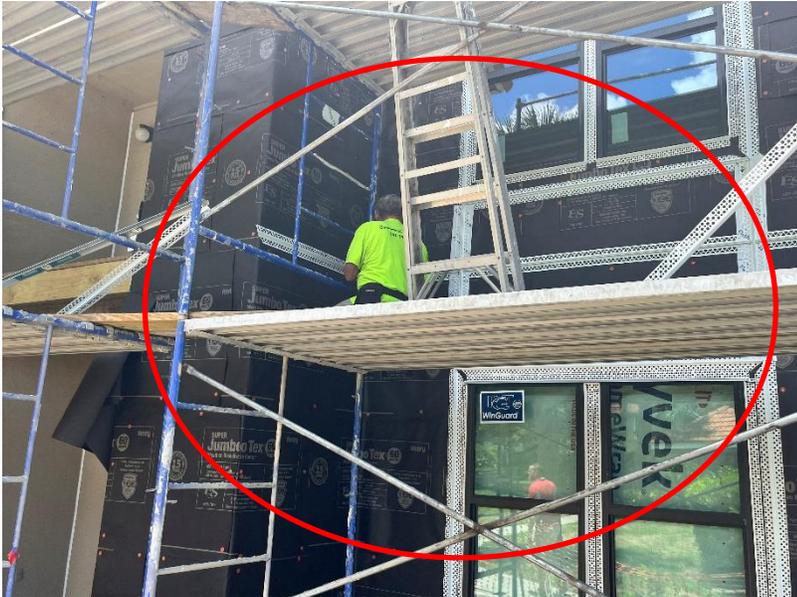

**BUILDING 9
SECTION E**

Sub-contractor installing new control joint accessories over Jumbo Tex WRB.

PHOTOGRAPH #20



**BUILDING 9
SECTION D**

Tyvek HomeWrap applied over new plywood sheathing and new PGT windows installed as per drawings.


PHOTOGRAPH #21



**BUILDING 9
SECTION D**

Contractor installing head flashing detail over electrical panels as per drawings.

PHOTOGRAPH #22

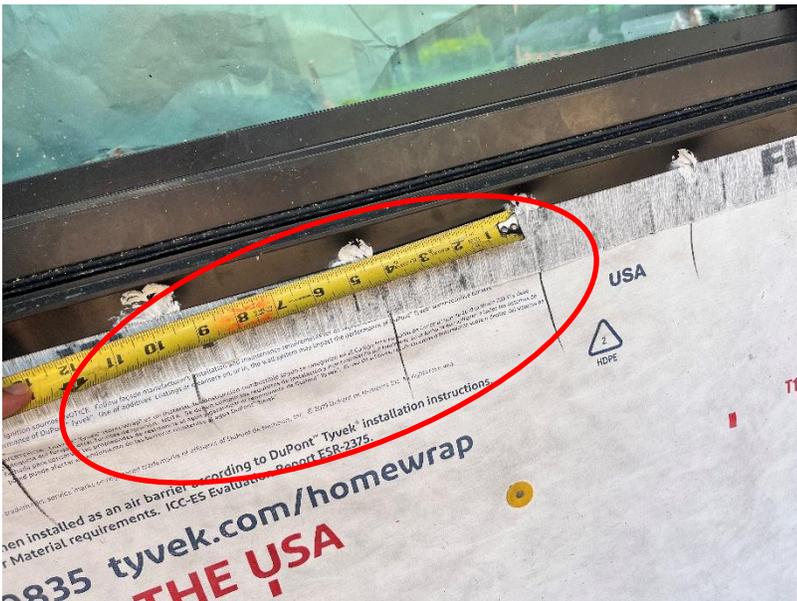

**BUILDING 9
SECTION D**

New PGT window attached at fin at 5" O.C with 8d common nails as per drawings.

PHOTOGRAPH #23



**BUILDING 9
SECTION C- UNIT 917**

Gap between 2X wood studs and window frame does not exceed the allowed 5/16" max. gap as per drawings.

PHOTOGRAPH #24



**BUILDING 9
SECTION C-UNIT 917**

Gap between 2X wood studs and window frame does not exceed the allowed 5/16" max. gap as per drawings.

PHOTOGRAPH #25



**BUILDING 9
SECTION A**

Contractor installing R-16 insulation where missing or damaged.

PHOTOGRAPH #26



**BUILDING 9
SECTION A**

Contractor installing 15/32 exterior rated plywood sheathing.

PHOTOGRAPH #27



**BUILDING 9
SECTION A**

Contractor installing 15/32 exterior rated plywood sheathing fastened with 0.113" x 2-3/8" electro galvanized ring shank nails at framing studs.

PHOTOGRAPH #28



**BUILDING 9
SECTION A**

New plywood soffit and vinyl soffit screen installed as per specifications.

PHOTOGRAPH #29



**BUILDING 15
SECTION H**

Framing damaged marked for repairs at 2nd floor top plate and bottom cord of roof truss.

PHOTOGRAPH #30



**BUILDING 15
SECTION H**

Roof sheathing damage observed to be repaired by owners roofing contractor.

PHOTOGRAPH #31



**BUILDING 15
SECTION G**

Framing damage marked for repairs at bottom plate and window framing.

PHOTOGRAPH #32



**BUILDING 15
SECTION G**

Framing damage marked for repairs at breezeway post.

PHOTOGRAPH #33



**BUILDING 15
SECTION G- UNIT 1522**

Damaged built up beam and three deck boards marked for repairs.

PHOTOGRAPH #34



**BUILDING 15
SECTION F- UNIT 1526**

Damaged built up beam and all deck boards marked for repairs.

PHOTOGRAPH #35



**BUILDING 15
SECTION F**

Framing damage marked for repairs at windows triple header.

PHOTOGRAPH #36



**BUILDING 15
SECTION E**

Framing damage marked for full repairs at breezeway.

PHOTOGRAPH #37



**BUILDING 15
SECTION E**

Framing damage marked for repairs at windows double header and windows studs.