

PHOTOGRAPH #1



**BUILDING 12
SECTION A**

Patio screen enclosures being installed.

PHOTOGRAPH #2



**BUILDING 12
SECTION A**

Contractor performing additional rust removal as marked on breezeway railings.

PHOTOGRAPH #3



**BUILDING 12
SECTION A**

Contractor applying Florida Paints HI-Performance urethane enamel at breezeway railings.

PHOTOGRAPH #4



**BUILDING 12
SECTION A**

Contractor applying Florida Paints HI-Performance urethane enamel at breezeway railings.

PHOTOGRAPH #5



**BUILDING 12
SECTION A**

Contractor has painted stucco wall and front doors at breezeway areas.

PHOTOGRAPH #6



**BUILDING 12
SECTION B**

Patio screen enclosures have been installed.

PHOTOGRAPH #7



**BUILDING 12
ATTIC REPAIRS - UNIT 1225**

Contractor has performed scab repairs at damaged trusses as per drawings.

PHOTOGRAPH #8



**BUILDING 12
ATTIC REPAIRS - UNIT 1225**

Contractor has performed gusset repairs at truss intersections as per drawings.

PHOTOGRAPH #9



**BUILDING 12
ATTIC REPAIRS - UNIT 1225**

Contractor has multiple fire wall repairs as per specifications.

PHOTOGRAPH #10



**BUILDING 12
SECTION C- UNIT#1217**

New PGT window is cracked and will require replacement.

PHOTOGRAPH #11



**BUILDING 12
ATTIC REPAIRS - UNIT 1227**

Contractor has performed gusset repairs at truss intersections as per drawings.

PHOTOGRAPH #12



**BUILDING 12
ATTIC REPAIRS - UNIT 1227**

Contractor has performed scab repairs at damaged trusses as per drawings.

PHOTOGRAPH #13



**BUILDING 12
ATTIC REPAIRS - UNIT 1227**

Contractor has performed fire caulk repairs at fire wall penetrations.

PHOTOGRAPH #14



**BUILDING 12
SECTION G-UNIT 1212**

Screen enclosure installed but door framing has not been repaired.

PHOTOGRAPH #15



**BUILDING 9
SECTION H**

Stucco Sub-contractor has completed new three coat 5/8" stucco system as per ASTM C926.


PHOTOGRAPH #16



**BUILDING 9
SECTION F**

Kick out flashing detail is incomplete at transition tie into existing roofing.


PHOTOGRAPH #17

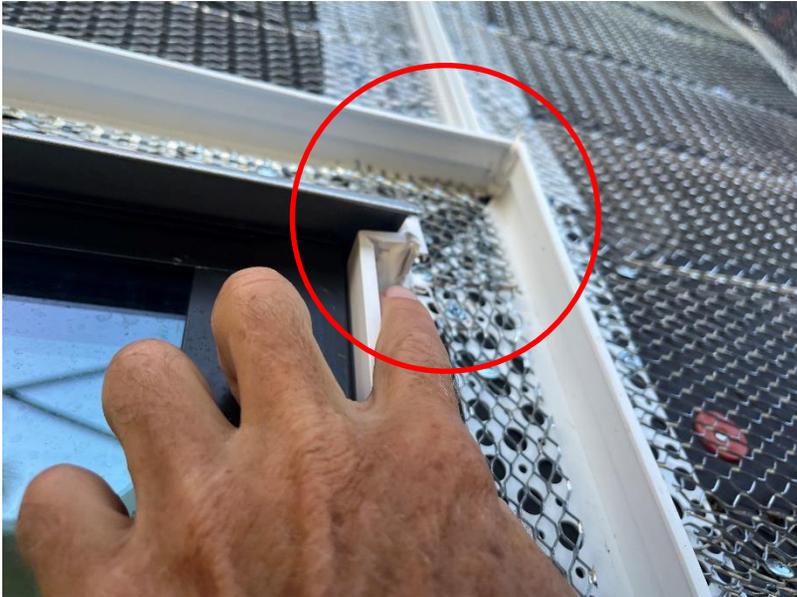

**BUILDING 9
SECTION F**

Stucco sub-contractor has sealed vinyl stucco accessories with fast cure urethane sealant as per drawings.

PHOTOGRAPH #18

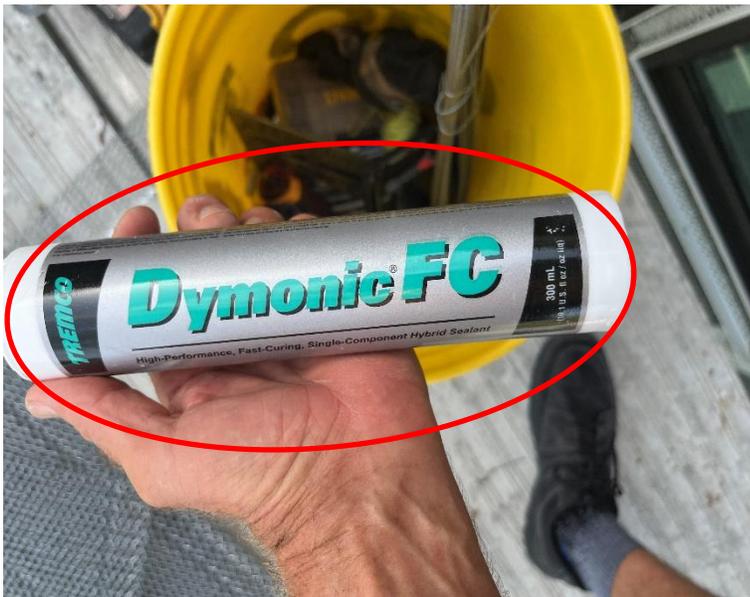

**BUILDING 9
SECTION F**

Stucco sub-contractor has sealed vinyl stucco accessories with fast cure urethane sealant as per drawings.

PHOTOGRAPH #19



**BUILDING 9
SECTION E**

Sub-contractor has installed Dupont Flashing behind vertical control joints as per drawings.

PHOTOGRAPH #20



**BUILDING 9
SECTION D**

Sub-contractor applying Henry Jumbo-Tex 60 water resistant barrier as per specifications.

PHOTOGRAPH #21



**BUILDING 9
SECTION D**

Sub-contractor applying Henry Jumbo-Tex 60 water resistant barrier as per specifications.

PHOTOGRAPH #22



**BUILDING 9
SECTION C**

Vinyl weep stucco accessory installed at base of wall and flashed with Dupont Flashing Tape as per drawings.


PHOTOGRAPH #23



**BUILDING 15
SECTION G**

Framing damaged repaired at 2nd floor window framing studs.

PHOTOGRAPH #24

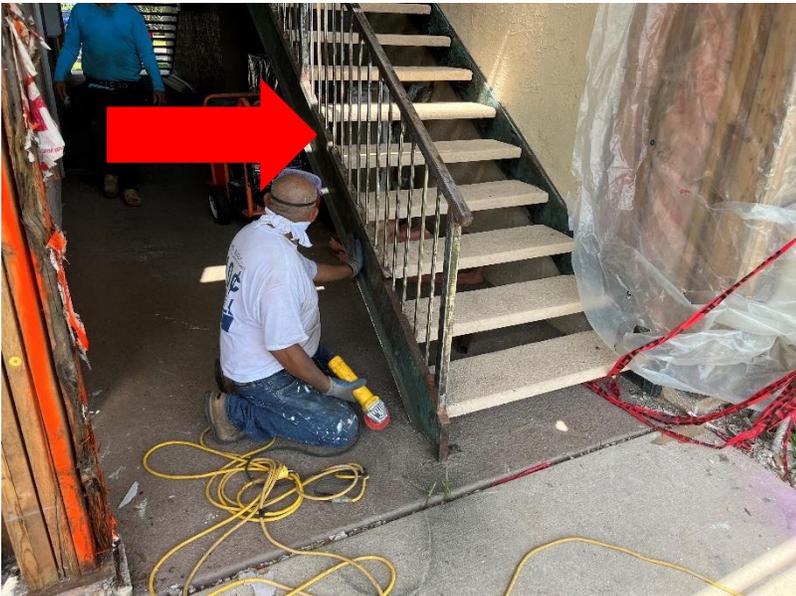

**BUILDING 15
SECTION G**

Surface preparation with hand grinders in progress at breezeway stairways.

PHOTOGRAPH #25



**BUILDING 15
SECTION F**

Built up beam and deck repairs performed at 2nd floor balconies.

PHOTOGRAPH #26



**BUILDING 15
SECTION F – UNIT #1524**

Built up beam repair performed at balcony as per drawings and specifications.

PHOTOGRAPH #27



**BUILDING 15
SECTION F – UNIT #1526**

Built up beam repair and full deck board replacement performed at balcony as per drawings and specifications.

PHOTOGRAPH #28



**BUILDING 15
SECTION B**

New southern pine 2x4 studs and pressure treated 2X10 lumber delivered for repairs.