

PHOTOGRAPH #1



**BUILDING 12
SECTION A-BREEZEWAY**

Flooring coated with Florida Paints TropiCrete Concrete Sealer.

PHOTOGRAPH #2



**BUILDING 12
SECTION A-BREEZEWAY**

Flooring coated with Florida Paints TropiCrete Concrete Sealer.

PHOTOGRAPH #3



**BUILDING 12
ATTIC REPAIRS - UNIT #1228**

Contractor has performed scab repairs at damaged trusses as per drawings.

PHOTOGRAPH #4



**BUILDING 12
ATTIC REPAIRS - UNIT #1228**

Contractor has performed fire caulk repairs at penetration of fire wall.

PHOTOGRAPH #5



**BUILDING 12
ATTIC REPAIRS - UNIT #1226**

Contractor has multiple fire wall repairs as per specifications.

PHOTOGRAPH #6



**BUILDING 12
ATTIC REPAIRS - UNIT #1226**

Contractor has performed scab repairs at damaged trusses as per drawings.

PHOTOGRAPH #7



**BUILDING 12
ATTIC REPAIRS - UNIT #1224**

Contractor has performed scab repairs at damaged trusses as per drawings.

PHOTOGRAPH #8



**BUILDING 12
ATTIC REPAIRS - UNIT #1224**

Contractor has multiple fire wall repairs as per specifications.

PHOTOGRAPH #9



**BUILDING 12
SECTION F**

Contractor has installed new screen enclosures at lower patios.


PHOTOGRAPH #10



**BUILDING 12
SECTION F**

Shuffleboard court stained by contractor covering and painting of railings.

PHOTOGRAPH #11

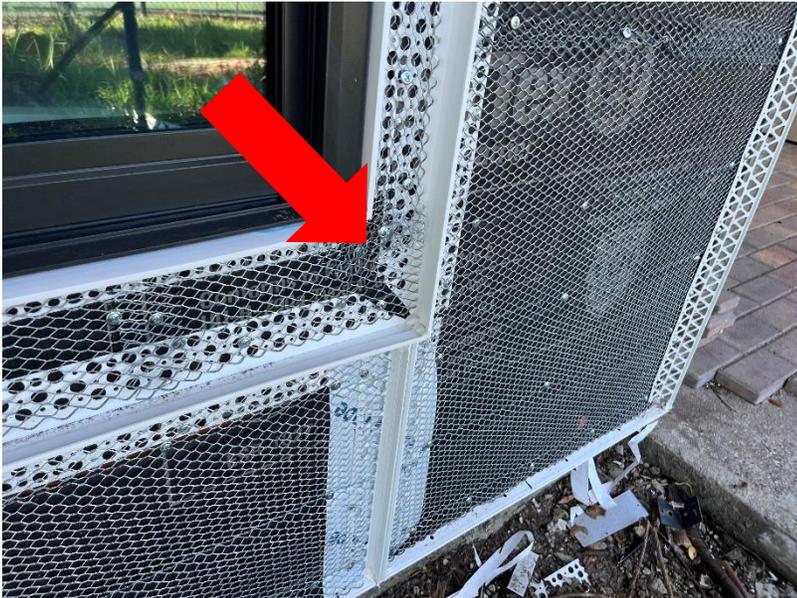

**BUILDING 9
SECTION E**

Stucco Sub-contractor has installed metal lath butterfly fastened to self-furring metal lath at each corner of windows as per drawings.

PHOTOGRAPH #12



**BUILDING 9
SECTION D**

Sub-contract has applied new vinyl stucco accessories and self-furring metal lath per ASTM C1063 for application of stucco.

PHOTOGRAPH #13



**BUILDING 9
SECTION C**

Sub-contract has applied new Jumbo Tex WRB and vinyl stucco accessories over Tyvek water resistant barrier.

PHOTOGRAPH #14



**BUILDING 15
SECTION H**

Gable end wall bracing repairs in progress.

PHOTOGRAPH #15



**BUILDING 15
SECTION H**

2x4 bracing @48" O.C. as per drawings and details.

PHOTOGRAPH #16



**BUILDING 15
SECTION H**

2x6 L-Scab reinforcement fastened with 10d nails at 6" O.C. as per drawings.

PHOTOGRAPH #17



**BUILDING 15
SECTION H**

Simpson #LSTA-21 strap at end of lateral braces as per drawings.

PHOTOGRAPH #18



**BUILDING 15
SECTION H**

Simpson #HGA10 attaching gable truss to plate as per drawings.

PHOTOGRAPH #19



**BUILDING 15
SECTION H**

Bottom plate fastened into existing footing with 5/8" Simpson Titen HD @ 24" O.C. as per drawings.

PHOTOGRAPH #20



**BUILDING 15
SECTION H**

Simpson MSTA 36 straps fastened from framing studs to second floor bottom plate and floor truss as per drawings.

PHOTOGRAPH #21



**BUILDING 15
SECTION H**

New urethane sealant from bottom plate to existing footing and copper green wood preservative applied at bottom 2' of framing as per drawings and specifications.

PHOTOGRAPH #22



**BUILDING 15
SECTION G**

Copper green wood preservative applied at bottom 2' of framing as per drawings and specifications.

PHOTOGRAPH #23



**BUILDING 15
SECTION G-UNIT #1522**

New PT. 2x6 deck board replaced at balcony deck were marked for repairs.

PHOTOGRAPH #24



**BUILDING 15
SECTION G**

Contractor has provided Simpson Strong-Tie MSTA straps at framing between floors as per drawings.