

**PHOTOGRAPHS**

**PHOTOGRAPH #1**



**BUILDING 6  
SECTION E**

Contractor installed PGT windows and verified WOCDs are installed on windows for second floor.

**PHOTOGRAPH #2**



**BUILDING 6  
SECTION F**

Contractor installed PGT windows and verified WOCDs are installed on windows for second floor.

**PHOTOGRAPH #3**



**BUILDING 6  
SECTION G**

Contractor installed PGT windows and verified WOCDs are installed on windows for second floor.

**PHOTOGRAPH #4**



**BUILDING 6  
SECTION G**

Contractor installed Dupont Flashing Tape at window head and extended 12".

**PHOTOGRAPH #5**



**BUILDING 6  
SECTION G**

Contractor installed Dupont Flashing Tape at window and extended 6" below.

**PHOTOGRAPH #6**



**BUILDING 6  
SECTION G**

Contractor installed L-flashing behind Tyvek with sealant per the construction drawings.

**HOTOGRAPH #7**



**BUILDING 6  
SECTION G**

Contractor installed windows and covered fasteners with MasterSeal NP 150.

**PHOTOGRAPH #8**



**BUILDING 6  
SECTION G**

Contractor installed new soffit and applied caulk to fill seams and nail holes.

**PHOTOGRAPH #9**



**BUILDING 3  
SECTION H**

Stucco Sub-contractor installed stucco accessories and is ready for stucco application.


**PHOTOGRAPH #10**



**BUILDING 3  
SECTION H**

Lath fasteners are spaced 6" on-center.


**PHOTOGRAPH #11**

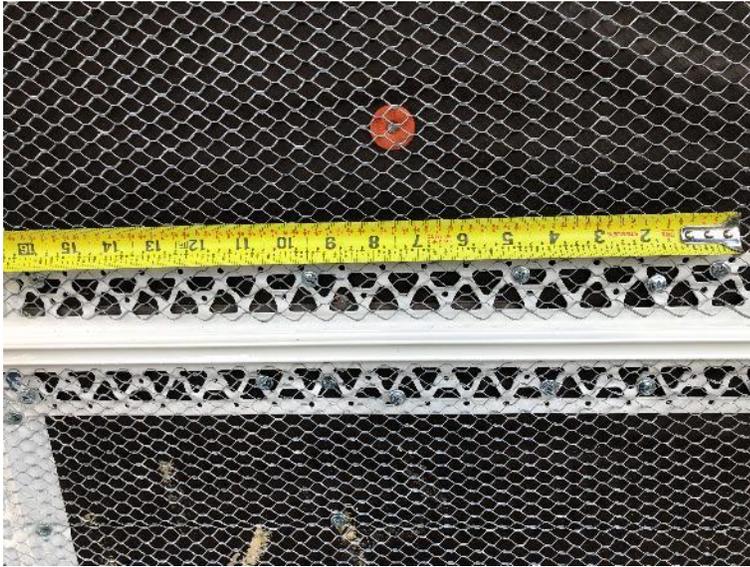

**BUILDING 3  
SECTION H**

Stucco accessories are fastened within 7" on-center.

**PHOTOGRAPH #12**

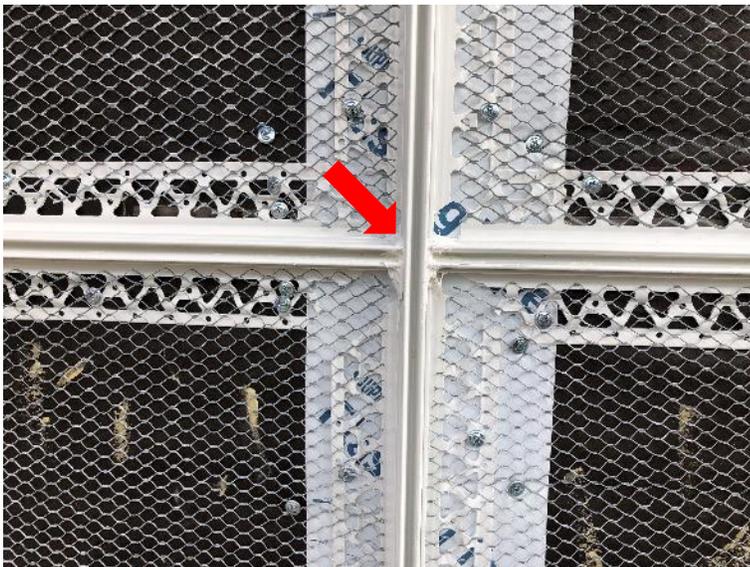

**BUILDING 3  
SECTION H**

MasterSeal NP 150 sealant was applied to accessory ends, corners, and intersections.


**PHOTOGRAPH #13**



**BUILDING 3  
SECTION H**

Protrusions have been flashed and sealed per the contract drawings.

**PHOTOGRAPH #14**

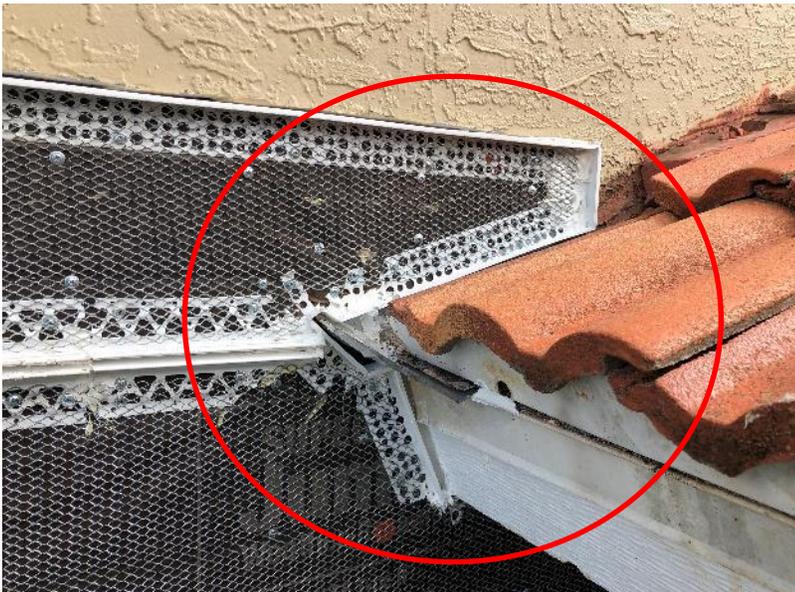

**BUILDING 3  
SECTION H**

Kickout flashing and accessories have been installed per the contract drawings.

**PHOTOGRAPH #15**



**BUILDING 3  
SECTION G**

Stucco Sub-contractor overlapped lath 2" minimum per the construction drawings and installed tie wire between fasteners.

**PHOTOGRAPH #16**



**BUILDING 3  
SECTION F**

Stucco Sub-contractor installing lath with fasteners 6" on-center.

**PHOTOGRAPH #17**



**BUILDING 3  
SECTION E**

Stucco Sub-contractor installing Super JumboTex 60 Minute Weather-Resistive Barrier.

**PHOTOGRAPH #18**



**BUILDING 3  
SECTION E**

Stucco Sub-contractor provided over 2" horizontal overlap and 6" minimum vertical overlap.

**PHOTOGRAPH #19**



**BUILDING 3  
SECTION D**

Contractor to install sheathing and Tyvek weather barrier.

**PHOTOGRAPH #20**



**BUILDING 3  
SECTION B**

Contractor painted underside of balconies with Florida Paints Ultra Exterior Supercoat.

**PHOTOGRAPH #21**



**BUILDING 3  
SECTION B**

Contractor painted underside of balconies with Florida Paints Ultra Exterior Supercoat.